



DEPARTMENT OF THE NAVY
VICE CHIEF OF NAVAL OPERATIONS
2000 NAVY PENTAGON
WASHINGTON DC 20350-2000

5830
Ser N09/22U100552
13 Jun 22

FINAL ENDORSEMENT on RDML Christopher J. Cavanaugh, USN ltr 5830 of 14 Jan 22

From: Vice Chief of Naval Operations
To: File

Subj: COMMAND INVESTIGATION INTO THE 6 MAY 2021 AND 20 NOVEMBER 2021
INCIDENTS AT RED HILL BULK FUEL STORAGE FACILITY

Encl: (1) RADM James Waters, USN, ltr 5830 of 14 Apr 22
(2) Commander, U.S. Pacific Fleet Task Order of 262215ZAPR22

1. I reviewed the subject investigation (Cavanaugh report) as supplemented by Enclosure (1) along with the first endorsement and related comments. The contamination of drinking water from the Red Hill Shaft was the result of the Navy's ineffective immediate responses to the 6 May and 20 November 2021 fuel releases at the Red Hill Bulk Fuel Storage Facility (Red Hill), and failure to resolve with urgency deficiencies in system design and construction, system knowledge, and incident response training. These deficiencies endured due to seams in accountability and a failure to learn from prior incidents that falls unacceptably short of Navy standards for leadership, ownership, and the safeguarding of our communities.

2. This investigation characterizes the primary and proximate factors that caused the 2021 events, providing the foundation for a comprehensive approach to safeguarding the environment and executing the Secretary of Defense's decision to defuel Red Hill. I approve the findings of fact, opinions, and recommendations of both investigating officers as modified by the first endorsement and the following:

a. Opinion 18 is modified to delete the phrase "as a formal release notice" from the second sentence of the opinion.

b. Recommendations 35, 43 and 49 of the Cavanaugh report are modified to read: "Review the expired DLA-NAVSUP, NAVSUP-CNIC, NAVSUP-NAVFAC, and DLA-NAVFAC MOAs and establish a comprehensive five-party MOA between DLA-Energy, NAVSUP, NAVFAC, CNIC and U.S. Army Corps of Engineers regarding roles and responsibilities, including the assignment of Engineering Agents and appropriate Programmatic Authority informed by the Deputy Chief of Naval Operations for Fleet Readiness and Logistics' review of Shore command and control."

c. The following Cavanaugh report enclosures are updated:

Subj: COMMAND INVESTIGATION INTO THE 6 MAY 2021 AND 20 NOVEMBER 2021 INCIDENTS AT RED HILL BULK FUEL STORAGE FACILITY

(1) Enclosure (39) is updated to OPNAVINST 5450.348A, Mission, Functions, and Tasks of Commander, Naval Facilities Engineering Systems Command, dtd 23 Jun 2021.

(2) Enclosure (268) is updated to OPNAVINST 5450.339, Mission, Functions, and Tasks of Commander, Navy Installations Command, dtd 21 Apr 2011.

3. This report and endorsement are provided to the Navy Learning to Action Board (L2AB) to track implementation of, and continuing adherence to, the key recommendations from this investigation. The L2AB will also track the ongoing immediate actions highlighted below.

4. The immediate actions directed by the first endorsement and elsewhere provide interim risk control/solutions while deeper assessments are conducted. These include:

a. Commander, U.S. Pacific Fleet's Task Order on Red Hill Command and Control (Enclosure (2)) provides interim C2 structure. In addition to clarifying Red Hill command and control/accountability, the Task Order directs units responsible for specific aspects of Red Hill to implement corrective actions within specified time frames across the scope of recommendations contained in the Cavanaugh Report and Enclosure (1).

b. Deputy Chief of Naval Operations for Fleet Readiness and Logistics (OPNAV N4) review of all Navy Shore Command and Control to probe for other instances of the overly complex command and control structure identified in this report. This task includes review of the interim Red Hill command and control structure established by Commander, U.S. Pacific Fleet.

c. OPNAV N4 assessment of the material, operational and incident response readiness at all Navy Managed Defense Fuel Support Points.

d. NAVIG assessment of Echelon II Inspector General offices and development of a clear standard for follow-up of non-fully compliant assessments.

e. Environmental Director, Commander Navy Region Hawaii, Site Characterization Plan update based on the 22 April 2022 notification to DOH.

5. By separate letter, I designated Commander, U.S. Fleet Forces as the Consolidated Disposition Authority (CDA) to address any administrative or disciplinary actions as appropriate relating to military members identified in this investigation. The CDA has independent authority and discretion to review all relevant information, and, as deemed appropriate, to take administrative or disciplinary actions at all echelons. Separately, this report will be forwarded to commands with cognizance over civilian employees named in the report for action as appropriate and shared with the first supervisory Senior Executive Service supervisor in the chain of command.

6. Ongoing assessments of Red Hill include an Inspector General of the Department of Defense evaluation of the operation, maintenance, review and oversight of Red Hill, and the Naval

Subj: COMMAND INVESTIGATION INTO THE 6 MAY 2021 AND 20 NOVEMBER 2021
INCIDENTS AT RED HILL BULK FUEL STORAGE FACILITY

Facilities Engineering Systems Command third-party assessment of the fuel transfer system, condition of the fire suppression system, and preparation of a lifecycle sustainment plan, in accordance with section 318 of the National Defense Authorization Act for Fiscal Year 2022. A Naval Supply Systems Command-contracted Simpson Gumpertz & Heger third-party assessment of Red Hill was completed on 29 April 2022. Expeditionary implementation of the recommendations from these assessments and this command investigation will guide a comprehensive approach to safe defueling operations at Red Hill.

7. Broader lessons spanning the imperative for clear command and control structure to drive strong Immediate Superior in Command ownership, strengthening the capability and capacity of installation commanders, and ensuring consistency in assessing and enforcing strong standards in system knowledge and incident response preparation are current actions.

8. While outside the scope of this investigation, I commend the strong efforts of the Joint Crisis Action Team that, in partnership with the State of Hawaii Department of Health and the Environmental Protection Agency, worked to restore safe drinking water for the Joint Base Pearl Harbor Hickam (JBPHH) community. This collaboration post-incident reinforces the critical importance of the Navy's relationship with the citizens of Hawaii and the imperative to earn their full faith and trust. We must act on both the specific recommendations and the broader lessons of this investigation with commitment and urgency.

9. Any questions or concerns may be directed to [REDACTED]



W. R. LESCHER
Admiral, U.S. Navy

Copy To:
OSD
DLA
DoN OGC
NR
USFFC
PACFLT
CNIC
COMNAVSUP
COMNAVFAC
Learning to Action Board
RDML Cavanaugh
RADM Waters

5830
15 Apr 2022

From: RADM James P. Waters III, USN
To: Vice Chief of Naval Operations

Subj: SUPPLEMENT TO COMMAND INVESTIGATION INTO THE 6 MAY 2021 AND 20
NOVEMBER 2021 INCIDENTS AT RED HILL BULK FUEL STORAGE FACILITY

Ref: (a) Convening Order Ser N09/22U100519 dtd 4 Mar 21
(b) VCNO Email RE: Red Hill Supplemental Extension Request dtd 30 Mar 22
(c) RDML Christopher J. Cavanaugh, USN ltr 5830 of 14 Jan 22

Encl: (1) Final Report

1. Reference (a), as modified by reference (b), directed an investigation to supplement reference (c).
2. The investigation team examined all factors and information related to the specific tasking identified in reference (a), as well as additional matters deemed relevant. Enclosure (1) is the directed report.

(b)(6)

J.P. WATERS III

Marking Removed

Marking Removed

Supplement to the Command Investigation into the 6 May 2021 and 20 November 2021

Incidents at Red Hill Bulk Fuel Storage Facility

15 April 2022

TABLE OF CONTENTS

I.	Preliminary Statement.....	1
II.	Reconciliation of Findings.....	2
III.	Findings of Fact.....	4
	• Red Hill Overview	
	• The Red Hill Well	
	• Response to the May spill, decision making, and key communications	
	• Response to the November spill, decision making, and key communications through 7 December 2021	
	• Action by FLC, Pearl Harbor to Communicate Manning Concerns	
	• AFFF System: Design, Install, Induction, Maintenance	
	• Command and Control	
	• Camera System	
IV.	Opinions.....	75
	• Comparison of the Immediate Response to the May and November Spills	
	• Command and Control	
	• AFFF System Design and Construction	
	• The Red Hill Well	
	• Communications	
	• Training	
	• Environmental Team	
	• Manning	
	• May Spill Volume Miscalculation	
	• Cavanaugh Report	
V.	Recommendations.....	91
Appendix A.	Enclosures	
Appendix B.	Red Hill C2 As Practiced Chart	
Appendix C.	Updated Quantities of Fuel Spilled, Recovered, and Potentially Released	
Appendix D.	Timeline of Engagements (20 Nov through 7 Dec)	
Appendix E.	Acronyms	
Appendix F.	References	

I. Preliminary Statement

Pursuant to reference (a), this investigation examined the facts and circumstances surrounding the immediate response to incidents at the Red Hill Bulk Fuel Storage Facility (Red Hill) on 6 May 2021 (the “May spill”) and 20 Nov 2021 (the “November spill”). This report is a supplement to reference (b), the command investigation completed by RDML Christopher J. Cavanaugh, USN on 14 January 2022 as endorsed by Commander, U.S. Pacific Fleet (COMPACFLT) in reference (c) (together, referred to herein as the “Cavanaugh Report”).

This supplement is written as an integral part of a singular investigative effort and cannot be read separately from the Cavanaugh Report. The Cavanaugh Report serves as the foundation upon which to present additional matters pertaining to the same incidents. To that end, the findings of fact from the Cavanaugh Report as they relate to the tasking in reference (a) have been adopted in this supplement. For readability, the findings of fact in this supplement associated with the Navy’s response to both spills are written in the order events occurred with an asterisk next to those findings and enclosures that were replicated from the Cavanaugh Report.

Notwithstanding the above, and in accordance with reference (a), a reconciliation of findings of fact between this supplement and the Cavanaugh Report is provided in section II. This investigation reviewed all findings of fact from the Cavanaugh Report that are germane to this supplement and where necessary, provided clarification, amplification, or reconciliation.

In addition to conducting a site visit of Red Hill, the investigation interviewed over 50 individuals and reviewed a significant amount of documentary evidence from multiple organizations to include reports, correspondence, policies, and other materials. All personnel and organizations cooperated fully and all relevant evidence was collected.

All explicit tasks delineated in reference (a) are addressed herein, and the following additional matters were identified as relevant and examined in greater detail: (1) Red Hill well configuration; (2) command and control (C2) of Red Hill; (3) AFFF system design, implementation, and maintenance; (4) understanding of the roughly 20,000 gallon volume discrepancy following the initial investigation into the 6 May spill; (5) closed circuit television system unavailability.

Drawing from the Cavanaugh Report and additional findings in this supplement, this investigation determined that the Navy’s immediate response to both spills contributed to the contamination of Navy-provided drinking water in Hawaii. While there are several additional contributing factors described herein, the water system contamination was the result of human error primarily derived from insufficient human performance enhancement, assessment and feedback processes needed to support effective incident response actions and improper incident response C2. Consolidated exposure to risk existed via multiple avenues associated with Red Hill, however the C2 as practiced, to include ISIC oversight, was insufficient to identify

accumulating risk and take actions to mitigate it. Finally, the November spill, which was the source of the contamination that reached the Red Hill well, was the result of human error exacerbated by poor Red Hill support system design and implementation.

Although this supplement runs through 7 December 2021, it is worth noting that during the course of this inquiry, the Department of Health for the State of Hawaii announced on 19 March 2022 that safe drinking water had been restored to all homes. This was the result of partnership and significant coordination across multiple stakeholders, working in collaboration with the State of Hawaii. While this supplement only tells the story up until 7 December 2021, the work that continued beyond 7 December 2021 accomplished the immediate mission of restoring clean drinking water to all residents and returning them to their homes.

II. Reconciliation of Findings

Pursuant to reference (a), the findings of fact in the Cavanaugh Report were reviewed in order to reconcile discrepancies with the findings of this supplement and to correct any errors that were discovered during the course of this inquiry. There were some findings from the Cavanaugh Report that required elaboration in order to complete the required tasking in reference (a). In those instances, the supplement incorporated the relevant findings from the Cavanaugh Report and added additional findings. There were also findings from the Cavanaugh Report that necessitate modification or correction, and those are recommended as follows:

- a. Finding of Fact 2 is modified by substituting “oversight” in place of “oversight and direction” and “oversight and control” and replacing enclosure [8] with the current MOA between NAVSUP and NAVFAC effective as of 23 August 2017.
- b. Finding of Fact 23 is modified to include additional CNRH responsibilities: “CNRH, as the ISIC to JBPHH exercises direct oversight of the installation. The JBPHH CO retains Title 10 responsibilities for safety, security, environmental stewardship, and protection of personnel and property on the installation, which extends to all fuel service and storage, including bulk fuel facilities aboard their installation.”
- c. Finding of Fact 25 is modified to include additional DLA responsibilities: “DLA is also responsible to perform end-to-end analysis of the risk and performance of the bulk petroleum supply chain.”
- d. Finding of Fact 31 is modified as follows: “An emergency oil pressure door is located at the end of the tank gallery in the lower access tunnel. The door is designed to automatically close when oil is detected in its sump (via a high-level float indicating the sump is full) or a nearby push button is activated. Closing of the door activates the fire alarm system which sets off audible and visual alarms throughout the facility and alerts the Federal Fire

Department. The door provides a fuel tight seal once closed and is designed to withhold the contents of one of the facility's storage tanks."

e. Finding of Fact 32 is modified to strike the second sentence and should read as follows:

"A fire suppression system is installed to mitigate the risk of fire in the upper and lower access tunnels." This correction is due to the fact that AFFF system maintenance commenced on different portions of the system at different times and is further detailed within this report's findings of fact.

f. Finding of Fact 44 is modified to strike a comma in the second sentence which should read: "Tanks 17 and 18 were out of service for CIR maintenance, and tank 19 is permanently out of service because its capacity is not required."

g. Finding of Fact 206 is modified to replace the first sentence and should read as follows:

"During the response, the CDO called the 24 /7 watch at the Waiawa pump station at 2130 and a NAVFAC Utilities and Energy Management employee responded to the scene at 2230. Upon arrival, he opened the door to the Red Hill well shaft and noted there was no fuel inside the door. He closed the door and left Red Hill shortly thereafter." This modification corrects that the NAVFAC employee that responded was not a supervisor and provides additional information.

h. Findings of Fact 38, 287 to 292 as well as Appendix C are modified to reflect the 6 April 2022 update to the quantities of fuel spilled, recovered, and potentially released to the environment. Key updated values, which are used within this report are: Total fuel spilled in the May spill was 20,957 gallons, maximum amount transferred to the AFFF retention system was 19,377 gallons, and total fuel that remains unrecovered is 5,542 gallons.

i. Finding of Fact 353 is modified as follows: "FLC Pearl Harbor is under the administrative control of NAVSUP and is assigned official additional duty to CNRH. Prior to 2020, CNRH submitted concurrent Fitness Reports on the FLC Pearl Harbor CO. The former CNRH discontinued this practice."

j. Finding of Fact 357 is modified by striking the last sentence and is modified as follows: "Per MOA between NAVSUP and NAVFAC, FLCs are responsible for providing oversight of bulk and aviation fueling operations and work functions. The MOA further establishes roles and responsibilities associated with NAVFAC Regional POL Engineers (RPEs) co-located with FLCs in support of sustainment, restoration, and modernization (SRM) programs."

k. Finding of Fact 358 is modified to substitute "10 subordinate commands" in place of "11 subordinate commands."

l. Finding of Fact 360 is modified to substitute "[Encls (37), (268)]" in place of "[Encl 37]."

- m. Finding of Fact 370 is modified to substitute “[Encl 38]” in place of “[Encl 31].”
- n. Finding of Fact 372 is modified to substitute “[Encl 37]” in place of “[Encl 38].”
- o. Finding of Fact 373 is modified as follows: “NAVFAC is an echelon 2 command, led by a Civil Engineer Corps Rear Admiral (O-8), with a headquarters in Washington, DC. NAVFAC is the immediate superior in command and assigned administrative control of four subordinate commands; NAVFAC Pacific, NAVFAC Atlantic, Navy Crane Center, and NAVFAC EXWC. The NAVFAC Commander reports for additional duty to CNIC as the Deputy Commander for Facilities and Environmental.”
- p. Finding of Fact 380 is modified to read: “COMNAVFACSYSOM, Pacific provides direct support to U.S. Pacific Fleet, and is additional duty to the Pacific Fleet Commander as the Fleet Civil Engineer. As Fleet Civil Engineer, NAVFACSYSOM Pacific provides prioritization, general engineering and resource management advice and support for all facility and operational engineering matters to the Fleet Commander [Encls (264), (268)].”
- q. Finding of Fact 387 is modified as follows: “NAVFAC EXWC is an echelon 3 major command, led by a Civil Engineer Corps CAPT (O-6). NAVFAC EXWC is located in Port Hueneme, California. NAVFAC is the immediate superior in command.”

III. Findings of Fact

The Cavanaugh Report establishes a timeline of events from the May spill through the November spill and concludes with the decision to secure the Red Hill well. This supplement extends into the decision making and resulting steps following the November spill, which includes drinking water contamination.

Red Hill Overview

The Cavanaugh Report introduced key personnel and positions in the first section of the findings of fact. The below personnel are added based on their roles and responsibilities and their relevance to these events.

The Joint Base Pearl Harbor Hickam Commanding Officer (JBPHH CO) is responsible for safety, security, environmental stewardship, and protection of personnel and property on the installation. He or she enables maximum mission readiness of all tenant commands and activities by providing installation services, facilities support and quality of life programs. The commanding officer is CAPT Erik Spitzer and has been assigned to the position since July 2020. [Encl (42), (399), (403)]

The JBPHH Public Works Officer (PWO) is assigned to directly support the installation commanding officer. He is primary duty to JBPHH and additional duty to Naval Facilities and Engineering Systems Command Hawaii (NAVFAC HI). The PWO is responsible for roughly 1,000 employees, all of which are NAVFAC HI employees but is the only NAVFAC position assigned directly under JBPHH. The PWO has roughly 30 naval officers reporting to him and the remainder are civilians. The primary responsibility is facility management, maintenance, and real property accountability for the installation. As a PWO supporting NAVFAC HI, he or she also supports reimbursable projects that are not CNIC owned. The PWO has an environmental team assigned, but there are other environmental personnel assigned to NAVFAC HI. Finally, the PWO has a Utilities and Energy Management (UEM) team assigned with responsibility for the Navy water distribution system, among other duties. The PWO for JBPHH is CAPT (b)(6) and has been in the position since late 2019. [Encl (43)]

The PACFLT Force Surgeon is responsible to support medical readiness in the PACFLT AOR and with the primary focus on operational support. CAPT (b)(6) is the PACFLT Surgeon and has been in the position since January 2020. [Encl (218)]

The Commander, Navy Region Hawaii (CNRH) Environmental Director, who also serves as the NAVFAC HI Environmental Business Line Leader, is responsible for executing the Navy Region Hawaii environmental program which is designed to protect human health and the environment. The position reports to the CNRH N4, who is also the NAVFAC HI CO. The position provides ground water modeling, development of conceptual site models, regulatory interface with the Environmental Protection Agency (EPA) and Hawaii Department of Health (DOH), and environmental sampling. (b)(6) has been serving in the position since August 2020. [Encls (40), (46), (47)]

The JBPHH Environmental Program Director reports to the JBPHH PWO and supervises the installation environmental team made up of NAVFAC HI environmental field technicians. (b)(6) has been in the position since 2017. [Encl (44)]

The NAVFAC HI UEM Branch for Potable Water Commodity Manager falls under NAVFAC HI Utility Management Branch and directly supports the JBPHH PWO. This position is responsible for all Navy water systems across Oahu. (b)(6) has served in this position since 2016. [Encls (172), (213)]

The Commander, NAVFAC PAC is RADM Dean VanderLey who relieved RDML John Adametz as the Commander in August 2021. RADM VanderLey has been in the position since. [Encl (125)]

The Red Hill Well Overview

In order to best appreciate the decisions and chain of events that resulted in drinking water contamination, it is necessary to understand the Red Hill well, where it is situated inside the Red Hill Bulk Fuel Storage Facility tunnels, and its proximity to the site of the November spill.


(b)(3)(A)

1. The Red Hill well is described in various documents as the Red Hill Shaft, State well Number 3-2254-001, RHMW2254-01 (when used as a groundwater sampling point), and Navy Well 2254-01. This well feeds into the Navy's JBPHH Water System. [Encls (3)-(6)]
2. The Red Hill well is a Maui-type well, also known as a skimming well. This type of well requires excavation of a near-horizontal tunnel at a level appropriate to skim a thin freshwater

layer, known as a lens, sitting atop saltwater below it. The operator must be careful not to withdraw water too quickly and draw in salty water from below the freshwater layer, which would contaminate the well. [Encl (8)]

3. The Red Hill well is located [REDACTED] (b)(3)(A) [REDACTED]. [Encls (3), (9)]

4. The vertical well shaft is located within the Red Hill Pump Station, which is accessed via [REDACTED]. The access to the pump station is directly adjacent to the train tracks that were channeling spilled fuel to the groundwater sump during the November spill. [Encls (10)-(12)]

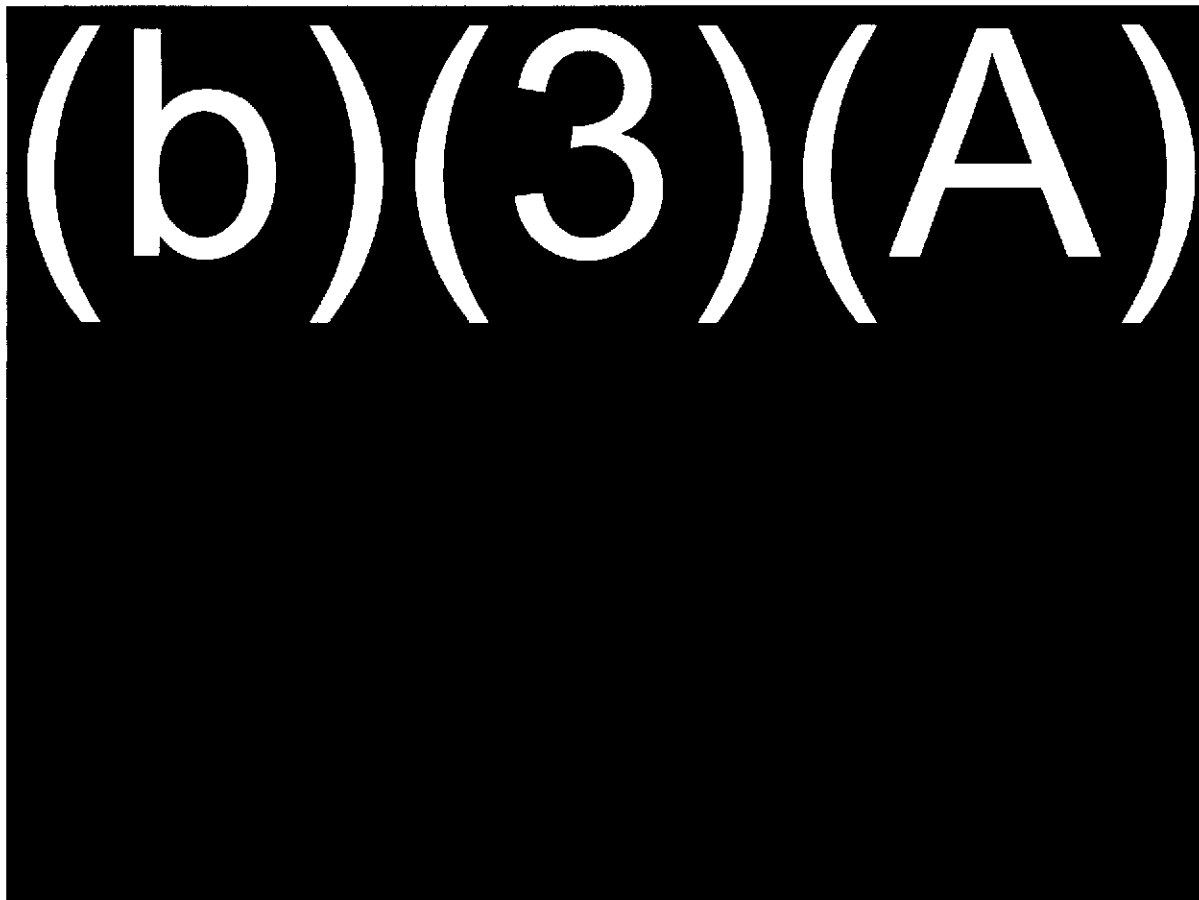

Red Hill well entrance with Pump Station sign to the right. The large pipe was installed to assist in flushing and was not present prior to December 2021.



Lower Access Tunnel with AFFF retention line in top right (PVC pipe)

5. The entrance to the pump station is located (b)(3)(A) and 380 feet from the site of the ruptured Aqueous Film Forming Foam (AFFF) retention line low point drain inside the Red Hill lower access tunnel. The top of the well shaft is approximately (b)(3)(A) from the entrance of the pump station. [Encls (7), (9)]
6. Water is pumped from a 110-foot deep vertical well shaft with a bottom elevation of (b)(3)(A) sea level. [Encl (12)]
7. The well includes a horizontal water tunnel, known alternatively as a development tunnel or infiltration gallery, which is connected approximately 100 feet down the vertical well shaft. This horizontal developmental tunnel extends across the water table (b)(3)(A). [Encls (4), (12)]
8. The bottom of the development tunnel is 3 feet below sea level and is 18 feet high by 6 feet wide. (b)(3)(A) [Encl (12)]

9. The development tunnel crosses beneath the lower access tunnel, then turns south and passes under the lower access tunnel again. A lava tube cross cuts the water development tunnel about 300 feet before the end of the tunnel. The length of the lava tube is unknown. There is continuous water flow at the end of the water development tunnel. [Encls (9), (12)]

10. DOH has consistently expressed concern regarding the protection of the Red Hill well. The Navy regularly monitors Red Hill for contamination based on the Administrative Order on Consent and in accordance with the NAVFAC HI Groundwater Protection Plan. [Encls (3), (4)]

Response to the May spill, decision making, and key communications

On 6 May 2021, as established in the Cavanaugh Report, Red Hill operators improperly executed a fuel transfer procedure, resulting in two piping joint ruptures and a subsequent spill of Jet Propellant-5 (JP5) fuel inside the RHBFSF lower access tunnel in the vicinity of Tanks 18 and 20. The below findings of fact start from the point when the rupture and fuel spill initiated, in order to capture additional information within the context of the response to this spill. Wherever possible, events are presented in the order they occurred. Additionally, relevant findings of fact from the Cavanaugh Report have been included here for readability within the flow of events and are marked with an '' to indicate that they are from that report.*

11. The Red Hill rover was in the gauger station at the time of the incident. He heard a loud noise and immediately informed the Control Room Operator (CRO). [Encls (13)-(15)]*

12. As an emergency response, the operations order directed the watch team to stop the fuel transfer, contact the chain of command, and align the system to transfer fuel back to the source tank. [Encl (16)]*

13. At 1812, the CRO began isolating Tank 12. The CRO verified Tank 20 isolation valves closed, and the level in Tank 20 was not changing. He determined the spill was from the JP-5 pipeline and not a fuel tank. [Encls (13), (17)]*

14. At 1813, Tank 12 net volume drops 19,866 gallons (473 bbl) over 50 seconds. The tank is likely losing volume before this time, but the delayed response is due to the tank gauging's precision and the Automated Fuel Handling Equipment (AFHE) system polling frequency. [Encl (14)]

15. After donning personal protective equipment (PPE), the Red Hill rover walked through the gauger station door, near Tank 12, and into the lower access tunnel. He walked through the blast door near tank 18, saw fuel spraying in the vicinity of Tank 20, and noted the floor of Zone 7 was covered with fuel. [Encl (15)]*

16. The Red Hill rover observed the Zone 7 sump and fire suppression system Sump 1 were filled to their grates with fuel. He heard a pump running, which he assessed was the Zone 7

sump pump. He had never heard the fire suppression system sump pumps operate, so he was not able to differentiate between different pumps in the area. [Encl (15)]*

17. The Red Hill rover closed the blast door, noting that a small quantity of fuel continued to leak through the door seal into the lower portion of the tunnel. After 5-10 minutes, he noticed fuel was no longer leaking under the door and assessed it was safe to re-enter Zone 7. Upon reentering Zone 7, the Red Hill rover saw fuel was no longer flowing from the Tank 20 pipe. He reported this observation to the CRO and evacuated the lower access tunnel via Adit 3. [Encls (14), (15), (17)]*

18. While not recognized at the time of the incident or during post-incident assessments, the fire suppression system Sump 1 pumps ran on 6 May 2021 and transferred up to 19,377 gallons of JP5 fuel into the fire suppression system retention line. Each of the four sump pumps has a 1,000-gallon per minute capacity, so this transfer could have occurred in less than five minutes. The elevation profile and capacity of the fire suppression system retention line allowed this volume of fuel to remain in the line without reaching the fire suppression system retention tank. [Encls (18)-(23)]

19. The AFFF retention line slopes down from an elevation of (b)(3)(A) sea level in the area under the bulk fuel storage tanks to a minimum elevation of (b)(3)(A) sea level approximately (b)(3)(A) and rises from there to the retention tank inlet at an elevation of 147 feet above sea level. These elevation changes create a low area in the AFFF retention line capable of holding 30k to 40k gallons of fluid. [Encls (327)-(329)]

20. Shortly after the incident, the NAVFAC HI Construction Manager, (b)(6) was informed of the spill by an APTIM contractor who was on-site for Clean, Inspect, Repair (CIR) maintenance. The NAVFAC HI Construction Manager went to Red Hill and contacted an FLC PH Facilities Division general engineer, (b)(6) and the CDR (b)(6) NAVFAC HI Red Hill Program Management Office (NAVFAC HI PMO) Director. [Encls (24), (25)]*

21. At 1819, a Fuels Department Work Lead directed the pump operator to align valves to drain the JP-5 pipeline to surge tank 2, using the ruptured joint as a vent path. [Encls (13), (26)]*

22. At 1905, the pump operator commenced draining the JP-5 pipeline to Surge Tank 2. He completed this evolution at 1950. [Encl (13)]*

23. The Fuels Department Work Lead instructed the CRO to continue informing the chain of command. The CRO then sent the Deputy Fuels Director a text message. Once he saw the text message, the Deputy Fuels Director called the CRO and instructed him to contact the Federal Fire Department (Fed Fire). (b)(6) the Deputy Fuels Director attempted to call the Fuels Director, but he was unable to leave a voice message. [Encls (26)-(28)]*

24. The Deputy Fuels Director called the FLC PH CO and notified him of the spill. The Deputy Fuels Director's initial report included his assessment that the spill was contained, and no fuel was released to the environment. [Encls (18), (27)]*
25. At 1937, the CRO notified Fed Fire of the spill. The Fed Fire logged the call as a "gasoline or other flammable liquid spill" and dispatched a unit at 1940. [Encls (28)-(30)]*
26. That evening, the Fuel Department Bulk Fuel Operations Supervisor called the NOSC Representative (NOSC-R), (b)(6) informing him of the spill at Red Hill and explaining it was contained in the lower access tunnel and sumps. No personnel at FLC PH requested assistance from the NOSC-R for spill response or cleanup. [Encl (31)]*
27. The responsibility of the NOSC-R, as delegated by CNRH, is to oversee the response to actual or potential Navy oil and hazardous substance (OHS) spills or releases within the CNRH area of responsibility. [Encls (31)-(33)]*
28. CNRH first learned of the fuel spill from an e-mail from the Hawaii News Now television station. CNRH Public Affairs Officer (PAO) took the lead for public affairs operations for response to the spill, per the CNRH Standard Organizations and Regulations Manual (SORM). CNRH coordinated public affairs actions with PACFLT Public Affairs (PA) and Commander, Navy Installations Command (CNIC) PA. A response to query (RTQ) was coordinated and chopped by CNRH PAO with the NAVSUP FLC PH CO, NAVFAC HI CO, CNRH COM and Chief of Staff (COS), and PACFLT PA. [Encls (34)-(37)]
29. Per the CNRH Oil and Hazardous Substance (OHS) Integrated Contingency Plan (ICP), the spilling activity fills functional roles for incident management in the Incident Command System when the spill is small. However, if cleanup is beyond the activity's capabilities, the activity is required to request assistance from CNRH. In those cases, the NOSC-R fills the role of Incident Commander and oversees a fully staffed CNRH Spill Management Team to manage the response. [Encl (39)]*
30. The FLC PH CO, in coordination with the NAVFAC HI CO and CNRH COS, determined the spill was contained and within his command's capabilities to respond. Further, he determined no fuel was released to environment. As a result, FLC PH maintained incident management responsibilities. [Encls (12), (31), (40)]*
31. At 1955, Fed Fire personnel arrived on-scene. [Encl (28), (29)]*
32. At 2113, Fed Fire turned the scene over to (b)(6) and departed the scene. (b)(6) did not reference being in charge, and Deputy Fuels Director and (b)(6) were both on the scene. Deputy Fuels Director confirmed there was no established incident command that evening. [Encls (26), (38), (41), (409)]

33. The JBPHH CO, PWO, and Installation Environmental Program Director (IEPD) were not present at Red Hill that evening and did not know the extent of the release. [Encls (42)-(44)]

34. The FLC PH CO and NAVFAC HI CO did not respond on site. The FLC PH CO called CNRH COS and NAVFAC HI CO to report the incident but did not recall notifying anyone at the installation. [Encl (18)]

35. The NOSC-R was called but did not respond to the site per guidance from the NAVFAC HI PMO. The NOSC-R called and informed the CNRH Environmental Director. [Encls (18), (31), (41), (45)-(47), (409)]

36. After receiving a phone call from the CNRH PAO at approximately 2000 on 6 May 2021, CNRH COS contacted the FLC PH CO to inquire about the response at Red Hill. The FLC PH CO was aware of an incident but was unable to provide many details. CNRH COS then notified CNRH COM; the NAVFAC HI CO; and the PACFLT Director of Government Affairs (PACFLT GA), (b)(6) [Encl (54)]*

37. At approximately 2000, the Fuels Director became aware of the incident when she received a call from the NOSC-R. The NOSC-R reported that the Deputy Fuels Director and NAVFAC HI PMO Director were both on-scene. [Encls (31), (48)]*

38. The Fuels Director then called the Deputy Fuels Director, who informed her the spill occurred due to over-pressurization, and the Red Hill rover was evacuated. The Fuels Director did not go to Red Hill on 6 May 2021 based on a discussion with the Deputy Fuels Director. The Fuels Director was also in contact with the CRO, who was providing information about the amount of fuel recovered. [Encl (48)]*

39. The FLC PH CO initially went to the FLC PH Fuels Department building at JBPHH to obtain more information about the incident. He later met the FLC PH Executive Officer (XO) at the FLC PH headquarters building to discuss reporting requirements. The FLC PH CO, FLC PH XO, and NAVFAC HI CO did not go to Red Hill on 6 May 2021. [Encls (18), (45)]*

40. Upon arrival at Red Hill on 6 May, an FLC PH Engineering Technician, (b)(6) checked and gauged the fuel oil reclaimed (FOR) tank (tank 311). At 2030, the level in tank 311 had increased by 722 gallons and was stable. [Encls (20), (48)]*

41. From the tank gallery, the Engineering Technician noted that fire suppression system Sump 1 was filled to the grate with fuel. He checked the associated sump pump controllers for signs the pumps had activated. He noted they were in automatic mode with no audible indication and no lights illuminated. He also directed an APTIM contractor to check the fire suppression system retention tank, which was empty. [Encls (20), (21), (48), (49)]*

42. Based on these observations, the Engineering Technician assessed the fire suppression system sump 1 pumps had not activated. If functioning properly, the pumps should have activated with a full sump. [Encls (20), (21), (50)]*

43. On 6 May, the contractor responsible for fire suppression system maintenance, *Hawaii Kinetix (Kinetix)*, received a request for support from FLC PH to bypass the fire alarm system and monitor the fire pump to facilitate the cleanup. [Encl (51)]

44. At approximately 2200, the FLC PH CO, Fuels Director, and Deputy Fuels Director conducted a three-way conference call to coordinate follow-on actions. They agreed reports to Navy leadership and to regulators were required within 24 hours. [Encls (48), (52)]*

45. The Deputy Fuels Director visually estimated the amount of fuel spilled in the lower access tunnel was between 1,000 and 1,500 gallons. He recommended delaying cleanup until 7 May 2021, which the FLC PH CO approved. [Encls (48), (52)]*

46. A total of 1,580 gallons of fuel was recovered immediately following the 6 May 2021 spill. [Encl (53)]*

47. The FLC PH CO and NAVFAC HI CO subsequently informed CNRH and CNRH COS that the spill was from a ruptured piping joint and that the spill was contained. The FLC PH CO and NAVFAC HI CO assessed there was no need to immediately contact regulators since there was no release to the environment. CNRH COS and PACFLT GA agreed that formal notification could be made the following morning. [Encls (45), (54)]*

48. Early on the morning of 7 May 2021, prior to senior Navy leadership or congressional delegate notification, local media reported a fuel spill at Red Hill of approximately 1,000 gallons. [Encls (40), (45), (54)-(57)]*

49. At approximately 0700, the FLC PH CO ordered the Fuels Director to take the lead on notifications. The Fuels Director prepared a draft OPREP-3 message and a Naval Supply Systems Command (NAVSUP) Immediate CCIR report with assistance from the NOSC-R; the FLC PH Fuels Intern, LT (b)(6) and the FLC PH XO. [Encls (31), (48), (58), (59)]
*

50. Between 0830 and 0840, the FLC PH CO made required incident notifications. He left a voicemail report to COMNAVSUP. He then successfully made voice reports to the NAVSUP COS, NAVSUP N4, and CNRH COS. [Encl (60)]*

51. At 0844, the FLC PH XO made a voice report to the NAVSUP Logistics Operations Center. [Encl (60)]*

52. At approximately 0900 on 7 May, the NAVFAC HI PMO reached out to DOH to provide a courtesy notification regarding the activities overnight. He also offered DOH a tour of the site the following week. [Encls (46), (47), (61)-(64)]

53. At 0925 the CNRH Environmental Director directed the Environmental UST staff to make a courtesy call to the DOH UST point of contact for Red Hill as well, and the NOSC-R was asked to call DOH Hazard Evaluation and Emergency Response (HEER). During their conversation, HEER assigned a case number to the event. [Encl (46)]

54. At 1006, the FLC PH CO emailed COMNAVSUP a link to the local media release and stated "All released fuel was contained within the tunnel and recovered. No fuel was released into the environment." This assessment was based on visual observations alone. NAVFAC HI was unable to conduct soil vapor or groundwater monitoring until 10 May 2021, due to safety concerns. [Encls (65), (66)]*

55. On 7 May, there was a telephone call at 0900 between NAVFAC HI and both DOH and EPA. Although contained releases do not require immediate notification to regulators, contact was made for transparency. [Encl (61)]

56. On 7 May 2021, the Hawaii DOH On-Scene Coordinator, (b)(6) called the NOSC-R to ask why he had not notified her of the spill. The NOSC-R told (b)(6) there was no release to the environment, so reporting was not required. [Encl (31)]*

57. At 1200 NAVFAC HI CO directed the NOSC to submit the standard form paperwork required by the HEER office within 24 hours of an event. [Encls (46), (64)]

58. At 1323, based on information provided by FLC PH and CNRH, COMPACFLT (Acting), RADM Stephen Koehler, emailed Commander, United States Indo-Pacific Command (INDOPACOM) and Chief of Naval Operations, stating: "...the design of the lower access tunnel and the piping within prevents release to the environment via a network of drains and sumps...there was NO release to the environment." He also stated: "EPA reports no concerns due to no release to the environment...CNRH will initiate root cause analysis/investigation and facilitate repair of failed piping." [Encl (57)]*

59. On 7 May 2021, FLC PH Fuels Department reported to Defense Logistics Agency (DLA) that less than 1,000 gallons of fuel spilled. [Encl (68)]*

60. On 7 May 2021, FLC PH conducted an operational pause. This event was focused on damage assessment and cleanup. It was not focused on determining the cause of the incident or conducting training. [Encl (69)]*

61. On 7 or 8 May 2021, a FLC PH Facilities Division Engineering Technician contacted the fire suppression system contractor, *Kinetix*, to request an inspection of the fire suppression

system. Fire suppression system Sump 1 remained filled with fuel. During the inspection, *Kinetix* concluded the pumps had not activated based on checking the Gamewell control panel, which is designed to record system activity. However, following the 20 November 2021 spill, *Kinetix* contractors assessed that the direct digital controller was not properly communicating with the Gamewell control panel. [Encls (20), (21)]*

62. On 7 May 2021, the Deputy Fuels Director directed the Control Division accounting team to conduct a post-spill inventory reconciliation. They noted that the AFHE system recorded a drop in tank 12 fuel level of 19,983 gallons between 1801 and 1818 on 6 May 2021. Additionally, a loss of 20,139 gallons was recorded in Fuels Manager Defense (FMD) for all JP-5 evolutions on 6 May 2021. [Encls (22), (70), (71)]*

63. On 7 May 2021, FLC PH Facilities Division engineers determined the volume of spilled fuel was equal to the volume of the main pipeline and cross piping above the damaged dresser coupling at tank 20. They calculated this volume as 1,016 gallons. At this point, they did not know the tank 18 dresser coupling was also damaged, because it was behind a maintenance partition. [Encl (72)]*

64. CNRH PA issued a press release on 7 May informing that Navy personnel responded to a reported release of fuel from a distribution pipeline inside the Red Hill Bulk Storage Facility on the evening of 6 May. The release stated that preliminary reports indicated approximately 1,000 gallons of fuel released during a fuel transfer and fuel was properly collected by the fuel containment system. The release also included that there were no leaks from fuel tanks and that the fuel release was detected immediately and the system worked as designed to collect, isolate and contain fuel safely. [Encls (34), (73)]

65. Following the first press release related to the spill, PACFLT was contacted by staff members from the Hawaii delegations requesting to review future press releases before they were sent. Up to that point, the review process for Red Hill related press releases included CNRH PAO, PACFLT PA, and PACFLT GA. NAVFAC HI PMO for Red Hill and CNRH Chief of Staff (COS) would often send press release information directly to PACFLT GA. CNRH would not release a Red Hill related message without PACFLT's approval. [Encl (74)]

66. On 7 May, NAVFAC HI CO emailed CNRH COS expressing concerns about how the investigation into the spill should be conducted. NAVFAC HI CO believed the investigation should not be led by FLC PH. [Encl (75)]

67. As part of the continued cleanup effort, FLC PH requested *Kinetix* to return on 10 May and repeat the same actions from 7 May in bypassing the fire alarm system and monitor fire pump to facilitate further clean up in the vicinity of the lower tunnel. [Encl (51)]

68. On 12 May 2021, CNRH asked COMNAVSUP to conduct an external investigation into the events of 6 May 2021. He noted there was significant damage and had concerns about FLC PH's ability to conduct an adequate internal investigation. [Encls (54), (76)]*

69. On 12 May, COMNAVSUP emailed PACFLT COM informing him that he will be initiating a NAVSUP led investigation in support of CNRH into the spill at Red Hill, and is aligned with PACFLT GA, PACFLT N4, CNRH, NAVFAC, and DLA. [Encl (77)]

70. FLC PH requested *Kinetix* to return a final time on 13 May to return the fire alarm and fire suppression system back to normal because clean-up of the spill was complete. [Encl (51)]

71. On 13 May 2021, COMNAVSUP appointed Naval Petroleum Office (NPO) Deputy Officer in Charge (OIC), (b)(6) to conduct a command investigation into the facts and circumstances surrounding the 6 May 2021 fuel spill at Red Hill. The order noted that FLC PH was conducting its own administrative review and NAVFAC Engineering and Expeditionary Warfare Center (EXWC) was conducting a root cause analysis of the incident. The appointing order further instructed (b)(6) to conduct a review, validation, and consolidation of the FLC PH and NAVFAC EXWC efforts, in addition to the NAVSUP Headquarters-level investigation of the incident. The completed report, including opinions and recommendations, was due by 10 June 2021. This deadline was extended to 30 June 2021. [Encls (78), (79)]*

72. COMNAVSUP appointed the NPO Deputy OIC as the investigating officer, because the NPO OIC was conflicted, having already been appointed in March 2021 to investigate an FLC PH personnel matter. [Encls (80)-(82)]*

73. On 10 May DOH performed a Red Hill site visit and requested the addition of daily soil vapor monitoring to the ongoing sampling requirements of the AOC. Daily soil vapor readings continued through 9 June. [Encl (46)]

74. Following the release on 6 May, soil vapor monitoring was delayed in the ports under Tanks 17, 18, and 20 until they were remediated. When these ports were opened for sampling on 10 May, samplers noticed that they had been compromised by fuel. The Navy had to excavate soil, clean the probes, and change fittings to reduce the potential for false positives. [Encls (46), (83)]

75. On 12 May 2021, the FLC PH CO emailed COMNAVSUP, reporting the total quantity of fuel recovered was 557 gallons. He stated: "Levels in the sump tank have been holding steady to confidently state 557 as the quantity of the release." This was the last total reported to him by the Deputy Fuels Director. [Encls (57), (84), (85)]*

76. NAVFAC HI increased the sampling of their soil vapor monitoring ports from quarterly to daily for the week following 6 May 2021, and then weekly for the following four weeks. [Encls (86), (87)]*

77. The following week, an FLC PH Facilities Division general engineer, (b)(6) discovered the dresser coupling for tank 18 had also been damaged during the 6 May 2021 incident. This discovery prompted a recalculation of the spilled fuel based on the volume of the main pipeline and cross piping above the damaged dresser coupling. They calculated this volume as 1,618 gallons. [Encls (88), (89)]*

78. On 26 May 2021, the FLC PH Control Division Supervisory Management Analyst, (b)(6) created a memorandum for the record (MFR) documenting a total inventory loss of 20,139 gallons in the FMD accountable property system of record. The MFR stated, "Per Operation Controller...this evolution was cancelled and did not occur. The 19,983 gallons was put into the pipeline and not accounted for inside any tank." [Encl (71)]*

79. Based on the Facilities Division engineering assessment on 17 May 2021, a volume of 1,618 gallons was accounted for as spilled, and a volume of 18,521 gallons was accounted for as having remained in the pipeline. The inventory discrepancy was reported to the Deputy Fuels Director, who reported this to the FLC PH CO. However, the FLC PH CO did not recall this report. [Encls (18), (53), (70), (71), (90)]*

80. Although not involved in the volume assessment at the time, when interviewed in March 2022 the DLA Energy East Pacific Commanding Officer assessed that it is impossible for fuel to be put or "packed" into the pipeline and subsequently not accounted for because the pipeline is assumed full in the FMD accountable property system. [Encls (91), (92)]

81. FLC PH's final determination from 6 May 2021 was 1,618 gallons spilled, with 1,580 gallons recovered. The FLC PH CO was not involved in any discussions regarding the final amount of fuel spilled. [Encls (18), (53), (71)]*

82. DOH held a Fuel Tank Advisory Committee (FTAC) meeting on 20 May to brief members on updates regarding the AOC and FTAC activities. NAVFAC HI CO provided a brief on the 6 May release and technical updates that had been completed since the last meeting. [Encl (93)]

83. On 21 May DOH conducted a site visit at Red Hill. They observed sampling and the pipeline rupture at Tank 18. DOH indicated they would be providing improvements to the monitoring plan the next week. [Encl (94)]

84. On 28 May 2021, the FLC PH Business Department Director issued a memorandum to the NPO Deputy OIC providing the findings of his Management Inquiry. The synopsis of the findings stated, based on the evidence collected from employee interviews and analysis of documents and records, that the Fuels Department received a rating of SATISFACTORY (with minor concerns) in the inquiry's three focus areas: (1) records management, (2) training and qualifications, and (3) inspections and preventive maintenance. The FLC PH Business Department Director noted the inquiry was not meant to be a root cause or technical analysis of

the fuel release. The inquiry's focus was to ensure personnel are properly trained and to document whether inspections and preventive maintenance were conducted. [Encl (17)]*

85. During the investigation that followed the 6 May 2021 spill, the NAVFAC HI CO directed the NAVFAC HI Chief Engineer, (b)(6) to validate the amount of fuel lost. He shared concerns with (b)(6) that the calculations were based on an incorrect assumption that the pipeline was not pressurized, and therefore the loss calculation was too low. However, he did not revisit this concern until October, after the NPO Deputy OIC amended his investigation. [Encls (45), (78), (95), (96)]*

86. Although known to the NPO Deputy OIC at the time, he did not provide NAVFAC HI documents indicating the approximately 20,000 gallon loss of inventory reported in FMD on 6 May, when he requested assistance in validating the FLC PH calculations of fuel lost. [Encl (70)]

87. Between 4 and 8 June 2021, total petroleum hydrocarbons oil and grease for Red Hill ground water monitoring well 03 increased above the Environmental Action Level. All follow-on samples were below the Environmental Action Level. [Encls (98), (99)]*

88. Between 3 and 4 June 2021, the NPO Deputy OIC provided an update to members of the PACFLT staff on the status of his investigation as well as his coordination with NAVFAC EXWC and FLC PH. [Encl (100)]

89. On 4 June 2021, CNRH COS requested additional input from the NPO Deputy OIC regarding the expected timeline to complete the command investigation. [Encl (101)]

90. Following coordination with the NPO Deputy OIC and members of the PACFLT staff, PACFLT COM provided a status update on the command investigation to Commander, U.S. INDOPACOM. [Encl (102)]

91. On 8 June 2021, the NPO Deputy OIC provided members of the PACFLT staff with an initial estimate on how much JP-5 was released to the environment and not recovered as well as a preliminary assessment on the potential impact it had on the environment. [Encl (103)]

92. On 9 June 2021, following further engagement with the PACFLT N40 team, the NPO Deputy OIC provided clarification on the estimated number of gallons released. PACFLT N40 acknowledged receiving the estimate and requested an update on when the NAVFAC HI chief engineer would be done validating the estimates. [Encl (104)]

93. On 9 June 2021, CNRH received a Release Confirmation and Request for Information from DOH, which changed the sampling requirements to soil vapor monitoring every two days and monitoring well sampling three times per week within the tunnel. [Encls (46), (47), (105)]

94. On 10 June 2021, the NAVFAC HI Chief Engineer reviewed the initial estimates of the spill calculations and communicated his review to the NPO Deputy OIC and the NAVFAC HI PMO Director. [Encl (106)]

95. On 10 June 2021, the NAVFAC HI Chief Engineer validated the calculations of the FLC PH Facilities Division engineers. He concluded that the calculations were reasonable for a static system; however, he said these would not have been correct if the plant was pressurized. The NAVFAC HI PMO Director informed the NAVFAC HI Chief Engineer the pumps were off and the plant was not pressurized. This was confirmed by the FLC PH Facilities Division engineers. [Encl (78)]*

96. In his 10 June 21 validation of the calculations, the NAVFAC HI Chief Engineer states that “No information regarding post break pressure has been provided and therefore impossible to determine any additional lost fuel.” Although the data was available in the AFHE system, the NAVFAC HI Chief Engineer was unaware, at the time, that the Tank 12 isolation valves were open for approximately 2 minutes following the pressure transient that damaged the pipeline. This applied pressure to the damaged pipeline based on the weight of fuel in Tank 12. [Encls (78), (14)]

97. On 11 June, the NPO Deputy OIC informed the PACFLT staff and the CNRH COS that the preliminary estimates on the number of gallons released from the May spill were validated by the NAVFAC HI Chief Engineer. [Encl (107)]

98. PACFLT GA stated that the PACFLT staff maintained a strong interest in the NPO Deputy OIC investigation from a government affairs perspective to stay informed and enable information flow to key government officials. [Encls (108)-(110)]

99. On 11 June 2021, NAVFAC HI CO, PACFLT N4, CNRH COS, and the NPO Deputy OIC discussed validating the spill numbers. [Encls (97), (101), (124), (177), (178)]

100. On 25 June 2021, the NPO Deputy OIC submitted his investigation report. The investigation focused on determining the cause of the 6 May 2021 fuel spill, how much was released, and the impact of the release on the environment. It noted each objective of the appointing order was met with the exception of validating the work of the engineering root cause analysis contracted by NAVFAC EXWC, which was not complete at that time. As part of the NAVSUP investigation, he interviewed a number of FLC PH personnel, including CROs, Red Hill rovers, and supervisory staff. [Encl (111)]*

101. Although known at the time, the NPO Deputy OIC did not include in his report the fact that the FMD inventory ledger from May 6 indicated a fuel loss of approximately 20,000 gallons because he did not deem it relevant. [Encl (97)]

102. Following the 6 May incident, CNRH signed COMNAVREGHINST 3440.18: "COMNAVREG Hawaii Red Hill Bulk Fuel Storage Facility Emergency Response Notification Coordination Plan" as a supplemental guide for emergency response notification and coordination actions to take during a fuel, oil, or hazardous substance release as well as any other non-release related emergency situations within the Red Hill Storage Facility. [Encl (112)]

103. The NAVSUP investigation did not reveal a directly attributable cause for the 6 May 2021 fuel spill. The report stated that additional engineering analysis was needed. [Encl (78)]*

104. The NAVSUP investigation concurred with FLC PH's assessment of the quantity of fuel spilled on 6 May 2021. The NPO Deputy OIC, working with FLC PH Facilities Division engineers, determined 1,618 gallons spilled and 1,580 gallons were recovered. He concluded 37.9 gallons were released to the environment. The FLC PH CO was not aware of the 37.9 gallons released to the environment until after his change of command in August. On 1 October, NAVFAC HI Environmental Business Line Leader, (b)(6) forwarded a memorandum to the Hawaii DOH reporting 1,618 gallons spilled and 1,580 gallons recovered. [Encls (13), (97), (111), (113), (114)]*

105. A contested case hearing was held on 8 July to hear testimony on soil vapor monitoring following the 6 May pipeline discharge. [Encls (115), (116)]

106. Results of samples taken from the Red Hill well on 8 and 15 July as part of the ongoing monitoring program showed a detection of total petroleum hydrocarbons, oil (TPH-O) below the Environmental Action Level (EAL). When the samples were analyzed using the silica gel cleanup method, there were no detections. The sample taken on 29 July showed an estimated detection of TPH-O. This detection remained estimated following use of the silica gel cleanup procedure. These were reported to DOH on or around 24 September. [Encls (94), (98)]

107. Silica gel cleanup is intended to exclude naturally occurring organics from quantitative extractable petroleum hydrocarbon results. The process is based on the premise that most naturally occurring hydrocarbons are polar and will be captured by the activated silica gel. Examples of these organics include lipids, plant oils, humic acids, and fatty acids. However, silica gel will remove any polar organic compound, not just naturally occurring ones. This could include breakdown products from the weathering of petroleum hydrocarbons. DOH does not recognize the use of silica gel cleanup. [Encls (117), (118)]

108. On 13 July, the contested case post hearing briefs were submitted. The Navy requested that the permit move forward. [Encl (115)]

109. Samples taken from the Red Hill well on 5 and 26 August showed results for TPH-O that exceeded the EAL. TPH-O was also detected on 12 and 19 August but below the EAL. When the samples were analyzed using the silica gel cleanup method, there were no detections. These

results were reported to DOH and discussed prior to 1 November. The EAL is not a health-based level and was not considered an immediate concern. [Encls (94), (98), (188)]

110. In August 2021, the new FLC PH CO and Fuels Director questioned the 6 May 2021 fuel spill calculations. Based on a discussion with the FLC PH Lead Regional Fuel Engineer, (b)(6) they accepted his explanation that the drop in Tank 12 was consistent with fuel being repacked into the main pipeline. [Encls (121), (22)]*

111. In August the Navy submitted the Supplemental Tank Upgrade Alternatives document to the State as part of the continuing permitting process. [Encl (119)]

112. A sample taken from the Red Hill well on 1 September resulted in a detection below the EAL for TPH-O. When analyzed using the silica gel cleanup step, the detection decreased and became estimated. [Encl (98)]

113. On 7 September 2021, NAVFAC EXWC Technical Director, (b)(6) issued a memorandum to the NPO Deputy OIC providing the results of a root cause analysis of damage during the 6 May 2021 event conducted by Austin Brockenbrough and Associates, LLC, a private engineering and consulting firm. Per NAVSUP guidance, the FLC PH CO was unable to release the root cause analysis report to the Fuels Department. FLC PH Fuels Department operators and engineers did not know the root cause of the 6 May 2021 spill until training conducted during an operational pause following a pressure transient event on 29 September 2021. The training consisted of one slide that focused on the operator error and mitigations implemented by the command. [Encls (14), (123)]*

114. As part of the root cause analysis, the written report produced a timeline of events of the entire incident. Within the timeline, the report identified a net volume drop of 473 barrels within approximately 50 seconds, which equates to 19,866 gallons. While this information was contained in the root cause analysis, none of the technical personnel that reviewed the report identified this as an issue worth exploring. [Encls (14), (124)-(129)]

115. EXWC stated that personnel from Austin Brockenbrough that were involved in drafting the root cause analysis did not highlight the 473 barrels beyond noting it in the timeline of the report. Personnel from Austin Brockenbrough had internal discussions about the 473 barrel drop, but did not communicate anything on the matter beyond what was in the report. Because the purpose of their report was to determine the engineering failures associated with the May spill, the 473 barrel drop was only important to them because it was the final time stamp of events where the analysis in the report terminated. [Encls (14), (124)-(129)]

116. On or about 10 September, the Hearing Officer recommended approval of the Red Hill Fuel Storage Facility operating permit. [Encl (130)]

117. On 15 September 2021, the NPO Deputy OIC issued an amendment to his investigation to incorporate the engineering root cause analysis. The analysis concluded the double block and bleed valve of Tank 12 was opened, and a rapid inflow of fuel resulted in the collapse of a vacuum created by operator error. The resulting pressure wave displaced the piping, damaged the dresser couplings, and resulted in a level decrease of 473 barrels (19,866 gallons) in Tank 12. The only recommended corrective action was to reinforce training on operations orders. The investigation did not evaluate the effectiveness of the operations orders, training, and qualifications. Additionally, the investigation did not address the 19,866-gallon discrepancy or recommend accountability actions. [Encls (111), (131)-(133)]

118. Although contained within a single line item within an attachment to the root cause analysis, which is itself an attachment to the NPO Deputy OIC led investigation, the 19,866 gallon discrepancy was not called out in the main body of the report. Additionally, the investigation did not review or address the response to the May spill. [Encls (14), (111)]

119. On 17 September 2021, NAVSUP provided an update to PACFLT COM on the status of the NPO Deputy OIC report. NAVSUP informed that the report was complete and was amended to include the root cause analysis report from EXWC, and that the total fuel release was 1,618 gallons of which 1,580 gallons was recovered. [Encl (133)]

120. Samples taken from the Red Hill well on 15, 22, and 29 September showed detections of TPH-O. Following the silica gel cleanup method, the detections remained though the ones taken on 22 and 29 September became estimated. It should be noted that there were quality control concerns that bring these results into question. The analyte was found in the blank when all of these samples were analyzed. [Encl (98)]

121. On 17 September the CNRH Environmental Director sent an Initial Release Response Report to DOH in response to the 9 June NOL. [Encls (134), (135)]

122. Also on 17 September CNRH received a follow up Request for Information letter expressing DOH's concern that the investigation into 6 May was still ongoing and that the reporting DOH had reviewed so far was deficient. [Encl (136)]

123. On 28 September 2021, FLC PH CO briefed PACFLT COM and staff members on the NPO Deputy OIC report as well as an update on the Red Hill Operating permit. Following this brief, NAVFAC PAC initiated an additional report to capture the mitigation measures and follow-on repair actions to address the underlying engineering causes to the May spill. The additional mitigations report was tasked to EXWC to complete. [Encls (125), (127), (133)]

124. On 1 October 2021, PACFLT COM notified COM INDOPACOM of the results to the 6 May investigation. PACFLT GA initiated the process to coordinate notification to regulators and state officials. [Encl (133)]

125. On 1 October 2021, CNRH issued a letter to DOH reporting the May spill investigation results (signed by CO NAVFAC HI / CNRH N4). Additionally, NAVFAC HI CO responded to the 9 June NOI from DOH and reported that the collection system functioned as designed and 1,618 gallons were released. [Encl (114)]

126. On 1 Oct 2021 at 1134, PACFLT GA sent an e-mail to professional staff members for the Hawaii congressional delegation, state government representatives, and city of Honolulu representatives providing an update on 6 May 2021 Red Hill spill investigation under review by PACFLT. PACFLT GA shared the findings that the spill was caused by operator error resulting in the release of 1,618 gallons with all but 38 gallons recovered. [Encl (137)]

127. In October 2021, after the root cause analysis and NAVSUP command investigation was finalized, the NAVFAC HI CO reiterated his concerns with the previous spill calculations, this time to the FLC PH CO. He was concerned the system was pressurized and the calculations were based on the system being under static conditions. The FLC PH CO informed the NAVFAC HI CO that the extra fuel was repacked into the main pipeline and that this was validated by the NAVFAC HI PMO Director. [Encls (45), (95)]*

128. Samples taken from the Red Hill well on 6 October resulted in an estimated TPH-O detection. There were no detections for the samples taken on 13, 20, or 26 October. When analyzed using the silica gel cleanup step, the detection decreased and became a non-detect. [Encl (233)]

129. Between June and September, various senior leaders from the PACFLT and CNRH staffs reviewed drafts of the NPO Deputy OIC investigation report. During the course of that review, members identified various deficiencies or concerns with the draft and generally assessed it was not thorough or well done. Of note, no one identified the discrepancy of the 20,000 gallons. While there were some discussions with the PACFLT legal office and senior leaders of the PACFLT staff on the appropriateness of communicating their issues or concerns about the draft report to NAVSUP, ultimately no one communicated these concerns or issues to NAVSUP prior to the investigation being closed out. On 14 October 2021, COMNAVSUP signed a close out endorsement on the NPO Deputy OIC investigation report of 15 September 2021. [Encls (11), (108), (109), (125), (138), (177), (178), (404)]

130. On 18 October 2021, NAVFAC PAC COM signed out a first endorsement of the 15 September 2021 NPO Deputy OIC report, which was addressed to Commander, U.S. Pacific Fleet. As part of this endorsement, NAVFAC PAC COM pulled together the root cause analysis and mitigation report that was produced by EXWC. The endorsement recommended that PACFLT COM approve the NPO Deputy OIC investigation of 15 September 2021 as well as the EXWC mitigations report and root cause analysis. [Encls (125), (139)]

131. On 20 Oct 2021, NAVFAC PAC COM provided a brief to PACFLT COM and members of the staff on the mitigations report along with the NPO Deputy OIC report of 15 September 2021.

The brief included an overview of all investigations through present day along with a public release plan of the reports, which would happen just prior to the FTAC Hearing on 28 October 2021. [Encls (125), (140), (141)]

132. The 18 October 2021 close-out endorsement letter from NAVFAC PAC COM included a signature block for PACFLT COM to indicate a decision but it was never signed. During his interview, COMNAVFAC PAC stated that his endorsement to PACFLT COM was intended to create a record of actions to account for repairs but a more appropriate document would have been a memorandum for the record. [Encls (125), (140)]

133. On 26 October CNRH received a Notice of Violation and Order, No. 21-UST-EA-0 from DOH based on an inspection of the RHBFSF that occurred during the period of 3 September to 9 October 2020, approximately one year earlier. CNRH had not previously received notification of the inspection results. Violations did not include anything directly related to the events discussed herein and are being addressed by the Navy Litigation Office. [Encls (47), (142), (143)]

134. CNRH PA issued a press release on 26 Oct 2021 informing that the investigation determined operator error caused the release of 1,618 gallons of jet fuel (JP-5) from pipelines inside the Red Hill Bulk Storage Facility on 6 May. The press release said the Navy recovered all but 38 gallons of fuel and had implemented new procedures. The press release also said that copies of the investigation were provided to DOH and EPA. As part of this release, CNRH made available to the public redacted copies of the NPO Deputy OIC report, EXWC root cause analysis, and EXWC mitigation report. [Encls (35), (74), (144)]

135. On 28 October, the FTAC meeting received technical updates from CNRH COM and NAVFAC HI CO. This group met to provide updates on the current efforts of the AOC and FTAC and included an update on the 6 May spill. [Encl (145)]

136. Samples collected at the Red Hill well on 3 November did not detect petroleum hydrocarbons. Samples collected at the Red Hill well on 10 November showed an estimated detection of total petroleum hydrocarbons, diesel (TPH-D), which decreased to non-detect with silica gel cleanup. Samples collected on 17 November showed estimated detections of TPH-D and a detection of TPH-O below the EAL. After application of the silica gel cleanup step, these samples decreased to non-detect. [Encl (233)]

137. On 1 November, the four congressional members of the Hawaii delegation sent a letter to the Secretary of the Navy (SECNAV) to express increasing concern about the safety of fuel operations at Red Hill following reports about a fuel leak near Hotel Pier that occurred in March 2020. The letter expressed disappointment regarding the lack of communications with regulators, state officials, and the public and the Navy not being more forthcoming. [Encl (146)]

138. On 9 November, the Honolulu Star Advertiser reported whistleblower allegations about Red Hill. The article states that Hawaii environmental regulators were informed that the Navy did not disclose there were holes and corrosion in the Red Hill fuel tanks during the state permitting process. [Encl (147)]

139. On 16 November there was a meeting between Navy representatives and DOH where the Navy proposed updating environmental monitoring requirements to address laboratory concerns (including lab availability, capacity, and turn around time) and reducing monitoring frequency. The decision was pending at the time of the 20 November release, at which point it was overcome by events. [Encl (148)]

Response to the November spill, decision making, and key communications through 7 December 2021

On 20 November 2021, as established in the Cavanaugh Report, a Red Hill watch stander inadvertently struck a low point drain valve in the AFFF retention line with the passenger cart of a train, cracking the PVC pipe and spilling up to 19,377 gallons of fuel deposited there on 6 May. Up to 5,542 gallons of fuel remain unrecovered, with some portion of that fuel contaminating the Red Hill well and the Navy drinking water distribution system.

As fuel from the damaged AFFF retention line flowed into the Red Hill tunnel near Adit 3, it ran downslope between the train tracks to the Adit 3 Y, where the flow was divided. A small portion flowed down the Harbor Tunnel and dissipated. The majority flowed toward Adit 3 and was deposited in the groundwater and CHT sumps approximately (b)(3)(A) from the tunnel entrance. Following notification of the incident, the FLC PH CO and NAVFAC HI CO walked the length of the AFFF retention line, and noting its connection to fire suppression system Sump 1, realized the fuel in the pipeline originated from the 6 May 2021 spill.

While the Cavanaugh Report provides a detailed accounting of the immediate response actions by personnel from FLC PH, the Federal Fire Department, and NAVFAC HI, the below findings of fact amplify some communications captured in the Cavanaugh Report, and expands the timeline to capture actions taken beyond 28 November. This section begins on 20 November just after 1650, at the point fuel was released from the AFFF retention line low point drain. Wherever possible, events are presented in the order they occurred and are divided into sections by day. Additionally, appropriate findings of fact from the Cavanaugh Report have been included here for readability within the flow of events and are marked with an '' to indicate that they are from that report.*

20 November 2021

140. The CRO contacted FLC PH Fuels Department Engineering Technician, (b)(6) and reported water leaking out of the fire line. The Fuels Department Engineering Technician immediately called *Kinetix*. *Kinetix* dispatched a technician. [Encl (20)]*

141. Shortly after the first report to the CRO, the Red Hill rover reported that the leak smelled like fuel. The assistant CRO directed the Red Hill rover to attempt to identify what kind of liquid was coming from the pipe. [Encls (149), (150), (151)]*

142. At the scene, the Red Hill rover closed the ventilation door leading to the lower section of Adit 3. This did not prevent the flow of fluid from entering the section of the tunnel downgradient from the leak, due to a gap between the bottom of the door and the deck. The rover also unplugged the train to prevent any potential for a spark. He then attempted to locate a fire suppression system isolation valve to stem the flow of what he assessed as a fuel/water mixture, but was unable to find one. Meanwhile, the leak's location near an exhaust fan resulted in fuel vapors being blown into the outside environment. The Red Hill rover considered securing the exhaust fan next to the leaking low point drain, but he did not. [Encls (122), (149), (150)]*

143. The second Red Hill rover arrived on-scene, but both Red Hill rovers left shortly thereafter due to the buildup of fumes. Both Red Hill rovers exited via Adit 3. After exiting, the first Red Hill rover washed his eyes with water, because they were burning. He then re-entered Adit 3 and ascended to the upper tunnel via the elevator. He located and closed a fire suppression system supply line isolation valve at Adit 6 in the Red Hill upper tunnel, which had no effect on the leak. [Encl (150)]*

144. The Deputy Fuels Director, monitoring operations via a radio from home, overheard reports to the CRO. Once he heard reports of a fuel smell, he ordered the CRO to secure all fuel transfer operations and to call the Federal Fire Department. The Deputy Fuels Director contacted the Fuels Director, who notified the FLC PH CO of the incident. The Deputy Fuels Director arrived on-scene shortly thereafter. [Encl (27)]*

145. At 1718, the CRO contacted Fed Fire. Fed Fire assets were dispatched at 1720 and arrived at 1735. Fed Fire personnel noted a fuel odor at the entrance of Adit 3. A small team entered the tunnel and assessed the leak was not contained, as fuel continued to spill. Fed Fire then took air quality readings and established additional ventilation while FLC PH employees unsuccessfully attempted to isolate the leak. [Encls (149), (152)]*

146. The CNRH ROC called CNRH COS at approximately 1730 and informed him that Fed Fire had responded to Red Hill. CNRH COS then called the FLC PH CO, who informed him there was an ongoing leak at Red Hill that appeared to be water from a fire main. CNRH COS subsequently called the NAVFAC HI CO, who reported the same information. CNRH COS

informed PACFLT GA, who asked him to notify Congressional Delegates (CODELs) and regulators. [Encls (54), (153)]*

147. At approximately 1745, the Deputy Fuels Director arrived on scene. During the drive to Red Hill, he smelled fuel from the H-3 interstate and, upon arrival, concluded the smell was coming from Red Hill. [Encls (122), (154)]*

148. The FLC Deputy Fuels Director stated that the groundwater sump in Adit 3 was not pumping fuel when he got to the scene, but it had been in automatic at the start of the release and was disabled prior to his arrival by FLC staff. This is contradicted by the statement of the FLC engineering technician who states that he secured the pumps after Fed Fire certified the area safe at approximately 2157. [Encls (20), (41), (156), (409)]

149. Although initial responders knew the spill was mostly fuel, the FLC PH CO and NAVFAC HI CO understood it to be water, based on the first reports they received. At 1815, they participated in a group text with the CNRH COS and informed him that the spill in progress at Red Hill was water. [Encls (45), (54), (121), (153), (157)]*

150. The FLC PH CO consulted the CNRH Red Hill Fuel Storage Facility (RHFSF) response plan in the Red Hill control room and understood that he needed to act to control, contain, and recover. However, the guidance was not specific to this type of incident, and the plan does not reference securing the Red Hill well. The FLC PH CO remained convinced of his ability to handle the response throughout the incident. [Encls (12), (158)]

151. While Fed Fire was establishing ventilation in Adit 3, the Fuels Department Engineering Technician accessed the lower access tunnel via Adit 5. He checked the low point drain of the fire suppression system retention pipeline at the main sump and found fuel in the line. He also isolated two valves in the fire suppression system retention line near the oil-tight door in the lower access tunnel. He then returned to the leak location where Fed Fire and FLC PH personnel were completing the safety evaluation. [Encl (20)]*

152. The acting CNRH Environmental Director, who is dual-hatted as the NAVFAC HI Red Hill Production Management Office (PMO) Director, was at the scene based on his primary duty as PMO. The CNRH Environmental Director was off island for leave from 20 November – 2 December. The FLCPH CO felt that if there was a concern regarding a release to the environment, the acting Environmental Director would have informed CNRH that the situation was not stable and/or manageable and the recovery efforts per the CNRH RHFSF response plan were not sufficient to mitigate a risk of release. [Encls (12), (47), (158), (159)]

153. At 1840, the NAVFAC HI PMO Director called the NOSC-R to notify him of a fire main break at Red Hill. The NAVFAC HI PMO Director relayed that only water spilled and asked the NOSC-R if they were required to report the incident. The NOSC-R advised a report was not required for a water spill. The NAVFAC HI PMO Director told the NOSC-R it did smell like

fuel, but this was because the water was entering sumps and causing agitation. The NOSC-R also assessed the tunnel always smelled like fuel. [Encls (31), (160), (161), (162)]*

154. At 1942, with direction from the NAVFAC HI CO, the NAVFAC HI PMO Director texted the CNRH NOSC-R: "Please notify Hawaii DOH about the fire main break at Red Hill." Talking points were summarized as no required notification, no environmental issues or fuel leaks, and fire suppression line leak causing loss of pressure and the Fed Fire automatic response. The NAVFAC HI PMO Director indicated that the reason for reporting was a desire to over communicate, not because a formal report was required. The NOSC-R did not notify DOH due to the NAVFAC HI PMO Director calling back and telling him to hold off on reporting. [Encl (164)]*

155. The NOSC-R received no further communications until 2321, when he received a text from the NAVFAC HI PMO Director asking for Hawaii DOH contact information. The CNRH NOSC-R provided the number for the Hawaii DOH On-Scene Coordinator. The CNRH NOSC-R was not informed that the spill at Red Hill contained anything other than water with a smell of fuel. [Encls (31), (164)]*

156. The CNRH NOSC-R did not report to the scene and was not informed that the spill at Red Hill contained anything other than water. The NOSC still believed the spill was only water until his interview for the Cavanaugh report on 16 December. [Encls (31), (164), (165)]

157. At 1958, the FLC PH CO received updates indicating that the spill was not exclusively water. He then called the NAVFAC HI CO with these updates. The NAVFAC HI CO recommended CNRH COS wait on reporting to DOH in order to gain additional information. [Encls (45), (54), (121), (157), (163)]*

158. At FLC PH CO's direction, FLC PH XO made voice reports to the JBPHH Command Duty Officer (CDO), PACFLT CDO, and the CNRH ROC between 2000 and 2015. [Encls (112), (162), (167)]*

159. The FLC PH CO arrived at Adit 3 at approximately 2145. Shortly thereafter, he learned that the fluid was fuel and called the NAVFAC HI CO to inform him. The NAVFAC HI CO decided to go to Red Hill. [Encls (121), (163), (165)]*

160. At 2157, Fed Fire certified that the scene was safe to enter and informed responders that they did not have the capacity to assist with cleanup efforts. They departed the scene at 2215. [Encls (152), (156), (162), (166)]*

161. At 2157 the Fed Fire battalion chief on site made the determination that the space was safe for personnel using flammability and health readings, and the cleanup crew was already on site. Fed Fire also reported that the NAVSUP Deputy Fuels Director indicated NAVSUP was capable of addressing the spill from that point, which allowed Fed Fire to depart the scene at 2215. Fed

Fire did not record by name who the scene was turned over to. [Encls (30), (152), (158), (166), (168)]

162. After Fed Fire departed, no one announced themselves as the incident commander. Reports indicate most leaders assumed the FLC PH Deputy Fuels Director was in charge, though some subordinates recall NAVFAC HI CO and/or the FLC PH CO being in charge. [Encls (41), (124), (158), (159), (168), (409)]

163. The CNRH RHFSF Response Plan states that the Commanding Officer of the spilling command has incident command, initial reporting responsibility, and the responsibility to elevate the response by requesting assistance if needed. However, the FLC PH CO did not announce himself as in charge at the scene and believed that the Deputy Fuels Director was in charge. [Encls (12), (46), (158), (159)]

164. FLC PH CO's position was that the situation was stable because the assessment by Fed Fire was that the fuel was contained in the lower tunnel and the situation was stable. [Encl (158)]

165. Leaders on site did not request a standup of the EOC or ROC because they believed the spill was contained within the tunnel with no impact to the environment. [Encls (27), (41), (45), (121), (124), (157), (158)]

166. Once the atmosphere was deemed safe, the Fuels Department Engineering Technician went past the fuel leak and secured power to the motor controllers for the CHT sump pumps and the groundwater sump pump near Adit 3. One of two CHT sump pumps was out of commission. After seeing fuel flowing into the CHT sump, he repositioned sand bags that were around the CHT sump to restrict flow into the sump. [Encls (20), (155)]*

167. After securing all sump pumps and closing associated discharge valves, fuel began to fill both sumps. Prior to securing power to the motor controllers, the Fuels Department Engineering Technician observed both pumps running. [Encl (20)]*

168. The FLC Deputy Fuels Director and FLC CO believed the groundwater sump discharged to a leach field underground near the Halawa stream (which is actually a cement spillway running adjacent to Adit 3) and that a release to the environment was possible. FLC checked the stream for a sheen or smell of fuel and found none, so they did not consider the spill a release to the environment. On or around 9 December NAVFAC discovered that the groundwater sump flows to a concrete underground tank which spills over into a leach field. Trees had to be removed to access the underground tank, but once accessed there was evidence of fuel. [Encls (41), (156), (157), (158), (409)]

169. During the response, the CDO called the 24 / 7 watch at the Waiawa pump station at 2130, and a NAVFAC UEM employee responded to the scene at 2230. He opened the door to the Red

Hill well pump room, verified that there was no fuel inside the door and left Red Hill shortly thereafter. [Encls (27), (170), (171), (172)]

170. At approximately 2230, the NAVFAC HI CO arrived at the scene. [Encls (45), (165)]*

171. Between 2230 and 2330, both the FLC PH CO and the NAVFAC HI CO were at Red Hill, and response efforts were underway. During this time both COs knew that the leak was fuel and not water. [Encls (122), (157), (165)]*

172. When asked if he believed the ROC should have been engaged beyond the initial notification, the FLCPH CO said that the NAVFAC HI CO was there and could have made that decision in his capacity as CNRH N4 and as the senior CNRH officer present at the scene. [Encl (158)]

173. The FLCPH CO felt that if the NAVFAC HI CO had issues or concerns with the response actions, he was in direct communications with both CNRH and CNRH COS and would have communicated those concerns. [Encl (158)]

174. At approximately 2330, the FLC PH CO and NAVFAC HI CO made a voice report update to CNRH COM and CRNH COS. The report discussed recovery efforts and the contents of the fluid. The FLC PH CO and NAVFAC HI CO believe that they communicated that the fluid was mostly fuel. [Encls (55), (153), (157), (165)]*

175. CNRH COM and CNRH COS understood the 2330 report to mean that the fluid was water with a smell of fuel and that it was contained in the tunnel. The FLC PH CO later stated, in retrospect, that he may have used the word "contained," but intended to communicate that the spill was "stable and manageable." [Encls (54), (55), (157), (165)]*

176. At 2345, the acting CNRH Deputy Environmental Director called (b)(6) at DOH to report a water / fuel mixture spill in the tunnel. He was initially reluctant to call regulators before they were sure of the facts. [Encls (159), (173), (174)]

177. Although the Regional Environmental Coordinator, CNRH COM reported that he would not normally communicate with state regulators regarding Red Hill without ensuring alignment with PACFLT GA first, which was expressly not the intent of PACFLT GA. [Encls (108), (109), (175)]

178. The NAVFAC HI CO's biggest concerns during the spill were the groundwater sump pump and the CHT sump in Adit 3. He asked about this directly and was informed that FLC PH personnel had secured the pumps immediately. He was also told that the sump pump discharge location had been inspected to confirm the pumps had not activated. [Encls (45), (165)]*

179. The FLC PH CO and Deputy Fuels Director were not concerned about the CHT sump, because they believed the sand bags had been in place around it prior to the incident. [Encl (157)]*

180. FLC PH Fuels Department provided vacuum trucks, and NAVFAC HI provided drivers because FLC PH operators had exceeded allowable work limits. [Encls (122), (162), (170), (176)]*

181. As part of the initial response, the Installation Environmental Program Director (IEPD) received a call from first responders requesting hoses from his team to pump out the spill. [Encl (44)]

182. At the time of the spill and subsequent clean up, there was no knowledge of the hume line drainage system that runs beneath the lower access tunnel and leads to the groundwater sump. [Encls (11), (124), (125), (158), (177)]

21 November 2021

183. CNRH COS notified CODEL staffs, the Office of the Governor of Hawaii, the Office of the Lieutenant Governor of Hawaii, and other state representatives regarding the spill. [Encls (108), (175), (178)]

184. On 21 November, the JBPHH environmental staff sent the day before by the IEPD to assist with pumping the fuel out of the tunnel complained to the IEPD about the strong smell of fuel. Some chose to wear their respirators while working in and near the tunnel. The environmental staff were told by FLC PH responders that the spill was water that contained fuel. [Encl (44)]

185. At no point was the IEPD told that the spill was essentially all fuel. A fuel spill would require a different response and he would have asked NAVFAC Safety personnel to respond. His team relied on FLC PH staff to communicate risks and ensure a proper response. [Encl (44)]

186. At 1000, CNRH COM emailed the PACFLT Deputy Commander (DCOM), RADM Blake Converse, stating, "The leak occurred roughly (b)(3)(A) downhill of the actual fuel tanks in the lower access tunnel and on the way to the tunnel leading to the underground pump station near the Harbor...All the fluid has been contained within the tunnel...It was originally reported as predominately water yesterday, becoming more fuel laden this morning, indicating that water and fuel may have separated over time in the pipe," and "There are no indications of this fluid releasing into the environment, including the groundwater." [Encls (162), (179), (180)]*

187. On the morning of 21 November 2021, CNRH COM toured Red Hill with the FLC PH CO. During the tour, the CO informed CNRH COM that the spill was contained in the tunnel and the tracks. Additionally, the FLC PH CO stated that he was concerned about the groundwater sump pump, as it led to the Halawa stream, but he did not believe this was an issue since the pumps

were secured. During this visit, CNRH became aware that a significant amount of fuel on 6 May 2021 had been accounted for as having gone back into the pipeline. The FLC Fuels Department Deputy Director now believed that fuel went into the fire suppression system retention line and was the source of the fuel on 20 November 2021. [Encl (55)]*

188. During the tour CNRH COM noticed there was a fuel smell, but was informed by FLCPH CO and NAVFAC HI CO that it was a fuel/water mixture. [Encls (121), (124), (175)]

189. While CNRH COM was there, there was a discussion about how much fuel was in the AFFF retention line. Estimates were between 14,000 and 20,000 gallons. During that discussion, the Deputy Fuels Director said words to the effect of "that's where the 20,000 gallons of fuel went." The Deputy Fuels Director was referencing the discrepancy in fuel accounted for following the 6 May spill. This was the first time that CNRH COM heard of the discrepancy of 20,000 gallons of fuel from the inventory accounting. [Encl (175)]

190. By the early afternoon of 21 November 2021, FLC PH Fuels Department personnel erected a catchment below the still-leaking valve with a hose to direct fuel away from the ventilation fan and toward the Adit 3 sump area to facilitate continued recovery via vacuum truck. The leak had continued for approximately 21 hours after the event started before the rate of flow from the pipe allowed personnel to erect the catchment. [Encls (26), (157), (181)]

191. CNRH issued the first press release addressing to the spill at approximately 1618. The message was also posted to the CNRH and JBPHH Facebook pages. The release informed the public that the Navy was investigating the cause of the spill, which was approximately 14,000 gallons of a fuel / water mix that had been recovered and transferred to an above-ground storage tank. [Encls (34), (74), (182)]

192. At 1645 FLC PH released an OPREP-3 Navy Blue UNCLASS message to PACFLT, CNRH, NAVFAC HI and COMNAVSUPSYSCOM. A 3-inch pipe connected to a 14-inch AFFF retention line low point drain cracked in the vicinity of Red Hill Adit 3, lower tunnel access. All released fluid was contained in the lower tunnel. No known fluid was released to the environment. No impact to mission. [Encl (183)]

193. At approximately 1800 NAVFAC authorized the contractor, Pacific Commercial Services, Inc. (PCS) to provide cleanup support at Red Hill as requested by FLC PH. [Encl (184)]

194. NAVFAC HI CO told the acting CNRH Environmental Director to contact the EPA to notify them of the spill. The acting Director was not able to make contact with EPA but intended to follow up the next day. [Encls (159), (185)]

22 November 2021

195. At 0313, FLC Pearl Harbor capped the fire suppression system retention pipeline low point drain when the flow had reduced to a manageable level. FLC PH personnel continued monitoring the site. [Encl (162)]

196. During the day on 22 November, PACFLT senior staff met to discuss the spill. Present at the meeting were PACFLT COM, DCOM, CNRH, FLC PH CO, NAVFAC HI CO, PACFLT GA, PACFLT DMHQ, and other senior leaders. [Encls (11), (125), (177)]

197. At this meeting, CNRH COM reported the working theory that the fuel from the AFFF retention line was 20,000 gallons of fuel that was unaccounted for from the 6 May spill. [Encls (11), (125), (177)]

198. This was the first time that senior leaders at PACFLT heard about the 20,000 gallon discrepancy in fuel inventory following the 6 May spill. [Encl (11)]

199. PACFLT COM expressed that he had lost confidence in the accuracy and completeness of the NAVSUP investigation into the 6 May spill and directed RDML Cavanaugh to investigate the 6 May and 20 November spills. [Encls (11), (186)]

200. CNRH COM provided a brief to Representatives Case and Kahele on the spill and centered the brief on the Navy's response and containment. The Representatives were given a tour of Red Hill and were shown the AFFF Zone 1 sump near Tanks 17 and 18, the beginning of the AFFF retention line, as well as the location of the 6 May spill. They were not taken to the location of the 20 November spill based on their schedule. [Encl (187)]

201. From 1330-1530, NAVFAC HI PMO, Deputy Fuels Director, and (b)(6) conducted a site visit with four staff members from DOH. The tour went through Adit 3 to the location of the broken AFFF retention line valve and summarized how flow travelled to the groundwater sump near Adit 3. [Encl (189)]

202. NAVFAC Staff confirmed to the DOH representatives that fuel did not flow on the surface into the Red Hill well pump room. [Encl (189)]

203. On the site visit, DOH requested that the Navy confirm there was no sheen in the Halawa stream. FLC staff confirmed that there was not. [Encl (189)]

204. At 1601, CNRH issued a press release saying the Navy stopped the release of the water and fuel mixture and continued to coordinate with and provide information to DOH and the EPA. There were no signs or indication of any release to the environment and the drinking water remained safe. [Encl (190)]

205. That week, NAVFAC HI attempted to calculate the potential leak rate through the concrete. NAVFAC HI PMO completed an analysis and said that an insignificant amount could leak through the concrete given the amount of time the fuel was sitting on the deck. They did not discuss securing the well within that discussion. [Encl (124)]

23 November 2021

206. By 23 November, the FLC PH CO's concern was how to mitigate water entering the groundwater sump as it was no longer able to function as originally designed (i.e. discharging external to Adit 3 via the discharge line). The pump had been secured during the spill so it was possible the sump could overflow. FLC PH stationed a vacuum truck outside Adit 3 and started pulling material from the groundwater sump. They also set a 24/7 watch to make sure it was not overflowing. [Encl (158)]

207. At 0722, NAVFAC HI Environmental (NAVFAC HI EV) staff received an e-mail from U.S. Army Group – Hawaii, Department of Public Works – Environmental, requesting an update on the monitoring and current status of the water quality. This was a general inquiry and not in response to any reports of water quality issues. The email was forwarded to NAVFAC HI PA to coordinate a response through CNRH PA. The response was coordinated and returned to NAVFAC HI EV on 24 November. NAVFAC HI EV did not respond to the Army email until 29 November. [Encls (191), (192), (193), (194)]

208. At 1430, PACFLT COM and other PACFLT leadership toured Red Hill. Due to cleaning and remediation of the tunnel that occurred over the previous few days, there was no sign of a spill during the tour. [Encls (11), (158), (177), (195)]

209. The proximity of the well to the spill location was not apparent to any of the PACFLT team during the tour. [Encl (177)]

210. During the tour, PACFLT COM questioned the FLC PH CO and NAVFAC HI CO regarding the potential for environmental contamination. They said that there was no risk to the environment: fuel could not seep through the concrete tunnel; there was 100 feet of rock above the aquifer so no substantial amount of fuel could seep through; and fuel was collected in the groundwater sump and pumped out using trucks. [Encls (11), (124)]

211. PACFLT COM called Senator Hirono and told her that he had directed an investigation by a cross-functional team to examine all aspects of the 6 May and 20 November events. [Encl (196)]

24 November 2021

212. At some point in the week after the spill, there were internal discussions within NAVFAC HI about what should be done to monitor the environment. They discussed increasing the

frequency of monitoring well sampling, including at the Red Hill well. However, the well was already scheduled to be sampled on 24 November and that was deemed sufficiently soon. [Encls (124), (158); (197)]

213. The scheduled Red Hill well water sample was taken from the low flow pump that takes water from two feet below the well water surface. This was sent to the mainland for expedited testing and results were returned on 3 December 2021. The TPH results were non-detect; however, there were estimated detections of three naphthalene compounds. Samples were not taken at the water surface. [Encls (124), (198), (241)]

214. On 24 November DOH sent a Notice of Interest (NOI) in a Release or Threatened Release of Hazardous Substances for the 20 November spill to CNRH. The NOI included requirements for additional sampling and development of work plans to remediate the area, among other items. CNRH emailed a sampling plan in response to the NOI on 29 November. [Encls (199), (200)]

25 November 2021

215. Thanksgiving holiday. With the exception of the FLC PH 24/7 watch stationed with a vacuum truck to make sure the groundwater sump was not overflowing beginning on 23 November, there was no activity at Adit 3 and the November spill site. [Encl (124), (158)]

26 November 2021

216. The FLC PH CO gave a verbal order to minimize fuel transfers to, from, and between the storage tanks located in Red Hill, effective 27 November. This order was given due to the ongoing investigation. [Encl (201)]

27 November 2021

217. At 1830, a PPV resident complaint was forwarded by the JBPHH CDO to the JBPHH Public Works Department (PWD) help desk, marking the first phone call (from a resident of Moanalua Terrace) complaining of a chemical smell in their water. This is the earliest report of the issue. There is no indication that action was taken beyond logging it. [Encls (194), (202), (203)]

218. Extensive social media research was conducted by the investigation team to determine if reports or references to chemical smells were posted between 20 and 27 November. There was no indication that there were earlier reports prior to this report to the JBPHH CDO. [Encl (204)]

219. From 20 November through 28 November, the JBPHH PWO's understanding was the spill was primarily water and maybe AFFF but could not recall any discussions during this period of time that touched on fuel as being a primary part of the spill. It was not until after reports of

water contamination surfaced that the PWO first visited the area near the Adit 3 Y and the Red Hill well. During the intervening eight days, he could not recall conversations about any environmental issues that caused him concerns about risk of contamination of the well. [Encl (43)]

28 November 2021

220. The first calls received by the Army from Hickam Communities or AMR / Red Hill with water quality concerns were logged into the Hickam Communities, LLC, maintenance system on 28 November. [Encl (205)]

221. Phone calls from residents to the JBPHH PWD help desk complaining of a chemical / fuel smell in their water began at 0749 on 28 November and continued throughout the day. Thirty-seven calls were received that day. [Encls (10), (194), (202), (206), (207)]

222. All public works related calls to the JBPHH CDO or PPV help desk are routed to the PWD trouble desk, who take it for action. The CDO contacted the Drinking Water Distribution System Operator at approximately 0900 to investigate the reports of the smells in the water. [Encls (10), (194), (202), (206), (207)]

223. At approximately 1600, the JBPHH PWO informed the NAVFAC HI CO of the reports of a chemical/fuel smell in the water and also reported that utilities teams had been dispatched to the residences to verify chlorine levels were appropriate. After monitoring with handheld colorimeters and checking the chlorine dosage logs, the team determined the chlorine levels were consistent with those expected in the distribution system and reported this at 1609. [Encls (10), (43), (124), (208)]

224. The field team also tried to use a colorimetric test for fuel but it did not detect contamination. [Encl (10)]

225. While exploring the source of these complaints, the JBPHH PWO was informed that the 20 November spill was fuel. Up to this point he was not aware that fuel was spilled. [Encls (10), (43), (124), (208)]

226. NAVFAC HI visited four water storage tanks on the eastern side of the Navy distribution system (including the Red Hill storage tanks, S-1, and S-2) and could not smell any odor at the tanks. They also confirmed that the storage sites had not been tampered with. [Encls (10), (42), (43), (209)]

227. NAVFAC HI and Red Hill PMO visited three homes and confirmed a faint chemical / fuel smell in the water. [Encl (159)]

228. NAVFAC HI CO informed FLC PH CO of the reports. FLC PH CO met with NAVFAC HI CO at Adit 3 to investigate the well. FLC PH CO was there in a support role. The water distribution sites are owned by CNIC, but NAVFAC is the program manager / "owner" for maintenance of the system. [Encls (43), (158)]

229. The JBPHH PWO, NAVFAC HI CO, FLC PH CO and the UEM Potable Water Commodity Manager also went to the Red Hill well to conduct a visual inspection of the well. There was no visible fuel on the surface of the water and there was not a discernible odor of fuel specific to the well, though the tunnel itself still smelled of fuel. [Encls (43), (124), (188), (209)]

(b)(3)(A)

(b)(3)(A)

NAVFAC HAWAII
JOINT BASE
PEARL HARBOR - HICKAM
POTABLE WATER SYSTEM
SCHEMATIC



230. On the evening of 28 November, NAVFAC HI CO and JBPHH PWO thought that the fuel smell in the drinking water could be coming from the Red Hill well because the impacted housing areas were closest to the Red Hill well and they could not otherwise explain it. This assumption was made despite the fact that there was not data positively confirming contamination at that time. Environmental and Utility staff were not consulted. [Encls (43), (46), (124); (159), (175), (209), (210)]

231. NAVFAC HI CO and JBPHH PWO called CNRH COM and recommended shutting off the well. CNRH COM concurred. The well was secured at approximately 1930 using the remote operating feature from the 24/7 Watch Office at the Navy's Waiawa well pump station. There was no discussion with Public Affairs to generate a press release about the closure. [Encls (43), (46), (124), (159), (175), (209), (210), (211)]

232. CNRH COM was not sure he had the authority to secure the well but felt it was the right thing to do, especially since the well only supplied about 15% of the water in the Navy distribution system. CNRH COM believed the consequences of shutting down the well were negligible to the Navy's ability to supply water. [Encl (175)]

233. FLC PH CO directed a trend analysis on the bulk fuel storage tanks to ensure there was no movement of fuel from the tanks, and gave an order to cease all movement of fuel in the system. [Encl (158)]

234. At 2133 CNRH issued a press release informing people that the Navy was investigating reports of a chemical smell in drinking water from some residences. The release said that there was no immediate indication that the water was not safe, and the Navy was continuing to investigate, test the water, visit homes, and investigate the drinking wells. This was the first press release related to the well contamination issue and did not reference the well being secured. [Encl (212)]

235. NAVFAC HI CO was able to personally smell a chemical/petroleum odor in the water at the NAVFAC HI HQ building around 2200. [Encl (10), (188)]

236. NAVFAC collected samples from the Red Hill well after it was secured. Samples were also taken from NAVFAC HI HQ in Building A4 and seven other locations. The only test available on-island, and therefore with a quick return, was total organic carbon (TOC) testing through the JBPHH environmental laboratory that tested to a reportable limit of 5 parts per million (PPM). Although not sensitive enough to detect fuel near the EPA limit, this was the most sensitive type of test that could be processed in Hawaii. [Encls (44), (124), (213)]

237. CNRH COM provided an update to PACFLT COM on the reports of fuel in the water and securing the well out of an abundance of caution in the early morning hours of 29 November. CNRH COM detailed efforts taken and the way forward to deal with the problem. [Encl (120)]

29 November 2021

238. JBPHH stood up their Emergency Operations Center (EOC) in response to the complaints. [Encls (42), (210)]

239. CNRH established the JBPHH Water Quality Crisis Action Team (CAT). [Encls (184), (210)]

240. CNRH began “heat mapping” phone calls. [Encl (175)]

241. The results from screening level TOC samples collected by NAVFAC on the evening of 28 November were negative and were provided to DOH on Monday, 29 November. DOH was provided with water from these samples for their own screening tests. [Encls (44), (124), (213)]

242. JBPHH Public Works began a drinking water system flush in Eastern Housing, Ohana Nui, and Hickam via 12 fire hydrants. The locations were chosen by the Utilities Division based on system location and the proximity to empty space for the flushed water. Flushing secured at 1830 and re-commenced on 30 November, the next day. [Encl (211)]

243. Throughout the day, resident social media posts regarding smells of fuel in the water increased in number. [Encl (175)]

244. Fed Fire responded to a Pearl Harbor Child Development Center (CDC) following a report of a fuel smell in the water. Pierside CDC, Ford Island CDC, and Peltier CDC were all sampled in the week following 28 November. [Encl (202), (275)]

245. PACFLT COM briefed his staff at the Monday staff sync regarding the possibility of water contamination. Under his authority as Senior Officer Present in Hawaii, PACFLT COM assigned PACFLT DCOM to lead the PACFLT CAT for Red Hill. PACFLT COM’s priorities for the task force were 1) take care of people, get the word out, and bound the problem; 2) clean up the drinking water; and 3) fix the well. The PACFLT Surgeon was part of the CAT as head of the Medical Working Group. [Encls (11), (214), (215), (216)]

246. PACFLT Surgeon contacted Navy and Marine Corps Public Health Center (NMCPHC) CO for assistance and expertise. He also reached out to the Navy Environmental Preventive Medicine Unit 6 on island, which falls under NMCPHC. [Encl (214)]

247. CNRH PA took the lead on communications with civilian media supported by JBPHH PA, PACFLT PA, and FLC PH PA. [Encls (34), (191), (217)]

248. On 29 November, NAVFAC HI environmental staff responded to the 23 November email from Army Public Works environmental staff inquiring about the status of the monitoring and water quality. In the reply, NAVFAC HI environmental staff advised that the spill was stopped and the water/fuel mixture was placed into an above ground storage tank. Additionally, the Navy was coordinating with DOH and EPA and that samples of the drinking water were being taken weekly. There were no impacts to the soil and the drinking water remained safe. CNRH PA, as well as FLC PH and NAVFAC HI reviewed and approved the response on 24 November. [Encls (34), (191), (217)]

249. CNRH Environmental staff and PWO staff developed a sampling plan and began sending daily expedited samples to the mainland to be analyzed using the 8015/BTEX method. These tests allow a more sensitive detection of total petroleum hydrocarbons. [Encls (46), (124)]

250. At 1100 CNRH PA completed the JBPHH Water Quality Communication Plan working document. The communication plan was to be updated daily and coordinated with PACFLT, CNIC and CHINFO. The communication goals were to keep residents, families, base workers and anyone drinking Navy water informed on all actions and efforts to protect the water and individuals while reinforcing transparency of process and efforts. Themes, messages, audiences, timeline and tactics are included in the plan. [Encl (218)]

251. (b)(6) Deputy Director for Environmental Health at DOH, reported to CNRH that DOH was receiving complaints of a fuel / chemical smell in the water in Army housing at the Aliamanu Military Reservation (AMR). (b)(6) was unable to provide the number of calls received and said that DOH was going to recommend shutting down the entire Navy water system. [Encl (175)]

252. (b)(6) did not provide an analytical basis for shutting down the entire Navy water system, vice specific portions. Following the discussion with (b)(6) CNRH COM was concerned that they could not provide water to approximately 9,000 families if the recommendation from Hawaii DOH was adopted, so CNRH COM called JBPHH CO and directed him to begin finding drinking water sources and to prepare to contract for water services. [Encl (175)]

253. PACFLT DCOM spoke with (b)(6) regarding the situation at around 1200. (b)(6) reiterated the same concerns and DOI's prospective recommendation. PACFLT DCOM told her that they had bounded the locations and suggested figuring out what those neighborhoods are and putting out guidance focused on the problem areas. (b)(6) agreed that that made sense and acknowledged that she did not have the Navy's data. [Encl (11)]

254. PACFLT DCOM offered to provide the Navy's data and requested data from (b)(6). She said that she did not have data available; DOH was just getting calls. PACFLT DCOM then told CNRH COM that he needed CNRH people to work with DOH to get whatever data they had. Once it was known that the Army was receiving complaints, they requested the Army's data as well. PACFLT DCOM spoke with (b)(6) a couple of additional times during the afternoon in an attempt to reach alignment between DOH and Navy regarding the way forward and to send a joint press release on the situation. [Encl (11)]

255. At 1204, State Representative Aaron Johanson emailed NAVFAC HI PMO and (b)(6) reporting complaints from a constituent in Navy housing that there was jet fuel in her water and that she was able to set her drinking water on fire. NAVFAC HI PMO responded that the Navy was aware of the problems with water quality in housing and were collecting additional samples for analysis. (b)(6) and (b)(6) of DOH were also on the email, and (b)(6) was copied. [Encl (219)]

256. At 1250 the JBPHH CO released a statement to base housing residents reinforcing his team's commitment to the health and safety of the residents, that there were no immediate indications that the water was not safe, and that he and his staff were drinking the base water. The statement was coordinated through CNRH PA and PACFLT, at least up through PACFLT PA, as well as through CNRH COM and CNRH COS. The statement was initially disseminated via an e-mail to the Project Directors at Ohana Military Communities and Hickam Communities to post on their resident portals. [Encl (35), (220)]

257. At approximately 1900 on 29 November, DOH issued a press release recommending all Navy water system users avoid using the water for drinking, cooking, or oral hygiene. Navy water system users who detect a fuel odor from their water should avoid using the water for drinking, cooking, bathing, dishwashing, laundry or oral hygiene (brushing teeth, etc.). [Encls (11), (175), (221)]

258. Following the DOH press release, at 2026 CNRH issued a press release saying that the Navy was working with DOH to resolve reports of a chemical odor in military housing, recommended that residents avoid ingestion as a cautionary measure if chemical or petroleum odors are present and that samples have not detected petroleum in initial testing. The Navy was moving forward to provide sources of drinking water to affected residents and to sample affected locations. [Encl (222)]

30 November

259. By 30 November, CNRH had received over 200 trouble calls to the EOC, with the areas of concern centering in six PPV neighborhoods: Radford Terrace, Halsey Terrace, Catlin Park, Doris Miller, Moanalua Terrace and Ohana Nui. [Encls (175), (224)]

260. At 0901, a message was posted to the JBPHH Facebook page saying that the EOC had stood up an information cell to receive calls from residents in military housing who have concerns about their water. The same message was also posted to the CNRH Facebook page. [Encl (223)]

261. CNRH COM conducted a phone call with Hawaii Lieutenant Governor Josh Green in the morning, updating him on actions being taken. Dr. Green expressed his support and offered assistance if needed. CNRH COM also provided updates to Representative Kahele and Honolulu Mayor Blangiardi. [Encls (175), (224)]

262. At 1221, PACFLT DCOM emailed the USARPAC COS requesting logistical support from the 25th Infantry Division (ID) to provide water trailers (10 x 2,000 gallon capacity) for JBPHH communities. Elements of the Army's 25th ID deployed to the Army housing areas and began distributing water to houses on 30 November. Encls (175), (225), (240)]

263. At 1414, an update was provided via press release advising that the primary water distribution mains associated with the housing areas affected by possible potable water contamination had been flushed twice and a the third flush was ongoing. Residents were asked to run water in their homes to flush the individual lines to each residence. The public was also notified that no petroleum or contaminants had been detected in testing at affected sites or at wells and tanks; however, there remained a concern that residual contamination may exist in some of the water lines based on continued reports from residents. [Encls (226), (227)]

264. By 1600 on 30 November, the Navy set up four water distribution sites at the Main Pearl Harbor NEX Parking lot, Halsey Terrace Community Center, Catlin Park Community Center, and Ohana Nui. Community members were notified via press release at 2200, including JBPHH and CNRH Facebook posts at 2246. [Encls (175), (224), (228)]

265. In response to a request from DOH, NAVFAC HI PMO emailed the water system map, emergency action plan and groundwater protection plan to DOH. [Encl (229)]

266. A sample was taken for testing from the Red Hill Elementary School. This sample returned positive for TPH-O, which is characteristic of a heavier oil, not typical of JP-5. TPH-O is not an indicator of the presence of JP-5 fuel. [Encls (11), (214)]

267. In the evening of 30 November, four town hall events were held: 1 and 2) Hickam Theater (1800 and 1900), 3) Moanalua Terrace Community Center (1900), and 4) Halsey Terrace Community Center (1900). Participants included CNRH COM, PACFLT DCOM, NAVFACPAC COM, JBPHH CO and JBPHH Deputy. [Encls (175), (224), (230)]

268. At 2345, residents were notified that showers were available at JBPHH for those in affected military housing who had concerns with the water quality at their residences. [Encl (231)]

1 December

269. DOH and EPA representatives were invited to the PACFLT CAT team. (b)(6) and (b)(6) of DOH both joined the CAT meeting at 0800. [Encls (210), (214), (239)]

270. Results from the more comprehensive samples drawn on 29 November were received from the CONUS laboratory with 13 of the 14 samples reporting as non-detect. Only the Red Hill well had a detection of trace hydrocarbon constituents, but these were below threshold amounts. These samples were analyzed using a method that takes longer to complete but enables a lower detection limit. Labs with the ability to use this method and are certified by the State were not available in Hawaii. This is the first analytic data providing any indication that JP5 fuel was in the water. [Encls (11), (232), (241)]

271. A sample taken from the Red Hill well on 1 December showed estimated detections for several petroleum hydrocarbons and total petroleum hydrocarbons, gas (TPH-G). TPH-D and TPH-O exceeded the EALs but decreased to non-detect after the use of silica gel cleanup. [Encl 233)]

272. Free water was made available for residents of base housing from the JBPHH NEX and Commissary. CNRH also directed JBPHH CO, FLC PH CO, and PACFLT N4 to acquire water from NEXCOM and Pepsi. [Encl (234)]

273. At 1334, CNRH PA launched the "Joint Base Pearl Harbor-Hickam Water Resources and Updates" webpage. The webpage and information went live on both the CNRH and JBPHH pages. [Encl (235)]

274. At 1556, CNRH issued a press release announcing an Army-hosted town hall event that night for AMR residents, provided updates on potable water availability, and updated JBPHH EOC phone numbers as well as website information. [Encl (236)]

275. Potable water trucks provided by the Army were stationed at the Halsey Terrace Community Center, NEX parking lot, Moanalua Terrace, Catlin Park Community Center, Hickam Makai Rec Center, and multiple locations in AMR Housing. [Encl (236)]

276. At 1603, CNRH PA provided updated information on available shower locations on JBPHH. [Encl (237)]

277. Following concerns from OPNAV, CNIC and NMCPHC water program and risk communication experts regarding the language used in initial releases to the public, CNIC HQ directed CNRH Environmental and the CNRH Public Health Emergency Officer (PHEO) to get PAO guidance from NMCPHC, the Navy's experts at risk communication in public health matters. [Encl (238)]

278. PACFLT Surgeon reached out to the Army Public Health Center to initiate dialogue and led an effort to develop a standardized form for short-term medical screening and documentation of exposure / symptoms. The CNRH PHEO participated in these efforts. [Encl (214)]

279. At 1900, PACFLT COM, PACFLT DCOM, CNRH COM and JBPHH CO, in coordination with the Army Garrison commander, conducted a town hall event at AMR. Deputy ASN (E, I & E) Balocki participated in the event. [Encl (239)]

2 December

280. PACFLT COM contacted Honolulu Mayor Blangiardi and updated him on situation. The mayor wanted to know how he could best support the Navy. [Encl (241)]

281. USARPAC stood up Task Force Ohana and authorized their initial evacuation order to Army personnel in affected housing. They began placing residents into government procured lodging. The Army had a pre-existing contract as part of their COVID mitigation measures to leverage for the process of procuring large quantities of hotel rooms. There was no coordination with the Navy prior to the Army starting these initiatives. [Encls (175), (241)]

282. CNRH determined that the Navy needed a means to provide lodging and/or temporary lodging allowances (TLA) in order to provide Navy/JBPHH PPV residents similar services. [Encl (175)]

283. The PACFLT Surgeon stood up the Joint Health Services Working Group, which met daily to facilitate understanding and communication between joint and interagency medical leaders. Members included the DOH toxicologist (Dr. (b)(6)), as well as medical professionals from the Army, Air Force, INDOPACOM, and military treatment facility staff, as well as veterinarians, and others. PACFLT Surgeon credited the early recognition of the need for this coordination with the development of a cohesive sight picture for the medical community by the end of the first week. [Encl (214)]

284. The Joint Health Services Working Group began efforts to create the medical registry for potentially impacted individuals. [Encl (214)]

285. At 1505, a message was posted to the JBPHH and CNRH Facebook pages informing that the Military Family & Support Center had established an Emergency Family Assistance Center (EFAC) to assist affected personnel, including medical assistance. [Encl (223)]

286. At around 1600 the first Public Affairs Communications Plan was provided to CHINFO by PACFLT. PACFLT gave direction that there should be full transparency, to provide any information available and caveat it with the confidence level of that information if necessary. [Encls (241), (242), (243)]

287. The NAVFAC HI Ops Officer reported observations of a fuel smell and a sheen on top of the water in the Red Hill well. NAVFAC HI Utilities staff reported seeing a stain on the concrete wall of the well at approximately the elevation of the groundwater sump, which led to further investigation. Photoionization detector (PID) test results taken by contractor AECOM indicated hydrocarbon vapor above the waterline. From these observations, it was obvious there was fuel in the well before lab test results above the EPA limit were received. This is the first positive confirmation of fuel in the Red Hill well. [Encls (10), (124), (210), (244)]

288. A sample was taken from the Red Hill well on 2 December and analyzed. The preliminary results returned on 6 December and confirmed that the fuel in the water was consistent with the carbon signature of JP-5. [Encl 286)]

289. During a HASC Readiness Subcommittee Hearing, Rep Kahele questioned VADM Williamson (OPNAV N4) on the Navy's response at Red Hill and called the situation "absolutely unacceptable." [Encl (245)]

290. At 1900 PACFLT DCOM, NAVFACPAC COM, CHRH, PACFLT Surgeon and NAVFAC HI CO conducted a Virtual Town Hall on JBPHH Facebook Live to provide updates on actions taken and services available and answer questions from residents. [Encl (246)]

291. At 2204, CNRH issued a press release saying the Navy detected petroleum products in Red Hill Well, and that the well had been secured since 28 November. This is the first public report that the well had been secured. [Encl (247)]

3 December

292. CNRH provided a letter to DOH confirming the release of approximately 14,000 gallons of a mix of water and fuel from a fire suppression drain line in the tunnel downhill of the Red Hill Bulk Fuel Storage Facility. [Encl (248)]

293. PACFLT COM provided an in-person brief for Representative Case and phone updates for the Governor of Hawaii, Senator Hirono, Senator Schatz, Representative Kahele and State Senate President Couchee. Updates centered on support to families, testing protocol, restoring confidence with community and commitment to investigate Red Hill associated events. [Encl (210)]

294. PACFLT COM also provided an email update to the Governor of Hawaii. PACFLT COM sent the Governor updates he had provided to SECNAV and CNO. PACFLT COM also provided water test sampling results. [Encl (241)]

295. PACFLT staff launched the JBPHH Water Updates web page that replaced the Region web page for sharing information. [Encl (249)]

296. At 1900, PACFLT DCOM, CNRH, PACFLT Surgeon, JBPHH CO and NAVFAC HI CO conducted a town hall at Hickam Theater to provide updates on actions taken and services available and to answer questions from residents. [Encl (250)]

297. At some point after 28 November, the FLC PH team noticed that the groundwater sump would reach a certain level, then stop filling even though the pump was secured and the discharge line isolated. They were unsure of where the water was going. It was then drained, and on 3 December it was ordered vacuumed out daily. [Encl (158)]

298. The Honolulu Board of Water Supply's (BWS) Halawa well is approximately (b)(3) (b)(3)(A) [REDACTED] The Board announced on 3 December that they had secured pumping from this well. [Encls (12), (271)]

299. The Navy's Aiea Halawa shaft is (b)(3)(A) CNRH directed shut down of the Navy's Aiea Halawa shaft in an abundance of caution to prevent potential westward contaminant migration in the aquifer and because there were concerns over high chloride concentrations caused by saltwater intrusion. [Encls (11), (12), (43), (46), (251), (273)]
300. In addition to closure of the Red Hill and Aiea Halawa wells, the Honolulu BWS secured their interconnections with the Navy's system and removed the meters. [Encl (10)]
301. By the afternoon of 3 December, CNRH was able to execute options for both government procured lodging and authorization for individual procured lodging for service members, federal civilian employees and their dependents. [Encls (175), (252), (253)]
302. The JBPHH Deputy directed the CNIC web page to be updated and a Facebook posting with the JBPHH TLA Execution Plan. The TLA Execution Plan included the use of 16 phone lines at the Military & Family Support Center and JBPHH EOC, with walk-ins at the Military & Family Support Center Emergency Family Assistance Center also available. [Encls (175), (252), (254), (255), (256)]
303. In early December, CNRH Environmental negotiated with DOH to allow flushing of hydrants if the hydrants were monitored during the flush, sampled for TPH pre- and post-flushing, and the water ran onto land and not into the streets. JBPHH Public Works personnel failed to comply with these requirements by allowing the water to run into the street, resulting in a cease and desist order from DOH received on 3 December. This was followed by the requirement to use the 1 million gallon per day (MGD) granular activated carbon (GAC) units for flushing which began in mid-December. [Encls (47), (257)]
304. On 3 or 4 December CNRH engineer (b)(6) while looking at drawings of the Red Hill facility from the original construction, discovered the huge drain feeding into the groundwater sump that was impacted by the 20 November spill. This provided a path for fuel entering the sump to then travel under the tunnel floor and into the soil and rock below. This was the first indication of the most likely path from the fuel spill to the well. [Encls (143), (258), (394)]

4 December

305. On 4 December, PACFLT released an Execute Order establishing the responsibilities of cognizant Echelon 2 Navy commands to support the JBPHH community. The objectives were to restore safe drinking water and reestablish public confidence in the water supply system. [Encl (215)]
306. At 1100, following a press release notifying people of the event, PACFLT DCOM, CHRH COM, PACFLT Surgeon and NAVFAC HI CO conducted a Virtual Town Hall on JBPHH

Facebook Live to provide updates on actions taken and services available, as well as to answer questions from residents. [Encls (259), (260)]

307. A screening level TOC sample taken from the Aliamanu Military Reserve Housing Area (Army) was the first to positively detect hydrocarbons in the distribution system. The results were below the EAL. [Encls (210), (260)]

308. CNRH received a formal Request for Records from DOH at 1643 requesting sampling plans, data, methodology, and analytical reports concerning groundwater and drinking water in response to the petroleum contamination event. The request applied to future records generated as well. [Encls (261), (262)]

5 December

309. Governor Ige and Hawaii's Congressional Delegation called for suspension of Red Hill operations in a statement to the public. [Encls (263), (264)]

310. SECNAV met with Representatives Courtney, Garamendi, and Kahele regarding the contamination of the water from Red Hill. [Encl (210)]

311. Hawaii State Representative Aaron Ling Johanson contacted CNRH PAO via e-mail asking how to best advise citizens seeking immediate relief / recourse. The CNRH PAO provided the PACFLT website and information on lodging procurement for military-affiliated individuals affected by the water-related health and safety concerns and categories of lodging procurement (TLA, temporary duty orders and government contracted lodging information). [Encl (265)]

312. Hawaii State Senator Glenn Wakai requested from the CNRH PAO a graphic of Red Hill Bulk Fuel Storage Facility showing how fuel is moved from the facility. The CNRH PAO contacted PACFLT GA, who directed coordination with the NAVFAC HI PMO Director to find a suitable graphic. [Encl (265)]

313. On 5 December a sample was taken from the Navy's Aiea Halawa well building from a sample point in the chlorination system. The results, returned on 8 December, showed elevated detections of petroleum hydrocarbons. The Navy determined that, because that well had been secured since 3 December and the sample was drawn from the non-operating chlorination system, the sample in question was not representative of the water in the well. Samples taken prior to the shutdown of the well showed no signs of contamination. PACFLT DCOM called the DOH Deputy Director and the Honolulu BWS Manager, (b)(6) to explain the situation. However, on 10 December the Honolulu BWS held a press conference announcing that contamination was found in the Navy's Aiea Halawa well. [Encls (11), (210), (272)]

314. At 1448, the JBPHH CO apologized via JBPHH Facebook post for the comments that he made in his 29 November assurance to families that the drinking water was safe. [Encl (223)]

315. At 1500, SECNAV participated in a town hall event at the Hokulani Community Center. This event was also broadcast on the JBPHH Facebook page to provide residents updated information about the water issues. The event lasted almost five hours. [Encls (175), (266)]

316. CNRH received initial approval from DOH for divers to enter the Red Hill well. Mobile Diving and Salvaging Unit (MDSU) divers entered the well and could see fuel entering along the ceiling of the developmental shaft. This triggered the deployment of absorbent materials and the search for other ways to skim fuel from the surface of the water. Though they initially agreed to the diving operations, DOH ordered that diving stop on 8 December until a recovery plan was renegotiated. Permission was granted to continue on 9 December. [Encls (46), (47), (267)]

317. At 1947, CNRH COM was contacted by State Representative Bob McDermott raising a concern that qualified civilians who live in some off base housing have no point of contact for temporary lodging and assistance. CNRH COM thanked him for bringing the issues to his attention and informed him that CNRH was working to remove barriers and align resources while operating across many differing government directives covering each individual. [Encl (268)]

318. At 1957, a posting was made to the JBPHH and CNRH Facebook pages informing that the JBPHH Military Family & Support Center had licensed clinical counselors and chaplains available at the Emergency Family Assistance Center (EFAC) to assist anyone in need. [Encl (223)]

319. Following his response to Representative McDermott, CNRH COM directed personnel to take action to account for and take care of the federal employees / civilians, contractors, and retirees in the housing community. This included direction to set up a dedicated phone, resource, table or advocate to address each one of our non-uniformed members / dependents; update the web page with a tab for them; get people trained so that no person is told "no" or passed off to another phone number without a follow up. He also directed his CMC to reach out to Representative McDermott's office to get additional information. [Encl (269)]

320. The water line from Bishop Point (Hickam) to Iroquois Point, a neighborhood supplied by the Navy water distribution system, was secured due to resident complaints. The neighborhood continued to receive service from another Navy line, so they had access to water. [Encl (279)]

321. Joint Health Services Working Group finalized guidance for medical staff / providers on how to speak with concerned residents. [Encls (214), (280)]

322. CNRH sent a letter at 2116 to DOH acknowledging receipt of the 24 November Notice of Interest and expressing the intent to continue communication and coordination with DOH. [Encl (281)]

323. Throughout the week of 29 November housing residents provided comments on the JBPHH Facebook page and made comments at the town halls reflecting concerns and frustrations with the water situation and lack of trust in the Navy's response. [Encl (270)]

6 December

324. SECNAV toured Red Hill with CNO, PACFLT COM, NAVFAC PAC, CNRH, FLC PH CO and NAVFAC HI CO, and also had lunch with Governor Ige. [Encls (210), (283)]

325. SECNAV participated in teleconference with the Hawaiian Congressional delegation. [Encls (210), (283)]

326. SECNAV, Chief of Naval Operations (CNO) and PACFLT DCOM conducted a joint press engagement at 1330 at the US PACFLT Headquarters. The event was advertised to the press via a media release on the previous day. [Encls (282), (283)]

327. On 6 Dec 2021 PACFLT COM and DCOM met with Governor Ige, DOH Director (b)(6) and (b)(6) [Encls (210), (283)]

328. Also on 6 December, DOH requested via email to collect samples at Navy facilities. In the affirmative reply, the CNRH Environmental Director requested that the Navy be allowed to conduct split sampling. Split sampling is conducted by taking two or more representative portions from one sample or subsample and analyzing them by different analysts or laboratories. Split samples are used to replicate the measurement of the variables of interest. The requested sampling was conducted on 7 December. [Encls (274-276)]

329. DOH emailed CNRH with an updated groundwater sampling plan to be in effect over the following two months. The request included timelines, analytes to be sampled for and sampling locations. CNRH responded with clarifying questions on 7 December. [Encl (277)]

330. At 1705, JBPHH and CNRH Facebook posts informed residents that partial TLA (meals only) was authorized for personnel residing and remaining in their base housing. Temporary lodging was approaching 1,200 families in hotels from an occupied home inventory of 4,801 in Navy / Hickam areas of concern. [Encls (223), (283)]

331. Beginning in the evening, a heavy rain event caused water to build up and pool in the area outside of Adit 3, which overflowed into the Adit 3 tunnel. During this event, the CHT tank outside of Adit 3 overflowed and fuel came out of the tank. At that point, personnel recognized that fuel had been pumped out of the CHT sump and into this CHT tank outside of Adit 3 during the 20 November spill. FEDFIRE was called and responded to the Fuel release. The EOC was already active and it was reported to them as well. Personnel from FLC PH attempted to notify the NOSC but were unable to reach him. FEDFIRE produced a report of their response to this event that characterized the incident as a fuel release. The CNRH Environmental Director

reported that the overall flooding event was covered in the site characterization plan submitted to DOH on 8 December; however, the specific issue of the CHT tank overflowing fuel was not reported. Of note, the CNRH Environmental Director was unaware that the tank overflowed or that fuel was released until interviewed during this investigation in March. When subsequently questioned about the rationale for not reporting the CHT tank fuel release, the CNRH Environmental Director assessed that this did not trigger a formal release notice to regulators because she relied on the assessment from the FLC PH CO that there was not a release of fuel to the environment during the flooding event. However, as of 15 April 2022, the CNRH Environmental Director intends to discuss this matter with DOH at the next Site Characterization Discussion scheduled for 21 April 2022. [Encls (41), (47), (158), (278), (409), (410)]

332. A significant fuel smell was observed near Adit 3 during and immediately after the heavy rains. [Encl (43)]

333. At 1956, a JBP HH and CNRH Facebook post informed residents that all water distribution locations and Halsey Terrace shower and laundry facilities will cease operations due to the weather event. [Encl (223)]

334. DOH issued an order to the Navy to suspend operations at Red Hill Bulk Storage Facility, take measures to treat contaminated water at the Red Hill shaft and safely remove fuel from the 20 underground storage tanks. [Encls (210), (284)]

7 December

335. The Environmental team received first sample results from the Red Hill well, via fingerprint testing, confirming JP5 in the drinking water. [Encls (42), (210), (285), (286)]

336. CNRH responded to the 4 December formal Request for Records from DOH with sampling plans, sampling procedures, laboratory data, and initial sampling results. [Encl (287)]

337. On 7 December SECNAV issued an order to suspend Red Hill operations. [Encl (67)]

338. Shortly after CNRH secured the Red Hill well, the Office of the Judge Advocate General's Admiralty and Claims Division (Code 15) was in contact with PACFLT / CNRH to determine the potential impact of the this event. In the first week of December, Code 15 activated OJAG's disaster response plan and immediately began working with on-scene JAG personnel to provide support to the response effort, including the training of personnel assigned to support the Emergency Family Assistance Center (EFAC). A process was established for the intake and adjudication of personal property claims for damages from impacted military residents that was separate from the TLA reimbursement program. This process included the publication of a customized claims packet and a designated help desk in Norfolk with tailored hours to correspond with Hawaii Standard Time. In mid-December, Code 15 deployed an on-scene team to Hawaii to refine the process and provide additional on-site training to those acting as liaisons

who would direct property damage claims inquiries to Code 15. Code 15 deployed a second time in January to re-iterate training to rotating JAG personnel as they arrived in Hawaii and to continue to refine the process in light of the evolving situation. To meet the Navy's commitment to provide support for all of those impacted, Code 15 also worked with CNIC to obtain Emergency and Extraordinary Expense (EEE) authorization to fund, among others items, payment of property damage claims from businesses and non-military claimants. The claims process for impacted residents and businesses continues through present day and will remain in place for the foreseeable future. [Encls (288), (289)]

Action by Fleet Logistics Center, Pearl Harbor to Communicate Manning Concerns

In light of the Cavanaugh Report opinion that the FLC PH "Fuels Department is undermanned at every level," this section explores the actions taken by FLC PH to communicate concerns about their Fuels Department manning, including what decisions were made in response and at what level of the chain of command. Because the vast majority of the FLC PH Fuels Department personnel are civilian, the findings of fact below primarily center on civilian manning. As such, the term "Full Time Equivalent (FTE)" is used to describe the number of full time (40hrs/wk) civilians a given civilian personnel budget is expected to support. The term "position" is used to describe the collective duties and responsibilities which require the services of a single civilian employee. A given civilian personnel budget provides the financial resources for the total pay and entitlements, including overtime pay, for all civilian employees filling positions within an organization. Finally, for simplicity, the term "billet" is used here only to refer to a post assigned to a uniformed military person and the term "manning" is used regardless of whether manning or manpower is being addressed, unless "manpower" is required in a formal title or name.

339. Today, the FLC PH Fuels Department is comprised of 89 civilian FTE and 3 military billets, with 94 civilians and 3 Navy Officers actually on board. DLA-E funds 88 FTE and NAVSUP funds the remaining 1 FTE. Including the Fuels Department, FLC PH is comprised of 354 civilian FTE and 39 military billets. As a point that was unable to be reconciled during the investigation, NAVSUP comptroller reports that there are 84 civilian FTE supporting Fuels Department with DLA-E funding 80.5 FTE and NAVSUP funding the remaining 3.5 FTE. [Encls (290-294)]

Background

Prior to 2014, the Fuels Department bulk fuel operations did not include operations at Hickam Air Force Base (AFB). As such, it is important to note that prior to that year the Fuels Department FTE was about half the size that it is today because the mission scope was smaller.

340. Navy is the only service that has fuel operations FTE funded by DLA-E. All other services provide manning from within their own service budgets. [Encls (92), (374)]

341. All Fuels Department manning discussions identified in the last 25 years have involved civilian FTE. FLC PH has not requested any additional military billets for Fuels Department. [Encls (41), (293)-(298)]

342. Responsibility for Shore Manpower Requirements Determinations (SMRD) was decentralized and shifted to the BSOs on 14 October 1986. Responsibility for SMRD was recentralized to the Navy Manpower Analysis Center (NAVMAC) on 18 July 2021. Also, DLA does not provide manning guidance to the Navy for operation of DFSPs. [Encls (299), (301)-(303), (305)]

343. NAVSUP is BSO 23. [Encl (304)]

344. In Oct 1997, an Office of Management and Budget A-76 study was commissioned to assess the Fuels Department, which then consisted of 48 personnel on board. Although no longer permitted, A-76 studies were conducted to determine the most cost effective and efficient means of performing a given function in order to justify a government versus private contractor based operation. In Oct 2000, after 3 years, the A-76 study concluded that a Most Efficient Organization level of manning for the Fuels Department was 39.5 FTE. No evidence exists to document any action taken by FLC PH, NAVSUP, or DLA-E in response to the findings of the A-76 study. [Encls (307), (309)]

345. In Aug 2008, NAVSUP sponsored a Business Process Reengineering (BPR) Fuels Facilities study led by the consulting firm, Grant Thornton LLP. The Pearl Harbor Fuels Department was included in this study which concluded that they should be resourced at 47 FTE. Because DLA-E was already funding 47 FTE for Fuels Department, no action was taken based on the BPR. [Encls (295), (310), (313)]

346. In 2014, Pearl Harbor and Hickam AFB Fuels Operations merged to form JBPHH DFSP. Prior to the merger, the Navy funded 44 FTE for USAF fuels operations at Hickam AFB for various reasons and DLA-E funded 47 FTE for the Pearl Harbor Fuels Department. As a result of the merger, DLA-E agreed to fund 41 of the 44 Hickam AFB FTE, bringing the total for the JBPHH DFSP Fuels Department to 88 FTE funded by DLA-Energy. [Encls (92), (294), (295), (311), (312)]

347. In Oct 2017, due to increasing environmental compliance requirements pursuant to the Red Hill Administrative Order on Consent (AOC), FLC PH requested an increase of one FTE to support the addition of an environmental professional in FY18. This request was denied by DLA-E because they assessed that environmental monitoring and response actions are Service responsibilities. FLC PH did not elevate any concerns with this denial to NAVSUP or request assistance in adjudicating with DLA or in having NAVSUP fund the position. [Encls (92), (309), (313)]

2019 to May spill

348. In Sep 2019, the FLCPH Executive Director (ED) created 26 additional civilian positions within Fuels Department. There was no corresponding request to increase the budgeted FTE from the approved 89 FTE (Note: one NAVSUP funded FTE had been added since 2014). Additionally, there is no evidence of a work-based analytic basis for the increase, it was a budget driven decision. Because, on average, about 15% of the Fuels Department positions are unfilled at any given time due to retirements, departures and the time required for the government hiring process, the ED believed that the budget associated with the 89 approved FTE could support 26 additional positions. The ED thus leveraged savings within the civilian budget based on unfilled positions to add positions so that the Fuels Department could hire additional civilians with the understanding that at any given time 15% of all positions would be unfilled. These additional positions, when filled, are known as “overhires.” Hence, the total number of positions exceeded the authorized FTE. The ED created and filled the environmental position previously denied by DLA-E using an “overhire.” [Encls (41), (290), (295-296)]

349. In Aug 2020, the FLC PH Business Director was hired and in Nov 2020, he reported to the NAVSUP Financial Management/Comptroller and the FLC PH ED the potential for a civilian manning budget over-execution due to Fuels Department excessive overtime. Fuels Department ultimately exceeded their planned overtime by 103% in 2020. [Encls (41), (299-300), (309), (314)]

350. In Jan 2021, DLA-E asked FLC PH and the Naval Petroleum Office (NPO) to explain the fact that FLC PH reported expenditures for 93 DLA-E funded FTE, vice their authorized 88 FTE, in their November 2020 Monthly Status Report. At this time, Fuels Department had 103 civilians on board. Although there is no evidence that any manning analysis was conducted, FLCPH reported as part of their answer that they “...could not operate safely and effectively with 88 FTE’s.” NPO directed FLC PH to reference the NAVSUP Financial Management/Comptroller Office guidance that any expenditures above 88 DLA-E funded FTE, are to be charged to the NAVSUP FTE budget and not the DLA-E FTE budget. There is no evidence of any other related communications between NAVSUP and FLC PH regarding any concern associated with safe and effective operations due to manning. [Encls (92), (309), (315), (316)]

May Spill to November Spill

351. In May 2021, FLC PH Business Director conducted a mid-year budget review with NAVSUP Financial Management/Comptroller (SUP01), and requested additional Fuels Department FTE as part of the POM process. SUP01 stated that new/additional requests for manning would not be accepted during the POM process. [Encls (299), (314), (317)]

352. In Sep 2021, FLC PH Business Director raised concerns about the hiring process and their overtime overrun of 89% in 2021 to the FLC PH CO and FLC PH XO in preparation of the FY22 QTR 1 Financial Execution and Concerns Meeting hosted by SUP01. SUP01 subsequently cancelled the meeting. [Encls (41), (299), (300), (314)]

353. There is no evidence of any additional Fuels Department manning requests, or actions by FLC PH, NAVSUP, or DLA-E during this period. [Encls (41), (92), (293-295), (313)]

November Spill to Current

354. After 20 Nov 2021, the FLC PH Executive Director determined more personnel were needed to effectively operate due to emergency response requirements. On 22 Nov 2021, Fuels Department had 99 civilian personnel on board. FLC PH leadership initiated a request for a Shore Manpower Requirements Determination (SMRD) thru NAVMAC. [Encls (295), (318), (319)]

355. In Jan 2022, FLC PH Deputy Fuels Director reported difficulty completing Preventative Maintenance (PM) actions with current manning to FLC PH Executive Director. Approximately 300 PMs were done monthly in 2020/2021, and there had been a 300% increase in required PMs. [Encls (295), (314)]

356. In Jan 2022, based on FLC PH CO and FLC PH Executive Director identifying that a significant portion of FLC PH leadership time was spent responding to RFIs, a \$2.5M contract was awarded to Pond & Co for Technical Writers to assist in that work. [Encl (313)]

357. In Jan 2022, NAVSUP directed a data call to all FLCs asking for a listing of authorized manning, overhires and additional requirements related to fuel operations. In response, FLC PH provided a manning document indicating need for increase of 35 Fuels Department civilian personnel. [Encls (92), (320)-(323)]

358. In Feb 2022, the FLC PH CO delivered a revised proposal and analysis to NAVSUP to support an increase of (17) Navy funded FTE and (36) DLA-E funded FTE as an update to the Jan 2022 request for additional civilian personnel. [Encls (308), (324-326)]

359. On 4 Mar 2022, NAVMAC received the request for FLC PH SMRD from the NAVSUP Total Force Division Director. [Encl (327)]

360. Due to the SECDEF directed closure of Red Hill, NAVSUP reprioritized the Fuels Department SMRD and postponed the requested date for the SMRD to 2nd QTR FY2024. [Encl (296)]

361. In Mar 22, the FLC PH Deputy Fuels Director stated that the current FTE for Fuels Department is not ideal due to the impending closure of Red Hill because he believes it will

require an increase in manning due to the increased requirements for fuel transfers via barges, above ground fuel tanks and piers for overall Fuels Department operations. He believes that the SMRD should address this issue, but he has not been involved in the request. [Encl (41)]

AFFF System: Design, Install, Induction, Maintenance

As established in the Cavanaugh Report and updated herein, the AFFF fire suppression system retention line held up to 19,377 gallons of JP-5 fuel from the time of the May spill until the November spill, when a watch stander inadvertently struck a low point drain with the passenger cart of a train, cracking the pipe and spilling the fuel. The below findings of fact focus on the design, installation, induction, and maintenance associated with the AFFF retention line, sump pumps, tank and associated equipment (collectively referred to here as the AFFF waste system).



Cracked Low Point Drain

Train Passenger Cart

362. The requirement to upgrade Red Hill life safety systems to comply with DoD life safety standards was specified by DLA for the FY-15 National Defense Authorization Act. This upgrade was intended to provide various capabilities, to include: water fire sprinkler system in the upper access tunnel; automatic aqueous film forming foam (AFFF) & water fire suppression system in the lower tunnel; 350,000 gallon storage tank, two fire pumps, fire pump building, hydrants, and water supply lines; collection pits with sump pumps and an exterior 530,000 gallon retention tank for disposal of AFFF; repair for existing and additional oil tight doors along the tunnel; and several other safety related items. [Encl (328)]

363. Prior to upgrading Red Hill life safety systems, there was not an AFFF sprinkler or drain system in the tunnel. [Encl (329)]

364. The AFFF retention line is designed to transport an AFFF foam/fuel solution following AFFF system activation for fire suppression from the area of the lower access tunnel under the bulk fuel storage tanks to the AFFF retention tank outside adit 3. Although not designed to be a dedicated fuel transportation system, the AFFF retention line was also designed to be an emergent fuel transmission line in the event of a catastrophic leak. [Encls (330)-(332)]

365. The AFFF retention line is a 14" pipe connecting five sumps, each with four pumps, in the floor of the Red Hill lower access tunnel (directly below the bulk fuel storage tanks) to an AFFF retention tank outside of Adit 3. The pipe is constructed of a combination of PVC and steel and runs approximately 0.9 miles end-to-end. It slopes down from an elevation of (b)(3)(A) sea level in the area under the bulk fuel storage tanks to a minimum elevation of (b)(3)(A) sea level approximately (b)(3)(A) and rises from there to the retention tank inlet at an elevation of 147 feet above sea level. These elevation changes create a low area in the AFFF retention line capable of holding 30k to 40k gallons of fluid. The original design required manual draining of this low area to vacuum trucks or portable containers via manual low point valves installed in the AFFF retention line following any activation of the AFFF waste system. [Encls (333)-(335)]

366. AFFF that contain per- and polyfluoroalkyl substances (PFAS) are typically used to extinguish highly flammable or combustible liquid Class B fires, such as fires involving gas tankers and oil refineries. Releases of AFFF should be minimized because PFAS are persistent in the environment, have been found to accumulate in the human body, and exposure to some PFAS compounds may lead to adverse health outcomes in humans. [Encl (371)]

367. PFAS are a group of man-made chemicals that includes perfluorooctanoic acid (PFOA), perfluorooctanesulfonic acid (PFOS) and many other chemicals. The Military Specification for AFFF was revised in 2017 to require significantly reduced PFOS and PFOA. Due to the age of the Red Hill AFFF system, it has only ever contained this new formulation. [Encls (46), (371), (372)]

368. The material specification for constructing AFFF foam solution piping is established by DoD Unified Facilities Code (UFC) 3-600-01, Fire Protection Engineering for Facilities, section 9-9.2.1, which mandates "schedule 40 steel pipe" for such piping. Foam concentrate piping is also required to be steel by this UFC, but is discussed separately in section 9-9.2.2. The requirement for the overall capabilities of the systems providing fire protection for underground vertical storage tanks in POL (fuel) facilities is established by UFC 3-460-01, section 2-14.3. However, it is UFC 3-600-01 that delineates material specifications for the construction of fire protection systems and is used as the primary reference for material requirements by the designer of record in the basis of design. [Encls (330), (336), (337)]

369. The AFFF retention line was required by the government construction agent, NAVFAC PAC, and the designer of record to be constructed entirely of steel in the design specifications when the construction contract for this system was first awarded in 2015. [Encls (338)-(340)]

370. The government construction agent having contract oversight for the construction of the AFFF system was NAVFAC PAC - Contract title FY 15 P-1551 Upgrade Fire Suppression and Ventilation Systems, Red Hill Fuel Storage Facility (Contract number: N62742-11-D-0005). [Encls (332), (335), (342)]

371. On 26 Mar 13, the design contract for P-1551 was awarded to Insynergy Engineering, Inc (the designer of record). [Encl (342)]

372. On 25 Aug 15, the construction contract for P-1551 was awarded to Hensel Phelps, a general contractor and construction company (the construction contractor). [Encls (343), (344)]

373. On 5 Oct 15, site mobilization began and construction commenced in Jan 2016. [Encls (343), (344)]

374. On 28 Oct 15, just prior to starting construction, the construction contractor submitted RFI 0006 to NAVFAC PAC asking for clarification because their interpretation of the drawings and specifications provided by NAVFAC PAC indicated to them that the AFFF retention line, along with other lines in the AFFF system, was to be constructed of PVC. [Encl (345)]

375. On 15 Dec 15, a contract hire construction manager working on behalf of NAVFAC PAC responded to RFI 0006 by saying that the construction contractor should "proceed as per the proposal and identify in material submittals. No contract change required." There is no written record that he conferred with the responsible Design Manager or any other NAVFAC PAC government employee prior to this reply. [Encls (343), (345), (346), (348)]

376. On 24 Mar 16, the construction contractor provided a material submittal to NAVFAC PAC to document the purchase of general purpose plumbing materials. Although not indicated as such in this report, the materials listed included the PVC piping used to construct the AFFF retention line. [Encl (349)]

377. On 27 Jun 16, the construction contractor began installation of the AFFF retention line using PVC piping. [Encl (344)]

378. On 28 Jul 16, the low point drain plan was revised to provide equipment to drain the AFFF retention line low area into the ground water sump in the floor of the tunnel near the Adit 3 entrance. This plan would have replaced the groundwater sump pump with a new pump connected to the existing 6" ground water discharge pipe to transport AFFF retention line drainage out to a new manual hose connection at the Adit 3 entrance. The remainder of the

existing 6" groundwater piping was to be capped and retired in place since it runs underground to a buried cement tank. [Encl (333)]


379. On 24 Aug 16, the construction contractor submitted RFI 0119 to NAVFAC PAC to ask if a secondary containment "jacket" was required on the underground portion of the PVC AFFF retention line. Within the narrative of the question, the contractor stated "Hensel Phelps is utilizing Yelomine [PVC] Pipe for the AFFF retention line." [Encl (350)]

380. On 30 Aug 16, NAVFAC PAC responded to RFI 0119 stating that a secondary containment "jacket" should be provided. Correspondence between the designer of record (DOR) and the NAVFAC PAC construction manager regarding RFI 0119 indicates that both were aware that the contractor was using PVC to construct the AFFF retention line. There is no indication that either took any action regarding the use of PVC piping. [Encls (350), (351)]

381. On 6 Jan 17, the construction contractor completed installation of the AFFF retention line. [Encl (344)]

382. On 12 Mar 17, following an owner/contractor meeting between NAVFAC PAC and Hensel Phelps, the construction contractor verbally confirmed their use of PVC piping for the construction of the AFFF retention line. [Encl (352)]


383. On 13 Mar 17, the construction contractor formally notified NAVFAC PAC, in writing, that they constructed the entire AFFF retention line with PVC vice Steel pipe. [Encl (353)]

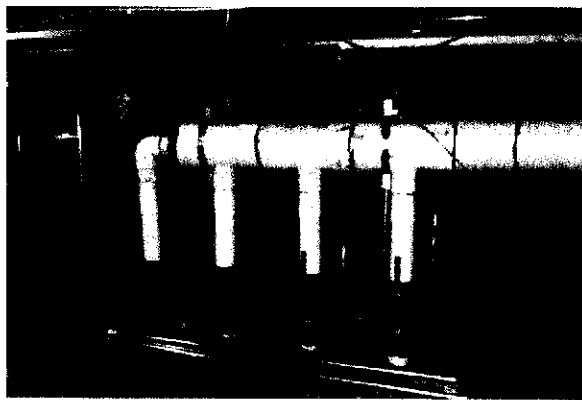

Original AFFF Retention Line Piping in Immediate Area of an AFFF Sump

384. On 13 Apr 17, the contractor proposed a revised AFFF retention line low area drain plan which is a self-contained unit with new tank and sump pump to move AFFF retention line

drainage out to a new manual hose connection at the Adit 3 entrance via new 3" PVC piping. This system does not utilize the groundwater sump system. This is the installed configuration today and is in close proximity to the Adit 3 groundwater sump, but does not connect with that sump. This system was not used to drain the AFFF retention line following the November spill. [Encl (354)]

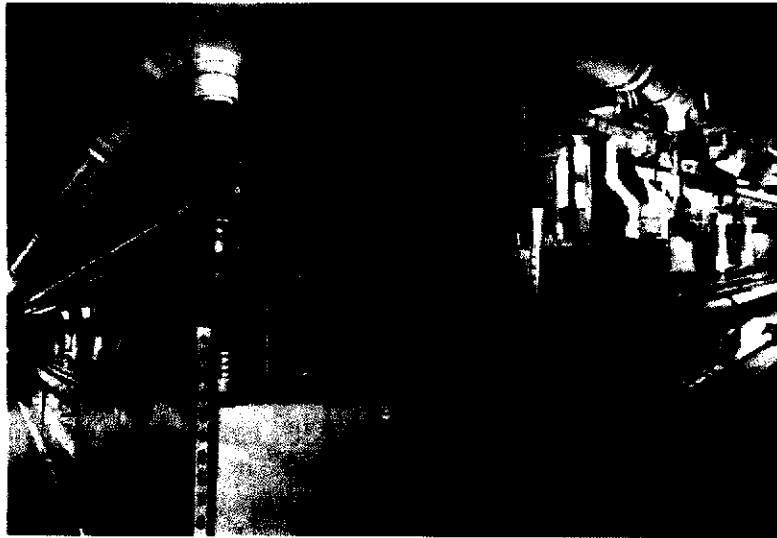

Final Installed Low Point Drain System with PVC Retention Line

385. On 26 May 17, CO NAVFAC HI notified Commander, Navy Region Hawaii, NAVSUP Global Logistics Support, and Commander, NAVFAC PAC that the AFFF retention line was constructed of PVC vice steel. [Encl (355)]

386. On 30 May 17, NAVSUP Global Logistics Support notified DLA Installation Support that the AFFF retention line was constructed of PVC vice steel. [Encl (355)]

387. On 17 Jul 17, a NAVFAC Red Zone meeting to discuss AFFF system completion and turnover was attended by representatives of the construction contractor, NAVFAC PAC, NAVSUP, FLC PH, and the designer of record. This is the only record of Red Zone activity for the AFFF system retained in the construction file. Retention of Red Zone records, to include a completed checklist/POA&M, is required by B-1.6.11 NAVFAC Business Process Management System's Red Zone Process. [Encls (368)-(370)]

388. On 22 Sep 17, an investigation was completed by NAVFAC HI to document the detailed actions of the construction contractor and the government that led to the AFFF retention line being installed using PVC vice steel pipe. This report notes the following key points: 1) The AFFF retention line is a large exposed discharge line in an area considered to be an industrial

space, where large equipment and materials are transported. Pipes and structures in this type of environment are susceptible to inadvertently being struck by a heavy object. In the event of impact, steel is far sturdier than PVC. 2) PVC is not acceptable for fuel because the gaskets used will break down when in contact with fuel. 3) PVC also presents an increased static electricity risk, and thus potential for explosion during fuel transportation. [Encls (330), (331)]

389. On 12 Oct 17, after identifying the deviation from the specification requirement to use steel for the retention line, the NAVSUP Navy Petroleum Office (NPO), in conjunction with NAVFAC PAC, DLA Installation Operations and the designer of record, proposed to replace the PVC pipe in the immediate area of the sumps with carbon steel pipe, while retaining the majority of PVC AFFF retention pipeline installed. Several additional modifications unrelated to piping material were also included in the proposal. Retaining the majority of the pipe as PVC was proposed primarily due to the excessive cost to replace the pipe with steel. Additionally, it was noted by DLA that the installed pumps were not designed to pump fuel. [Encls (332), (341)]

390. On 19 Oct 17, The NAVFAC PAC Fire Protection Engineer concurred with the NPO proposal. He notes that the modifications are accepted with the understanding that the retention line is primarily for the transport of foam-water and oil mixtures, its functionality may be limited to one-time use in the event that it is needed to pump 100% fuel in the event of a catastrophic fuel leak or if it is damaged by a large scale fire and that the liquid velocities in the pipeline up to the tank do not produce risk of static electricity build up. [Encl (341)]

391. On 21 Dec 17, commissioning testing was completed for the AFFF distribution system. [Encl (347)]

392. On 13 Jan 18, commissioning testing was completed on the AFFF waste system. All AFFF sump pumps were run satisfactorily by manipulating the float switches, but no water was pumped. [Encl (356)]

393. On 16 Jan 18, DLA Installation Operations proposed to maintain PVC pipe in the immediate area of the sump pumps, but continue to move forward with the non-material related modifications due to cost concerns. This was also based on the assumption that a fire would melt the wires powering the pumps before it would melt the PVC piping. [Encl (357)]

394. On 25 Jan 18, NAVSUP Energy and FLC PH concurred with DLA's updated proposal, contingent on the approval of the NAVFAC PAC Fire Protection Engineer. [Encl (341)]

395. On 31 Jan 18, the AFFF system, with the exception of the AFFF waste system, was accepted by NAVFAC PAC from the general contractor. This is the Beneficial Occupancy Date (BOD) for all AFFF components except the AFFF waste system. The initial maintenance contract for the AFFF system, with the exception of the AFFF waste system, took effect 5 months later on 1 Jul 18, and was later amended in July 2022 to cover the entire system. No NAVFAC Red Zone checklists are retained to describe system turnover. [Encls (358), (369)]

396. On 1 Feb 18, the NAVFAC PAC Fire Protection Engineer discussed identified fire protection deficiencies within the new proposal not to replace PVC piping in the immediate area of the AFFF pumps with steel. [Encl (359)]

397. On 8 Feb 18, DLA counter-proposed changing the piping in the immediate area of the sump pumps to steel and adding fast acting sprinklers to protect the wiring for the pumps. [Encl (360)]

398. On 12 Feb 18, NAVFAC PAC Fire Protection Engineer concurred with the DLA counter-proposal and accepted the final plan to change retention line piping to steel in the immediate area of the sump pumps, while retaining PVC in all other areas. [Encl (360)]

399. On 15 Feb 18, Initial AFFF system O&M manuals were hand delivered to FLC PH by NAVFAC PAC. More comprehensive and integrated O&M manuals were requested by FLC PH. [Encl (361)]

400. On 22 June 18, design work was completed for the AFFF retention line modification previously approved on 12 Feb 18 by NAVFAC PAC. This modification was known as 'Change R'. [Encl (362)]


401. On 26 June 18, a request for proposal to install the Change R design was sent to Hensel Phelps. [Encl (362)]

402. On 2 Aug 18, the construction contractor provided a proposal to execute Change R to NAVFAC PAC. [Encl (362)]

403. In Jan 19, physical construction began on Change R after the construction contractor mobilized for the new work. [Encl (362)]

404. On 18 Jun 19, NAVFAC PAC processed a service request (SR) to initiate maintenance on the AFFF waste system which was soon to be completed. The SR was reported by a NAVFAC PAC facilities operations specialist with a FLCPH facilities engineer listed as the customer representative. [Encl (363)]

405. On 19 Jun 19, Change R was completed by the construction contractor. This is the configuration today. Commissioning testing was not performed again on the AFFF waste system. However, servicing was performed on the sump pumps (grease, rotation, cleaning) during connection of the new steel piping in the immediate area of the pumps. It was noted at the time that some of the pumps were seized due to lack of preventative maintenance, but were operational at the completion of servicing. [Encls (332), (362), (364)]

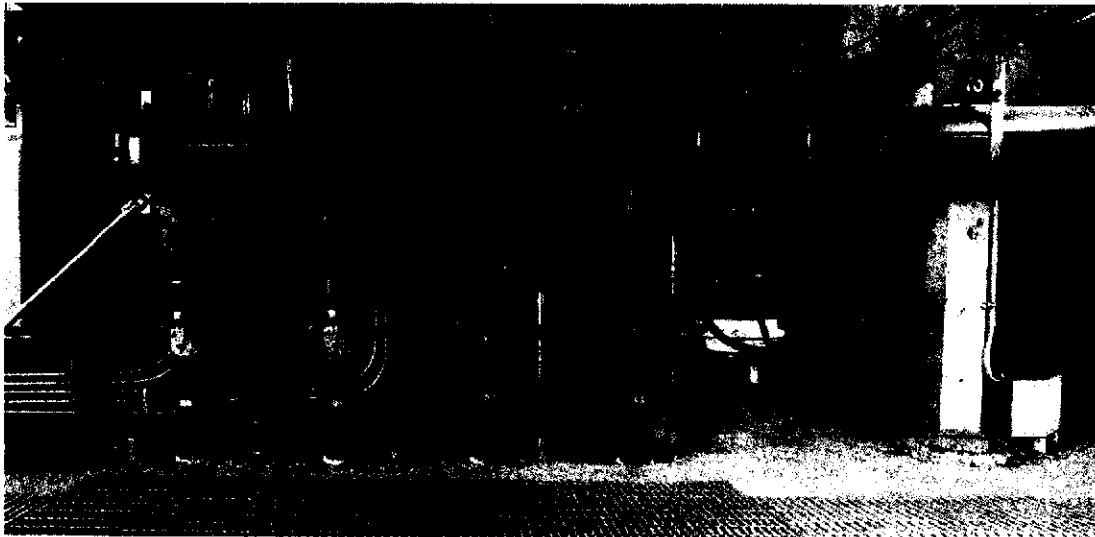

Final Change R Piping in Immediate Area of an AFFF Sump

406. On 2 July 19, the AFFF waste system was accepted by NAVFAC PAC from the general contractor. This is the BOD for the fully completed system. No NAVFAC Red Zone checklists are retained to describe system turnover. [Encls (358), (369)]

407. On 29 Aug 19, final Operations and Maintenance manuals were provided by NAVFAC PAC to FLC PH via DOD SAFE. [Encl (365)]

408. On 15 Apr 20, the AFFF system was inducted into the Navy's real property system when NAVFAC PAC submitted the Transfer and Acceptance of DoD Real Property form DD 1354 to Commander, JBPHH. Total project cost was reported as \$57,958,837.63. [Encl (366)]

409. As recently as April 2021, personnel within FLC PH were still advocating for a maintenance contract to be placed on the AFFF waste system and expressed frustration with delays, which they attributed towards systemic failure associated with maintenance support for Red Hill fire suppression safety. [Encl (390)]

410. On 15 Jul 21, the AFFF waste system was added to the existing Red Hill fire suppression system maintenance contract, more than 2 years after the Service Request was entered to request the maintenance. The contract is held by *Kinetix* and this is the first maintenance contract for the AFFF waste system. Following this action, *Kinetix* commenced monthly inspections of the entire system, which included a visual inspection of the AFFF retention line. There were monthly inspections in July, August, September, October, and November prior to the 20 November incident with no deficiencies noted. [Encls (51), (358), (384), (385)]

411. On 23 Dec 21, the first maintenance operating checks were performed on the AFFF sump pumps. This was the inaugural semi-annual maintenance for the AFFF waste system. All four zone 1 AFFF sump pumps failed the checks for various reasons. Three of the four were able to run in manual mode, but the “run” light for one of the three operational pumps failed to light. There is no record of any other operating checks on this system by *Kinetix*, or any other contractor overseen by NAVFAC, prior to this date. NAVFAC PAC is waiting for FLCPH to tell them what maintenance actions they desire to be done to correct identified deficiencies. [Encl (367)]

412. On 21 Jan 22, *Kinetix* reported results of follow-up testing of the AFFF sump pumps to NAVFAC HI. These tests checked to see if the installed float switches automatically started the pumps as designed. Two of the four zone 1 AFFF sump pumps were successfully activated, however they were not activated by the correct/expected float switch. [Encl (391)]

413. On 17 Mar 22, the final AFFF system property record cards are updated within the Navy’s real property record system, internet Naval Facilities Assets Data Store (iNFADS). [Encl (366), (407)]

414. On 17 Mar 22, during a walkthrough of Red Hill, the supplement investigation team noted visual evidence of a foreign substance on the outside of the PVC AFFF retention line piping joints that appears to have seeped out.



Installed PVC AFFF Retention Line with Joint Seepage

Command and Control

The findings of fact from the Cavanaugh Report detail the nexus of stakeholders with command, control, and oversight roles related to Red Hill. The report assesses that the C2 of Red Hill is complex but fairly well defined as follows: (1) FLC PH is responsible for day-to-day operations; (2) NAVFAC HI is responsible for maintenance and repair contracts; (3) CNRH is responsible

for environmental functions and incident response; and (4) DLA funds operations and maintenance.

Including the reconciliation noted in section II above, the supplement adopts the "Command Relationships and Responsibilities" findings of fact from the Cavanaugh Report (FoF 326 to 388). The below findings are added to provide additional specificity regarding the roles and responsibilities for DLA, NAVSUP, NAVFAC, and CNIC to illustrate the C2 as delineated by written policy and as practiced C2 in the field as it relates to the operations and maintenance Red Hill.

415. DLA is designated as the DoD EA for Bulk Petroleum and executes integrated material management responsibility for the Defense Working Capital Fund bulk petroleum supply chain by providing various functions to the point of sale which include procurement, transportation, storage, distribution, ownership, accountability, budgeting, infrastructure sustainment, restoration, and modernization. To execute these functions, DLA entered into various MOAs with the Navy that further delineate roles and responsibilities for the operations and maintenance of DFSPs, to include Red Hill. [Encls (91-92), (373)-(375)]

416. As part of an MOA between DLA and NAVSUP, NAVSUP FLCs are responsible for regional fuels engineering expertise for support and project oversight in managing the DWCF Fuel infrastructure, including submission of project deficiencies; coordinate with DLA and the "execution agents" for cradle-to-grave project development, execution and closeout; and ensure timing of Sustainment, Restoration and Modernization (SRM), Centrally Managed Program (CMP), recurring maintenance, deficiencies, Military Construction (MILCON), and demolition projects are coordinated to avoid workload conflicts or duplication. [Encls (33), (45), (91), (121), (157), (158), (159), (161), (174), (376), (380)]

417. As part of an MOA between DLA, NAVFAC, and NAVSUP for petroleum, oils and lubricants (POL) SRM of Navy capitalized facilities, NAVFAC is the primary "execution agent" for the Navy's POL SRM program funded by DLA. For non-CMP projects and maintenance, the Regional POL Engineer (RPE) (a NAVFAC HI employee embedded in FLC PH), based on input from FLC and operators, determines the best way to have work inducted, obtain scope, design, and contracts based on the need/requirement and capabilities at the installation. [Encls (159), (161), (174), (378)]

418. As part of an MOA between CNIC and NAVSUP for the management of Navy Bulk Fuel Facilities, Region Commanders must enter into and approve region agreements to execute the requirements of this MOA and installation Commanding Officers retain their Title 10 responsibilities for safety, security, environmental stewardship, and protection of personnel and property on the installation. These responsibilities extend to all fuel service and storage, including bulk fuel facilities, aboard the installation, remote areas and auxiliary activities under his or her command. NAVSUP acts as the "executive agent" for bulk fuel facility management

and fueling operations and has the ultimate authority and responsibility for ensuring “bulk fuel facility maintenance” is being performed. FLC is responsible for the bulk fuel facilities and must work with local NAVFAC leadership, typically the public works officer, concerning facility projects, maintenance, quality assurance inspections, contractor warranty issues, environmental support, and requirements affecting the installation. [Encl (377)]

419. NAVFAC and NAVSUP entered into an MOA for the facilities sustainment associated with DFSPs to establish the roles and responsibilities of the NAVFAC Regional Petroleum, Oil, and Lubricants (POL) Engineers (RPE) and the NAVSUP FLCs as they relate to the RPE function. The MOA establishes that the RPE shall be a NAVFAC forward-deployed asset located at the NAVSUP FLCs. [Encls (45), (121), (124), (157), (158), (165), (379)]

420. For fire protection systems ashore, as delineated in the applicable OPNAVINST, NAVFAC serves as the authority having jurisdiction for all matters related to these systems including maintenance, design, consultation, engineering surveys, and support. Other services include interpreting and enforcing design, construction, and maintenance criteria, as well as the United Facilities Criteria (UFC), and the uniform building codes. [Encls (45), (121), (124), (157), (159), (161), (165), (174), (375), (400)]

421. The AOC, entered into by the Navy, DLA, and EPA, was designed to protect the ground water, establishes requirements for the Navy to implement environmental analyses and infrastructure improvements that are designed to protect human health and the environment, to include the drinking water. Paragraph 4 of the findings of fact section within the AOC articulates command relationships with respect to Red Hill, but the Navy did not consent to that portion of the order. [Encl (3)]

422. While onboard a naval installation, Commanding Officers and all other personnel shall conform to the orders of the installation commanding officer related to common or specific services which he or she may provide, which may include field operations, security, fire protection, safety, defense, sanitation, recreation and welfare. For Red Hill, the installation Commanding Officers retains authority over all Title 10 responsibilities for safety, security, environmental stewardship, and protection of personnel and property on the installation and the responsibilities extend to all fuel service and storage, including bulk fuel facilities, aboard the installation, remote areas and auxiliary activities under his or her command. [Encls (42), (43), (45), (54), (55), (121), (124), (157), (158), (165), (175), (178), (377), (403)]

Maintenance Management and Ownership

423. DLA Energy, as a subordinate entity within DLA, manages the end-to-end global defense supply chain and is the interface with the Navy in their operation of Red Hill. As part of the DLA Energy organization, the Facilities Sustainment Directorate (FSD) handles portions of the day to day actions, to include the funding of maintenance for Red Hill. The FSD team funds a

Recurring Maintenance and Minor Repair (RMMR) program for Red Hill, managed by the Army Corps of Engineers, which provides systems and preventative type maintenance of fuel systems. For this type of maintenance, the FSD team assesses that FLC PH is responsible for identifying the deficiencies and maintenance needs but the RMMR program is set up so that a contractor comes out to execute the work without the need for a separate contracting action. [Encls (91), (92), (373)-(375)]

424. For maintenance responsibilities ashore, CNIC is mission funded to provide common base operating support (BOS) services, which normally requires each Navy installation to organize and maintain all Navy shore infrastructure in coordination with NAVFAC. To delineate these functions and support, OPNAVINST 11014.3 sets out the installation and tenant command responsibilities for maintenance by prescribing facility maintenance unit identification codes (MUIC), which are listed on every property record card. In the excepted cases where the installation is not the MUIC holder, the policy prescribes further guidance on establishing the responsible entity. The MUIC holders are responsible for determining and funding the appropriate level of preventive and corrective maintenance on facilities under their cognizance. In most cases, NAVFAC is the organization responsible for execution of preventive and corrective maintenance in support of the MUIC holder when appropriately funded for those services. [Encls (42), (45), (124), (125), (165), (401)]

425. The DFSP onboard Red Hill is part of JBPHH and falls under the cognizance of the installation Commanding Officer. The property record cards on file for the tanks, tunnels, rails, pipelines, utilities in the facility as well as land, roads and other above ground structures associated with Red Hill reflect various MUIC holders, but the primary entities are JBPHH (MUIC: N62813); and DLA (D33). Until March of 2022, the various property record cards for the AFFF system associated with the recent fuel leak specified either DLA or JBPHH as the MUIC holder, depending on the specific sub-system. In March of 2022, all property record cards associated with the AFFF system which previously listed JBPHH as MUIC holder were updated to list DLA as the MUIC holder. [Encls (42), (45), (124), (125), (165), (381), (401), (407)]

426. When asked who owns the program management for the sustainment and maintenance of the key fire protection components associated with the recent fuel leak, the JBPHH CO stated that his installation public works officer would support projects as requested by the tenant but that the JBPHH team was not responsible for the operations at Red Hill. The NAVFAC HI CO stated FLC PH has maintenance responsibility for all systems in the facility to include the fire protection systems but that there was an assumption by FLC PH that NAVFAC owned it. The NAVFAC HI CO stated that maintenance program management was not a NAVFAC HI responsibility because they had not been contracted by the MUIC holder. The FLC PH CO stated that CNIC is the real property owner and NAVFAC is the Navy's agent responsible for the maintenance. The FLC PH CO also highlighted that OPNAVINST 11320.23G specifies that fire protection systems ashore are an installation responsibility. [Encls (42), (43), (45), (121), (124) (157-159), (161), (165), (174)]

427. When asked who owns the program management for the sustainment and maintenance of the key fire protection components associated with the recent fuel leak, CNIC defers to DLA and NAVSUP to appropriately delegate and assign these responsibilities to NAVSUP based on the 22 December 2015 MOA between DLA and NAVSUP. But CNIC stated the MOA between CNIC and NAVSUP places the maintenance responsibilities for Red Hill with FLC PH. NAVFAC assesses NAVSUP owns the program management for the sustainment and maintenance, but acknowledged ambiguity exists because the property record cards improperly reflected the fire protection components MUIC holder responsibilities were shared between CNIC and DLA, which has been corrected as of 17 March 2022 (DLA is now reflected as having MUIC responsibilities). NAVFAC also stated the Operation and Maintenance Manuals (O&Ms), training material and as-built drawings were provided by NAVFAC HI to FLC PH upon completion of the system, which NAVFAC considers a further indicator that FLC PH is the operator and maintenance manager of the system. NAVSUP stated that CNIC and CNRH owns the real estate, NAVFAC is responsible for the maintenance, and when it comes to fire protection systems ashore, NAVFAC is responsible for the maintenance of the system. [Encl (383)]

428. For support systems maintenance onboard a military installation such as the AFFF system at Red Hill, DLA stated CNIC owns the infrastructure and NAVFAC is responsible for the programmatic oversight and execution for this category of maintenance. From the DLA Energy program management perspective for identifying maintenance needs on non-fuel systems, DLA is only responsible for funding and the Navy is responsible for managing and executing the maintenance. DLA assessed that they view JBPHH as a single installation that includes Red Hill and therefore NAVFAC is responsible for the entire installation within the public works function as the Navy's service executing agent. [Encls (42), (45), (121), (124), (125), (157-159), (161), (165), (174), (332), (374), (375), (381), (384), (385)]

429. There are three Commanding Officers with a nexus to Red Hill, but all three have different missions, functions, tasks, roles, and responsibilities for the facility: JBPHH CO, NAVFAC HI CO, FLC PH CO. When asked which Commanding Officer is the clear owner of Red Hill when it comes to program management for the sustainment and maintenance of the fire protection system, the Commander of Naval Installations Command acknowledged that there is little clarity as it relates to authority, responsibility and accountability for owning, identifying and managing maintenance requirements for the fire protection system at Red Hill. The NAVFAC Commander assessed that there are documented and clear roles and responsibilities within the governing MOAs and OPNAVINST 11014.3, "Facility Maintenance Unit Identification Code Holder Responsibilities," which define that NAVSUP has primary responsibility for owning, identifying, and managing maintenance requirements for the fire protection system at Red Hill. The NAVSUP Commander assessed that there are documented and clear roles and responsibilities within the governing OPNAVINST 11320.23G, "Navy Fire and Emergency Service Program," which defines that NAVFAC has primary responsibility for owning, identifying, and managing maintenance requirements for the fire protection system at Red Hill. COMNAVSUP acknowledged there are varying levels of understanding of the roles and

responsibilities in this space, with some lacking familiarity with the authorities and MOAs. COMNAVSUP also assessed there was never any effort by Navy to synchronize and harmonize all of the various authorities and MOAs to address the gaps and seams between mission partners. [Encls (383), (400)]

Environmental

430. CNIC, through Region Commanders and Installation Commanding Officers, is responsible for environmental readiness program management aboard Navy installations, with technical support from NAVFAC. JBPHH is the installation Commanding Officer responsible for installation environmental compliance for Red Hill. The Service component Regional Environmental Coordinator (REC) is responsible to coordinate environmental readiness issues for their respective Service, which includes communications with Federal, regional, State, and local agencies and officials on covered activities in the region. CNRH is the REC responsible for covered issues within Hawaii. [Encls (403), (405)]

431. When an oil or hazardous substance release occurs onboard a Navy installation, the designated NOSC-R for the Region is required to immediately take actions to ensure the installation or tenant command response is adequate for the scope of the release. [Encl (398)]

432. The CNRH Environmental Program Director assesses the NOSC needs to have a stronger role in reporting. The NOSC assessed that his GS level does not give him the necessary authority to carry out his emergency response and reporting responsibilities regarding Red Hill due to the sensitivity, high level interest and media attention. [Encl (31), (40), (46), (47)]

Emergency Management, Spill Response, and Training

433. All installations are required to maintain an installation emergency management (IEM) program to serve, in part, as a cross-functional program that integrates procedures and standards for all-hazards emergency preparedness, response, and recovery on Navy installations. The installation Commanding Officer is required to establish, maintain, and operate an Emergency Operations Center (EOC). The JBPHH CO stated that for Red Hill, there has never been an integrated response drill during his tenure and to his understanding, there is no requirement for him to serve as the Incident Commander for a spill. The JBPHH CO also highlighted that unlike most other installations, Fed Fire works directly for Region instead of the installation. To his knowledge, the JBPHH CO assessed that the installation would not be responsible for planning or executing a spill drill at Red Hill but would instead participate in a supporting role as directed by the NOSC. [Encls (42), (399)]

434. The Region Commander is required to designate a Regional Emergency Manager in writing and that individual maintains the regional emergency management program responsible for developing, coordinating, and executing the Navy IEM Program within the region's assigned geographical area, which includes training requirements. [Encl (399)]

435. For spill responses, all Navy facilities must maintain contingency plans to combat releases or discharges of oil and minimize hazards to human health and the environment. Additionally, they must develop Navy On-Scene Coordinator plans in combination with facility response plans to provide sufficient detail and ensure the Navy can respond to spills. These plans must cover notifications, responsibilities, initial actions, resources, and other areas and be accompanied with extensive drills and exercises with specified documentation and recordkeeping. [Encl (405)]

436. CNRH provides Incident Command System training to its Crisis Action Team members. Representatives from Legal, Public Affairs, Operations, Region Engineer, Information Systems, and Financial Services among other relevant divisions. Representatives from FLC, NAVFAC (including CNRH N4) and the CNRH PHEO have not received training. [Encls (386), (387)]

437. For spill response plans, JBPHH maintains an environmental pollution and contamination appendix in the installation EOC that was last updated in August 2010. For CNRH, there is a spill response plan but it was developed by a third party contractor and has not yet been signed out by CNRH. CNRH serves as "Navy on Scene Coordinator" (NOSC) for emergency response for reported or identified oil spills throughout the Navy Hawaii Region. [Encls (175), (388), 389)]

438. Separate from the spill response plans from CNRH and JBPHH, there is the JBPHH Emergency Response Plan (ERP) for the well inside Red Hill. The ERP is not referenced in any of the spill response plans for CNRH and JBPHH. However, the CNRH Red Hill Storage Facility Response Plan discusses the drinking water well and groundwater inside Red Hill, but only references the Groundwater Protection Plan and monitoring plan – it does not mention Community Water System Emergency Response Plan. [Encls (4), (12), (5), (392)]

439. RDML Kott stated that in the event of a fuel spill, the entity responsible for taking incident command depends on where the spill takes place, but for a fuel spill inside Red Hill, it is not clear which entity is responsible. [Encl (175)]

440. CO JBPHH stated there has never been an integrated response drill in his tenure for Red Hill and that there was no requirement for him to serve as the Incident Commander for a spill. He also highlighted that unlike most other installations, Fed Fire works directly for CNRH as opposed to the installation. He assessed he would not be responsible for planning or executing a spill drill but would participate in a supporting role as directed by the CNRH NOSC. [Encl (42)]

441. For an emergency response such as the May and November spills, CO JBPHH assessed the lead is CNRH and FLC PH with support from NAVFAC. CO JBPHH acknowledged this arrangement is not consistent with most other installations, but he understands Red Hill was different. [Encl (42)]

442. The NAVFAC HI CO assessed that JBPHH has no significant role in responding to an incident at Red Hill. He stated that CNRH is collocated with JBPHH, and because of the

visibility of Red Hill, CNRH has taken over any role the base would normally play. There is no reference or written authority that obviates JBPHH from the roles and responsibilities that an installation Commanding Officer owns to all tenants, to include Red Hill. [Encls (45), (124)]

443. The FED FIRE team was not trained on the Red Hill facility prior to either spill and did not have familiarity with the layout. They had to rely on the tenant for guidance during their response. FED FIRE was able to tour the Red Hill facility in February 2022 to increase their response capability. [Encl (168)]

444. Several key leaders, to include JBPHH CO, JBPHH Public Works Officer, and CNRH lacked awareness of the spill response plans associated with Red Hill. These same leaders shared an awareness to the lack of drills for a spill inside Red Hill but did not express any action had been taken to address this prior to the May or November spills. [Encls (42), (43), (175)]

445. In general, FLC employees do not participate in annual spill response training or drills. Only select supervisory staff were sent to Spill Prevention Control and Countermeasures inspection training so that they could disseminate the information. The FLC PH Environmental staff member did attend training and the worst-case spill scenario drill in the harbor in August 2021. [Encls (169), (393)]

446. JBPHH personnel interviewed assessed there is no specific spill instruction or spill plan for Red Hill that is maintained at the installation level and that Red Hill has been historically excluded from spill drills. However, the JBPHH IEPD stated CNRH Environmental previously conducted drills, tests, and large exercises involving the spill plan, but this had not occurred in quite some time. [Encls (43), (44), (46), (47), (209)]

447. The environmental staff at JBPHH includes a spill remediation team for spill cleanup, but the spill program management occurs at CNRH. [Encls (44), (46), (47)]

Responsibility for and Knowledge of Red Hill Well

448. CNIC has ownership of the well, but NAVFAC operates it. [Encls (43), (124), (125)]

449. The JBPHH CO has technical authority over securing the well. In addition, the Region N4, UEM Division Director, the UEM Water Commodity Manager, Deputy PWO, and PWO can secure the well if they determine there is a risk to the pumps, well, or water. [Encls (43), (124), (125)]

450. The proximity of the well to the spill location was not apparent to PACFLT leadership during their Red Hill tour on 23 November. [Encls (11), (171)]

451. The FLC CO was aware of the location of the pump station but not of the presence of the developmental tunnel that ran beneath the lower access tunnel. [Encls (121), (157), (158)]

452. NAVFAC PAC and Federal Fire were not aware of the proximity of the well in relation to the 20 November event until much later. [Encls (125), (168)]

453. The JBPHH CO and CNRH Chief of Staff were not aware of the proximity of the well in relation to the 20 November release prior to December. [Encls (42), (178)]

454. The Public Works Officer and Drinking Water Distribution System Operator were aware of the location of the well but were unaware of the significance of the fuel spill in the vicinity until 28 November. [Encls (43), (209)]

455. The PACFLT DCOM and Installation Environmental Program Director were not aware of the location of the well prior to the week of 29 November. [Encls (11), (44)]

456. The well and aquifer are listed in the CNRH Integrated Contingency Plan Appendix I as vulnerable to an uncontained fuel release within the lower access tunnel. [Encl (39)I]

457. The well is described at length in the CNRH Red Hill Fuel Storage Facility Response Plan, which clearly states that the groundwater flows from the Red Hill Facility toward the well. [Encl (12)]

458. In groundwater model simulations within the NAVFAC Groundwater Protection Plan (GWPP), an extended light non-aqueous-phase liquid (LNAPL) fuel plume of jet propellant (JP-5 or JP-8) within 1,099 feet of the well infiltration gallery resulted in benzene concentrations greater than the Federal maximum contaminant level (MCL) of 5 µg/L in the infiltration gallery. It was estimated that a release as small as 16,000 gallons of JP-5 near Tanks 1 or 2 could result in this condition. [Encl (4)]

459. The Groundwater Protection Plan acknowledges that a fuel release impacting the well may require construction of a water treatment facility to remove the contaminants at the wellhead. [Encl (4)]

460. The Groundwater Protection Plan states that it is required to be updated every five years. However, the initial plan was approved by DOH in 2008. The plan was updated in 2014 but not approved by the DOH. In a meeting with DOH and EPA on 1 Mar 2021, the Navy proposed updating the plan with an addendum to the 2008 version. [Encl (395)]

461. The JBPHH Risk and Resilience Assessment covers risks from natural hazards and malevolent acts but does not cover accidental releases. [Encl (6)]

462. The JBPHH Emergency Response Plan, Section 2.20.1 covers an appropriate response to a threat of or actual intentional introduction of contaminants into the potable water system. The steps listed were appropriate for the evening of 28 November. Of note, the ERP is not

referenced in the CNRH spill response plan or the JBPHH contamination and spill appendix from the EOC. [Encl (5)]

463. If there is contamination in the well, the JBPHH Emergency Response Plan [ERP] requires the installation to isolate the shaft, and issue "Do Not Drink" notifications until the contaminant has been identified. [Encl (5)]

464. Leaders were unaware of and unfamiliar with the JBPHH Emergency Response Plan. CNRH and the acting CNRH Environmental Director were not aware of the Emergency Response Plan. However, they completed many of the steps outlined in Section 2.20.1 after 28 November. [Encls (5), (46), (47), (55), (159), (175)]

465. NAVFAC HI CO confirmed that the Drinking Water Emergency Response Plan was not consulted on the night of the 28th. The NAVFAC HI Utility Management Branch Potable Water Commodity Manager was aware that the JBPHH Risk and Resilience Assessment and Emergency Response Plans had been recently updated but did not think to access the plan on 28 November. [Encls (124), (209)]

Public Affairs

466. The CNRH Public Affairs Officer implements all Region public affairs programs for the Region involving external and internal matters, community relations activities, and special projects, as well as coordinates media relations, community relations, and internal information programs. The CNRH PAO coordinates and manages all Navy public affairs matters within the Region, beyond immediate command responsibility, which may attract media interest or requires coordination with other PA professionals in the INDOPACOM AOR, and advises and assists all Commanding Officers and collateral duty PAOs of tenant commands. For spill incidents, CNRH PAO takes the lead as public affairs support. [Encls (34), (406)]

467. Following the May spill, CNRH PAO assumed lead for all public affairs matters associated with the incident. JBPHH PAO had minimal involvement with the May spill. As part of the support, CNRH PAO generated a briefing card to be used by Navy leaders that contained information about the incident and to assist in responding to queries from media or the public. The briefing card was coordinated with FLC PH Commanding Officer, JBPHH Commanding Officer, NAVFAC HI CO, CNRH Chief of Staff, and PACFLT PAO. [Encls (34), (35), (74), (217), (242), (243)]

468. Following the November spill, CNRH PAO generated a press release that was provided to the public on 21 November. The release was coordinated by FLC PH CO, NAVFAC HI CO, CNRH COS, CNRH Commander and chopped by PACFLT PAO. The PACFLT PAO did not provide any additional support between 21 November and 28 November. [Encls (34), (35)]

469. On 28 November, following growing complaints about water, CNRH generated a press release to inform the public the Navy was investigating reports by residents experiencing an odor in their water. This was the first press release on the matter. It was generated by CNRH and chopped by PACFLT PAO. [Encls (34), (35), (74), (217), (242), (243)]

470. Between 28 November and 7 December, CNRH remained lead on all public affairs support for Red Hill. By 8 December PACFLT assumed the lead role. [Encls (34), (35), (74), (217), (242), (243)]


Distribution of Responsibility

471. As it relates to the various responsibilities, functions, synchronization, and oversight associated with Red Hill, RDML Kott assessed that the role of Pacific Fleet (PACFLT) was unclear. Unlike a ship where C2 and responsibility for incident command resides with a Commanding Officer, RDML Kott assessed there is no single entity that is responsible for Red Hill. He stated that CNRH communicated with State agencies regarding Red Hill but would not inform the State of anything without first coordinating with PACFLT. RDML Kott understood that (b)(6) (PACFLT GA) was the PACFLT point of contact on all matters associated with Red Hill. PACFLT's stated intent was to coordinate and communicate on all matters associated with Red Hill to ensure messaging alignment across the Navy and not to usurp the authority or responsibility by other Navy organizations. [Encls (43), 175)]

Camera System

472. There is a closed-circuit television (CCTV) inside Red Hill that was installed sometime prior to the May 2021 spill. However, camera footage for the May spill and November spill in Red Hill is not available. Of the 57 CCTV cameras installed throughout Red Hill, 44 are inoperable and 13 cameras are operable. Of the 13 operable cameras, none of them covered the areas inside Red Hill where both spills occurred. [Encls (396), (397), (375)]

473. Approximately five months prior to the May spill, FLC PH identified the CCTV system was not fully operable. In January 2021, FLC PH routed a request to DLA Energy FSD to fund replacement of the CCTV system. Although the appropriate authority within DLA Energy FSD approved the request prior to the May spill, a miscommunication resulted in FLC PH being erroneously informed that the CCTV system would not be funded. FLC PH did not elevate that disapproval notification for resolution. In January 2022, DLA Energy resolved the communication breakdown and committed to fund a replacement for the CCTV system. [Encls (396), (397), (375)]

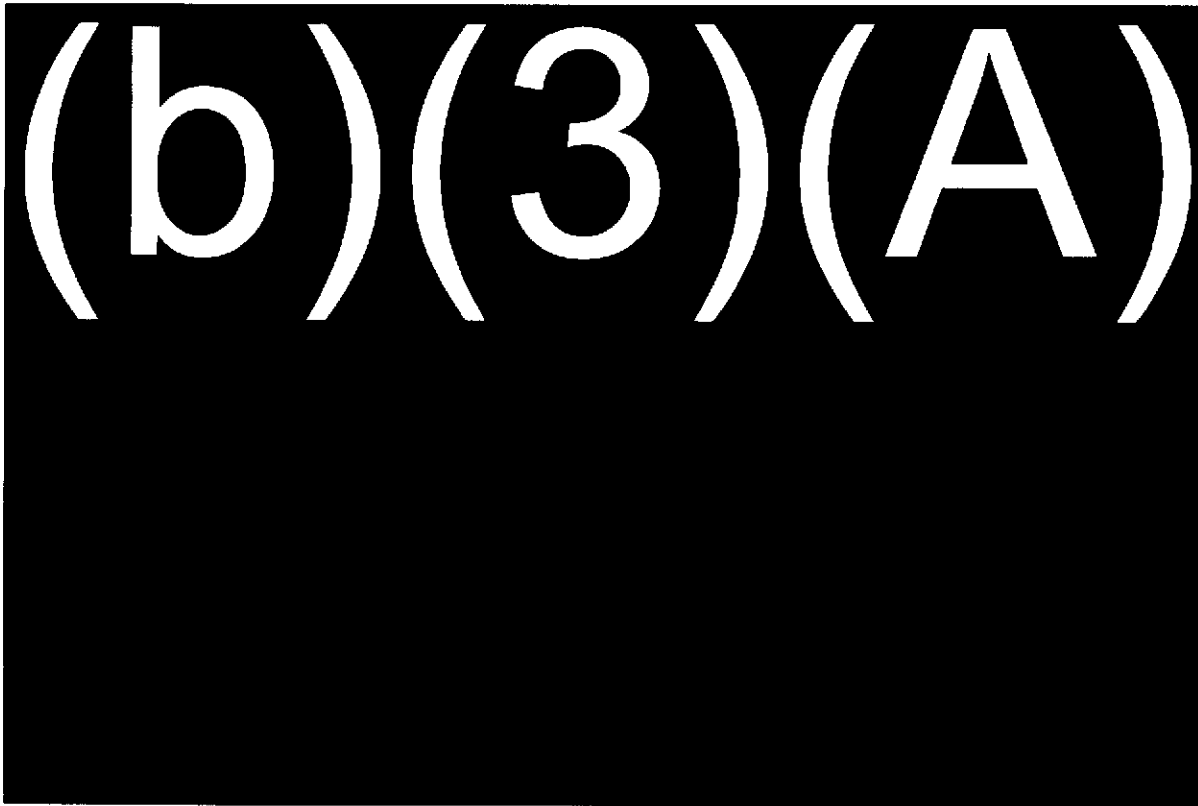

CCTV Camera next to lateral pipeline adjacent to Tank 20

IV. Opinions

The opinions contained in the supplement are, for the most part, separate and independent from the Cavanaugh Report. Most of the previous opinions are further supported by the findings of fact from this supplement, but with some exceptions noted herein. There are other opinions that, while still supportable, are further sharpened as a result of the findings and perspectives provided in the supplement. The below section, where it touches opinions from the Cavanaugh Report are appropriately qualified.

Comparison of the Immediate Response to the May and November Spills

There are three critical differences between the circumstances of the May and November spills that should be noted when comparing the responses to each: 1) the location (vicinity of tanks 18 and 20 in the lower access tunnel vs. tunnel in the vicinity of the Adit 3 Y near the Red Hill well); 2) the source (fuel pipe rupture during fuel movement [known to hold fuel] vs. PVC AFFF retention line rupture [thought to be empty]); 3) the duration (minutes vs. days).

1. The immediate responses to both spills were largely identical. In both cases, FLC PH watch standers quickly recognized the casualty, called for help, sought to shut the valve closest to the rupture, and evacuated the area; FEDFIRE responded, assessed the scene, and departed once they deemed the scene safe; the FLC PH Deputy Fuels Director managed actions at the scene and transitioned to recovery efforts as quickly as possible; incident command was not established; the NOSC-R did not arrive on scene to conduct an independent evaluation; neither the JBPHH Commanding Officer nor his Public Works Officer arrived on scene; the FLC PH and NAVFAC HI Commanding Officers contributed to a flawed and overly optimistic assessment that the fuel spill was contained; NAVFAC HI environmental spill response workers assisted in the cleanup with hoses and vacuum trucks; and the decision on how and what to report to DOH was compliant with required procedure, but did not rely on an independent assessment by those having environmental expertise, such as the NOSC-R. One notable difference was that notifications to State and Congressional stakeholders by Navy leaders was more organized and proactive in the November spill due to implementing a new CNRH notification instruction. Ultimately, both spill responses were equally and fundamentally flawed because they concluded with a significant amount of fuel unknowingly remaining outside of reported containment boundaries. [FF (11)-(64), (73)-(81), (102), (125), (140)-(213), (215), (430)-(456)]

2. There were no substantive differences in the immediate responses to the May and November spills because there was no learning or assessment with regard to response efforts following the May spill. Most troubling, there were no integrated spill response training or drill events conducted with installation and other support personnel between the May and November spills. Without such actions, there was no opportunity to understand the deficiencies, friction points, and challenges experienced by the combined team during the May spill. Therefore, key lessons were never learned and could not be compared to requirements and the plan in order to determine

how best to adjust and improve. In turn, this thwarted any opportunity for human performance improvement, assessment and feedback that would have allowed for the enhancement of team performance. An effective spill response training and drill program would likely have revealed gaps and seams in the C2 as practiced, flaws in the assumptions about who would respond, and how the team diverged from requirements and the plan, which in turn would most certainly have improved the response to the November spill and possibly identified the risk to the Red Hill well before the drinking water distribution system was contaminated. [FF (11)-(64), (73)-(81), (102), (125), (140)-(213), (215), (430)-(456)]

Command and Control

The C2, as practiced for Red Hill, was complex and not understood across the spectrum. The findings of fact detail the various authorities on this point, but Appendix B is a visual illustration of the C2 as practiced, which provides insight as to its complexity.

3. As stated in the Cavanaugh Report, human error in failing to properly respond to the November spill is the primary cause of the contaminated drinking water. However, C2 as practiced is a proximate cause of the contaminated drinking water. Multiple stakeholders are required to come together to ensure mission accomplishment at Red Hill. Unfortunately, this multi-faceted C2 construct broke down in crisis because there was no individual identified as singularly responsible and accountable for incident response when the November spill occurred. The pressure of crisis produced fault lines stemming from overly complex and unclear lines of responsibility and accountability expressed in multiple lengthy, obtuse, outdated, and sometimes contradictory MOAs. In fact, even after the fact, the Region Commander was not able to identify the entity responsible for taking incident command for a spill at Red Hill. These fault lines, generated by the C2 as practiced, resulted in a response to the November spill that was “managed by committee” and failed to accurately communicate and address the risk to the drinking water well and surrounding environment. [FF (1)-(10), (152)-(182), (202)-(203), (206)-(207), (212)-(213), (415)-(471)]

4. Contrary to that which was practiced, C2 as prescribed in Navy regulations and instructions unambiguously identifies the installation Commanding Officer as the individual who is singularly responsible for all facets of an installation – and Red Hill is no exception. In response to both spills, of the three cognizant Commanding Officers, only the installation Commanding Officer had authority over all aspects of Red Hill, including the well and the response efforts. Additionally, CNRH failed to either formally relieve the installation commander of his responsibilities with respect to Red Hill, in writing, or exercise his ISIC responsibility to ensure that the installation Commanding Officer executed his unique authority over all aspects of Red Hill during the crises. Further, the significant involvement in and communications about both spill responses by CNRH, NAVFAC HI, and FLC PH, combined with an absence of pressure from CNRH for the installation Commanding Officer to get involved, fed the idea that any responsibility or accountability for Red Hill by the installation Commanding Officer had been

abrogated. It is important to note that the idea that Red Hill is somehow different in this respect has permeated across multiple commands and was many years in the making. To be clear, the JBPHH Commanding Officer as well as CNRH inherited this misperception, they did not create it. Yet in spite of this long standing misperception, nothing relieved the installation Commanding Officer of his responsibility and accountability with respect to Red Hill. While there is no single Red Hill owner per se and the tenant Commanding Officers have authority and accountability unique to them, the JBPHH Commanding Officer was the single individual that held the authority and accountability to act comprehensively and decisively as the Incident Commander when the crises at Red Hill occurred. He did not exercise his unique authority, and that inaction contributed to contamination of the drinking water because the response was neither comprehensive nor effective. [FF (1)-(10), (26)-(30), (33), (35), (47), (53), (55)-(57), (66), (146), (150), (157)-(166), (172)-(175), (184), (415)-(471)]

5. Contributing to the above, the lines of responsibility for Red Hill between CNRH and JBPHH are not clear. Within the two organizations there is uncertainty as to who was responsible for some functions such as environmental oversight, emergency response, and communications. The NAVFAC HI relationship with both CNRH and JBPHH further exacerbates this problem through multiple dual hat relationships and the fact that all environmental program manager staff are NAVFAC HI Core employees at the Region level. The installation, therefore, only maintains field-level environmental staff and their supervision, who are also NAVFAC HI Core employees. This effectively reduces the sense of program responsibility and agency at the installation level. This has also resulted in the installation not having a tailored spill program of its own, as evidenced by the lack of a detailed spill instruction, program manager, or spill plan; forcing them to rely on guidance provided by the Region to address releases of all sizes. This further exacerbates the lack of engagement at the installation level and places an unusual level of responsibility on the Region for executing all aspects of a spill program. The fact that CNRH and JBPHH are headquartered in the same building and have nearly identical responsibility footprints (all except Pacific Missile Range Facility on Kauai) adds to the perception of overlap and contributed to the JBPHH CO assuming that his Red Hill responsibilities had been completely subsumed by higher headquarters. [FF (1)-(10), (26)-(30), (33), (35), (47), (53), (55)-(57), (66), (146), (150), (157)-(166), (172)-(175), (184), (415)-(471)]

6. There is no owner of maintenance program management for the Red Hill AFFF system. The instructions and references regarding responsibility for program management of support system maintenance in Red Hill are confusing and in some cases, contradictory. Further, the stated positions of the three key Echelon II Commanders (CNIC, NAVFAC, NAVSUP) regarding the AFFF system, in particular, are mutually exclusive and require formal resolution. That said, organizations subordinate to both NAVFAC and NAVSUP behaved in ways contrary to their stated positions at times, which further contributed to confusion regarding system ownership at the "deckplate." There is no record that NAVFAC PAC followed complete "NAVFAC Red Zone" procedures for AFFF system turnover which may have led FLC PH to believe that NAVFAC HI retained ownership. FLC PH received operations & maintenance manuals,

requested more detailed manuals, called the AFFF system maintenance contractor for assistance following the May and November spills, and contributed to decisions in regards to modifying the AFFF retention line during construction, which in the aggregate, likely provided NAVFAC HI the impression that FLC PH accepted that they were the owner/customer of the system. A further indicator of chronic friction is that FLC PH engaged with NAVFAC HI over a lengthy period of time, and as recently as April 2021, expressing concerns regarding the lack of maintenance contract for the new AFFF system. [FF (168), (182)-(184), (219), (362)-(414), (416)-(420), (422)-(429), (472)-(473)]

7. The lack of maintenance program management for support systems had direct and deleterious impacts on the AFFF waste system, as well as other support systems. Although the AFFF distribution system waited five months from acceptance until it was under a maintenance contract, the AFFF waste system sat unattended and unmaintained for more than two years following acceptance by NAVFAC PAC in July 2019. The first operational checks of system pumps in Dec 2021 and Jan 2022 revealed significant and previously unknown deficiencies. Additionally, the time lag in maintaining the system most certainly contributed to the low level of knowledge demonstrated by FLC PH and NAVFAC personnel who were not able to effectively recognize that the system had pumped fuel and that fuel remained in the system. Further, monthly maintenance inspections of the retention line which began in July 2021, were another missed opportunity to identify that fuel remained in the retention line, especially considering that there is visual evidence of a foreign substance on the outside of the PVC pipe that appears to have seeped out. The impact of the lack of clear support system ownership can also be seen in the missteps associated with replacing the CCTV system, which prevented the ability to visually review what happened to the fuel piping during the May spill. Such impacts are further revealed in the fact that it took until 9 December (19 days) for the combined team to discover that the groundwater sump flows to a concrete underground tank which spills over into a leach field. Finally, the fact that it took until 3 or 4 December (two weeks) to discover that the hume drain existed as an integral part of the groundwater sump is further evidence of the impact brought by lack of ownership and associated lack of knowledge regarding Red Hill support systems. [FF (168), (182)-(184), (219), (362)-(414), (416)-(420), (422)-(429), (472)-(473)]

8. The Administrative Order on Consent (AOC) expresses an intent, within a voluntary construct, for the Navy's expected actions to protect drinking water, natural resources, human health, and the environment. It does not prescribe Navy C2, but it can be seen as placing CNRH in a lead role vis-à-vis Red Hill because CNRH signed the document on behalf of the Navy and it plainly states that CNRH "oversees all Navy supporting commands involved in the operation or maintenance of the Facility." While the Navy did not agree to the section that describes this role for CNRH, the C2 as practiced developed from misperceptions that the roles and responsibilities of those most directly accountable for protecting the drinking water (i.e., the installation commander and the installation public works officer) were superseded by CNRH as first in the line of defense for addressing environmental threats at Red Hill. As such, this helps to illustrate the importance of clearly identifying a single entity to be empowered and responsible for

protecting drinking water and the environment. [FF (1)-(10), (33)-(35), (219), (73), (82), (135), (347), (415)-(471)]

9. Due to the unique nature of Red Hill and the environment surrounding it, PACFLT played a role to communicate and coordinate such that the Navy's efforts were synchronized and clearly understood by state and congressional stakeholders. This role evolved over many years in light of the multiple commands having responsibility for the operation and maintenance of the facility and surrounding property. However, the May and November spills reveal that a gap had developed between the communication and coordination functions performed by PACFLT and the operations, maintenance, and response functions performed in and around Red Hill by the various commands and their ISICs. This gap resulted in leaders not fully understanding or appreciating the accumulating risk due to the actual operations and support of the facility. Additionally, as a second order effect of the PACFLT focus on Red Hill, the commands that had various responsibilities with respect to Red Hill modified their expected behavior such that they did Red Hill things differently. As an example, the JBPHH CO reported that he clearly understood he was responsible in the event of a fuel spill in the harbor, but looked to CNRH for a fuel spill at Red Hill based on higher headquarters involvement. Although he is the Regional Environmental Coordinator, CNRH was reluctant to communicate with state regulators regarding Red Hill without concurrence from PACFLT. However, this was not the intent of the PACFLT team who sought awareness, rather than control, of regulator communications for the purposes of message alignment. [FF (58), (65), (69), (90)-(92), (97)-(99), (123)-(126), (129), (137), (177), (186), (196)-(199), (208)-(211), (422), (426)-(427), (429)-(471)]

10. When the PACFLT COM exercised his authority as Senior Officer Present on 29 November to establish a CAT and lead the combined response to the drinking water crisis, PACFLT, at the onset, stepped into the same tactical disadvantage that CNRH experienced. Without effective on-scene incident command led by the installation CO, PACFLT lacked the tactical, on the ground perspective that should have been derived from the experts most responsible for the systems, structures, and land impacted by the fuel spill. However, PACFLT was ultimately able to overcome these deficiencies in the subsequent days and successfully establish clear and decisive unity of effort through their leadership. While there were missteps in the initial days, PACFLT's involvement was the most consequential driver in resolving the drinking water crisis and supporting affected families. [FF (238)-(338), (466)-(470)]

AFFF System Design and Construction

While the Cavanaugh Report identified that the design of the AFFF system inside Red Hill deviated from required code by using PVC instead of steel for most of the retention line, the supplement uncovered additional facts that explain more fully how this deviation contributed to the November spill and subsequent water contamination.

11. NAVFAC PAC oversight of the Red Hill AFFF waste system design and construction directly led to the final PVC AFFF retention line configuration. The flawed execution of project management in this case resulted in the Navy accepting a deficient product that ultimately failed following a type of fuel movement for which the system was originally designed as a contingency function, releasing fuel into the environment. The Design Manager (DM) was not assertive in providing guidance to the construction manager (CM) regarding best management practices and code enforcement and did not effectively oversee the CM. Moreover, the DM failed to take effective action to address the construction contractor's intent to install PVC after receiving their recommendation to do so prior to construction commencing. The CM, a contracted employee, made a critical decision without consulting the DM and without understanding the risk associated with allowing PVC to replace steel. After construction of the AFFF retention line commenced, but prior to completion, the CM missed another opportunity to stop installation of PVC piping when answering an RFI from the construction contractor that explicitly stated that PVC was being used for the AFFF retention line. Additionally, overall NAVFAC PAC oversight of the actual jobsite was lacking in that it failed to identify and question the presence and installation of a large quantity of PVC pipe over a period of months, which had no reasonable justification for being on the jobsite. Despite these failures within the construction management process, the improperly installed PVC piping was discovered after it was fully installed, but prior to the system being accepted by the government. This should have led to the removal of the PVC and replacement with the specified steel piping. However, NAVFAC PAC, in extensive consultation with NAVSUP (FLC PH & NPO) and DLA, approved the plan to maintain PVC piping in the majority of the AFFF waste system based on cost. This approval was reached in spite of understanding that the system would be one-time use in the event that it transported fuel, and without addressing the fact that it did not meet the applicable DoD UFC for transporting AFFF solution or identifying and mitigating other risks associated with using PVC in an industrial environment, to include the risk of being struck by a heavy object as occurred in November 2021. [FF (362)-(414), (416)-(417), (420)]

12. While human error, as described in the Cavanaugh Report, is the primary cause of the November spill, the fact that a large portion of the AFFF retention line was constructed using PVC was a proximate cause of the November spill. It is reasonable that steel pipe, as required by the DoD UFC, would have been less likely to sag under the weight of fuel contained within it, making it unlikely that the trolley would have struck the low point drain valve in that case. Even if struck by the trolley in the same manner as actually occurred, a steel retention line and low point drain would most likely not have ruptured, thereby preventing the spill. [FF (5), (18)-(19), (140), (362)-(414), (448)-(452)]

13. Lack of knowledge regarding the design of the low area in the AFFF retention line also contributed to the November spill. If those personnel who did the checks of the AFFF waste system following the May spill had understood that the system was designed and built in such a way that up to 40,000 gallons of fluid would be retained in the system and that manual draining of the low area was required following any operation that moved fluid, it is reasonable to expect

that they would have used the manual low point drains, or the installed low point drain system, to check for fuel in the piping. This lack of knowledge was exacerbated by the two years that the system sat unattended and unmaintained due to the lack of a maintenance program manager. [FF (5), (16), (18)-(22), (41)-(43), (61), (67), (70), (140), (189), (362)-(414), (448)-(452)]

The Red Hill Well

14. Three factors combined to result in there being no risk analysis, beyond a cursory look inside the pump room, and no decisions regarding the Red Hill well for eight days after the November spill initiated: 1) lack of understanding of the well by those in leadership; 2) lack of understanding of and sensitivity to the magnitude and specific location of the spill by those who understood the well; 3) lack of knowledge and proficiency regarding response and protection plans that address the risk to the well. When applied to the multi-party crisis C2 as practiced, the combined team was not able to appreciate the risk associated with a large fuel spill directly above a functioning drinking water well, or the minimal operational impact to the water distribution system of securing the well. That said, the action by Commander, Navy Region Hawaii to secure the well within the first few hours of him being made aware of a chemical smell in the drinking water in a few homes, and before any data verified fuel in the water, is commendable as it certainly prevented greater contamination of the drinking water distribution system. [FF (1)-(10), (200)-(205), (209), (219), (228)-(237), (287)-(288), (291), (304), (335), (433)-(465)]

15. It is unacceptable that the JBPHH Public Works Officer failed to respond to the November spill, which was in the immediate vicinity of a well for which he was responsible. And although the May spill occurred further away from the well, his absence from that event further exposes his lack of diligence for protecting the water system following a spill event. Importantly, he is charged to both operate the Navy water system and oversee the installation environmental team. As such, he should have detailed familiarity with and clear ownership of the Red Hill well, as well as environmental expertise at his disposal. The PWO shared that he thought the November spill only contained water and maybe some AFFF. Even if that were the case, AFFF released in the vicinity of a well would be just as urgent a concern as fuel given its hazardous nature. The PWO's absence was a significant factor in a delayed recognition of the risk that the spill posed to the drinking water system. Additionally, spill information did not naturally flow through the installation commander's staff, based on the Red Hill C2 as practiced. CNRH, who lacked the technical expertise on his staff regarding the well, was the focal point for information regarding the November spill and was lead on communications with regulators. When combined with the PWO's lack of presence at the scene of the spill, this resulted in him not being aware that the November spill contained fuel until after chemical smells were reported in drinking water on 28 November. Finally, another notable factor is that the standing Red Hill response plan, which identifies the well as a risk in the event of a spill, was held at the CNRH level. However, it was not understood or practiced by those expected to respond to a spill at Red Hill. Altogether, these factors combined to produce a significant missed opportunity in connecting the spill to the risk to

the well. [FF (1)-(10), (33)-(35), (200)-(205), (209), (219), (223), (225), (228)-(237), (287)-(288), (291), (304), (335), (433)-(465)]

Communications

16. Based on a thorough review of the facts regarding communications by the Navy in response to the May and November spills, there was never an intent to mislead, lie, or obfuscate in any case. All communications were developed with the intent of being truthful based on the facts known at the time, all of which unfolded in a dynamic and fast developing environment. This is applicable for communications with military members and their families, regulators, state and congressional leaders, and the public. While there were missteps, all communications were developed and transmitted with the goal of transparency and ensuring that the receiver of the message was aware of the most up to date information available. This was made difficult by the rapidly accelerating drumbeat of information as the crisis unfolded. [FF (10), (52)-(53), (55)-(57), (73)-(74), (76), (81)-(83), (93), (102), (104)-(109), (111)-(112), (120)-(122), (124)-(126), (128), (133)-(139), (146), (153)-(157), (173)-(186), (194), (200)-(204), (214), (220)-(338), (433)-(470)]

17. Four key friction points in communications with the public negatively impacted public trust in the Navy following the discovery of fuel in the drinking water. First, there was a four day delay in reporting to the public that the Red Hill well was secured on Sunday, 28 November. There were certainly other Navy and DOH reports to the public regarding the potential for contamination in the drinking water during that time, but the revelation four days after the fact that the Navy saw the threat as serious enough to secure a water source gave some the impression that the Navy was trying to hide something and thus, it negatively impacted public trust. Of note, this delayed reporting on securing the Red Hill well was entirely due to an unintended disconnect between CNRH leadership and their Public Affairs team who were not aware of this development until 2 December. Second, the JBPHH CO's message to families on 29 November that the water was safe and that he and his staff were drinking it was followed, later that same day with competing press releases from DOH and CNRH that cautioned the public regarding hazards in the water. This immediate turn around in messaging, along with the report three days later that the Red Hill well was secured prior to the CO's message to families, combined to hurt public trust. Third, the misalignment in message and approach between the Navy and DOH caused confusion and hurt public trust, as seen on 29 November where press releases from the two organizations occurred less than two hours apart and differed considerably in recommendations to the public. It is important to note that there were strong, but unsuccessful efforts to reconcile the differences by both CNRH and the PACFLT DCOM ahead of these two competing press releases. Fourth and finally, the misalignment in message and approach between the Army and the Navy significantly hurt public trust because it created real differences in compensation and action, while also producing the perception that the Navy was lagging the Army's actions in taking care of families. In all but the first case, these friction points can be traced to differences in approach. The Navy was initially seeking data to show contamination

before taking certain actions, as opposed to DOH and Army who assumed a different posture and did not wait for data to prove contamination. This difference in philosophy generated a very visible reality that the Navy was behind in taking care of affected and potentially affected persons in the earliest days of the drinking water crisis, despite its significant and largely effective efforts to proactively provide resources and support. [FF (10), (146), (153)-(157), (173)-(186), (194), (200)-(204), (214), (220)-(338), (433)-(470)]

18. Communications with regulators in response to the May and November spills met the requirements of all governing instructions and regulations based on the facts known at the time. However, based on the facts known as of 15 April 2022, the CHT tank overflow during the 6 December flooding event should have been reported [REDACTED] to regulators. The plan by CNRH to raise this issue at the 21 April Site Characterization Discussion is positive, but the delays associated with this matter are not reflective of full transparency. Notwithstanding the above, it is important to note that the relationship between the Navy and state and federal regulators regarding Red Hill, which developed over many years, had engendered a lack of partnership among the parties at times, as they worked through past challenging events. This sense by some Navy staff adversely impacted communication efforts by the Navy, resulting in a focus on compliance with requirements rather than striving to develop a close partnership in the common mission of protecting the environment. In the initial stages of both spills, communications with regulators remained as close as possible to baseline requirements, even when providing what key Navy personnel perceived as courtesy notifications. There was also an outsized focus on coordinating regulator communications with those going to State and Congressional stakeholders via PACFLT, creating a sense among Navy environmental personnel that they could not exercise initiative to more quickly communicate key facts to regulators about events at Red Hill. Moreover, the CNRH NOSC-R and other environmental personnel, as well as their leadership, demonstrated a consistent practice of not conducting an effective independent assessment of spill events in order to help inform regulator notifications. In the case of the December flooding event, it once again highlights that CNRH continues to rely on tenant command personnel to inform decisions on required actions with regulators without conducting independent verification, which is a significant vulnerability. It is important to note, however, that following the discovery of water contamination on 28 November, communications with regulators regarding data about the water system took on a much more open and free-flowing structure. A key example of this was water sample data, which was given to regulators in raw form before final results were provided from the lab doing the analysis. [FF (10), (52)-(53), (55)-(57), (73)-(74), (76), (81)-(83), (93), (102), (104)-(109), (111)-(112), (120)-(122), (124)-(126), (128), (133)-(139), (146), (153)-(157), (173)-(186), (194), (200)-(204), (214), (220)-(338), (433)-(471)]

Training

19. As described in the Cavanaugh Report, human error in failing to properly respond to the November spill is the primary cause of the drinking water contamination. However, the lack of

sufficient human performance enhancement, assessment and feedback processes necessary to ensure readiness to respond to a complex spill inside of Red Hill was a proximate cause of the drinking water contamination. There is no evidence that the installation or the region had ever conducted comprehensive spill response training or even one drill to prepare for a spill at Red Hill. This lack of preparation even after the May spill, highlights this failure as that event should have served as a bellwether for key leaders to take action. An effective, coordinated training and drill plan should have the elements of formal instruction, practical demonstration, formal qualification, and certification events on a periodicity matched to the complexity of the mission. Failure at Red Hill was born out of a complex casualty in an unusual environment that required a multi-organization response, but was little understood and not practiced. It is likely that had the installation or CNRH run a rigorous integrated drill program, C2 seams would have undoubtedly been identified and corrected ahead of time. [FF (1)-(10), (29), (60), (102), (113), (117), (150), (152), (163), (265), (298)-(299), (430)-(471)]

20. The CNRH Red Hill response plan and other applicable spill emergency procedures require the spilling command to take charge initially and then determine if and when the casualty is beyond their capability. At that point they are expected to request additional assistance from the installation and/or region. With regards to a spill, there is no evidence that either FLC PH or NAVFAC HI key personnel received any training regarding the incident command system (ICS) or in recognizing the risks associated with threats to the environment, such as a major fuel spill. This lack of formal training yielded a lack of awareness and environmental insensitivity, likely contributing to the false sense of confidence both COs demonstrated in assessing that the spill was contained and that further assistance from the installation and/or region was not needed. Their confidence, in turn, transferred a false sense of security to CNRH and other senior leaders, affecting their actions in such a way that the causal chain that should have led to a more robust response was broken. [FF (1)-(10), (24), (26), (29)-(30), (47), (60), (102), (113), (117), (145), (150), (152), (155)-(156), (163)-(165), (174)-(180), (184)-(265), (298)-(299), (430)-(471)]

21. The Cavanaugh Report concluded that FLC PH personnel were not trained or equipped to stop the source of the November spill, however additional clarification is needed regarding the related opinion that responders defaulted to managing the spill. While accurate, FLC PH personnel did not default to managing the spill solely because the situation and available equipment prevented them from plugging the low point drain while fuel was flowing out of it, they were never prepared or expected to fight the casualty in that way. With noted exceptions, FLC PH watch standers during both spills responded as they were trained and equipped, which is to control the spill (shut the closest accessible valve), contain the spill, and then recover from the spill. The response capability of personnel at FLC PH for a large spill is thus limited because the expectation is that the shore installation support, who possess the expertise and resources, would augment them when necessary. That said, there were significant errors by FLC PH personnel, including the CO, in assuming and reporting the spill was contained in both cases. Additionally, failure to immediately secure the CHT and groundwater sump pumps in responding to the November spill was contrary to the goal of containing the spill. When combined with the lack of

coordinated installation support, Navy leaders were not cognizant of the risk they were accepting with the FLC PH watch stander spill response posture of “control, contain, and recover” prior to both events, as opposed to a more training and equipment intensive posture where watch standers would be trained and equipped to fight a spill in the same manner that a Navy Sailor would stop flooding on a warship at sea. [FF (1)-(10), (24), (26), (29)-(30), (47), (60), (102), (113), (117), (145), (150), (152), (155)-(156), (163)-(165), (174)-(180), (184)-(265), (298)-(299), (430)-(471)]

Environmental Team

22. In response to the November spill, the on-scene leadership (FLC PH CO and NAVFAC HI CO) did not appropriately engage environmental subject matter experts and therefore did not recognize the environmental risk they were assuming in making and reporting best case assumptions regarding spill containment. The acting CNRH Environmental Director, who had no specific environmental training, was on-scene due to his primary duty as the NAVFAC HI PMO, but did not contribute substantively to advising on-scene leadership regarding environmental risk. It is unclear as to what role the acting CNRH Environmental Director played in response to the November spill, which may have led on-scene leaders to assume that his lack of action indicated a lack of environmental risk. In reality, CNRH spill plans require the commander of the spilling command to establish incident command and call in the appropriate environmental support as required. [FF (140)-(215), (429)-(471)]

23. The NOSC-R failed to personally ensure an adequate response to both the May and November spills. Further, given the ambiguity in initial reporting and volume of fluid described, he should have been on site during the November spill response. The NOSC-R had the training and expertise to more accurately assess the release, better knowledge of the environmental subject matter experts available for assistance, and access to standing spill response Basic Ordering Agreements (BOA) that may have resulted in a faster, more robust response and arresting of the release. His failure to report to the scene of the November spill, was compounded by the acting CNRH Environmental Director reporting to him inaccurately regarding the scope and contents of the spill and telling him he was not required at the scene. Because it was very quickly clear to the on-scene responders that the spill contained fuel, the NOSC-R should have been called to the site to advise the on-scene leaders and CNRH regarding environmental risk. [FF (1)-(10), (24), (26)-(30), (35)-(37), (47), (49), (53), (56)-(57), (60), (102), (113), (117), (145), (150), (152), (153)-(156), (163)-(165), (174)-(180), (184)-(265), (298)-(299), (430)-(471)]

24. The CNRH environmental program management team failed to go to the site and investigate the November spill, even after the magnitude of the spill was obvious during the week following the event. Contributing to this, the CNRH Environmental Director was off-island from 20 November through 2 December. Because it is impossible to adequately assess a spill’s potential impact to the environment without being on site, the most experienced environmental subject matter experts missed a critical opportunity to observe the physical situation, question operators

and responders regarding sumps, and potentially apply knowledge of the well's developmental tunnel directly below the spill to produce a better risk assessment that may have resulted in closure of the well before the water distribution system was contaminated. [FF (140)-(338)]

25. CNRH and JBPHH failed to implement the requirements of OPNAVINST 5090.1, chapter 21, to engage preventive medicine in determining risk and risk communication strategies once the water contamination became apparent on 28 November. Engaging the Navy and Marine Corps Public Health Center regarding public communications in a timely manner might have prevented some of the negative impacts to public trust. When the water system exceeded an action limit, specific language about health effects, at-risk populations, and possible actions consumers should take to mitigate risks were not included in public notifications as required. Additionally, public notices were not reviewed by BUMED, as required, prior to giving them as recommendations for release to the installation Commanding Officer. It is imperative that experts in human health and environmental risk communication be part of the team advising the Commander and the Public Affairs team. This was not done. That said, it should be noted that the PACFLT Surgeon recognized the importance of engaging the experts at NMCPHC and quickly began building contacts and communication with them at the formation of the PACFLT CAT and more effectively addressed this issue. [FF (214), (245)-(246), (277)-(278), (283), (290), (296), (306)]

26. As the drinking water compliance subject matter experts, the environmental team should have been intimately involved in decision making and public communication regarding the water contamination, however the CNRH Environmental Director reported that her involvement with public communications was only to provide raw data to leadership. The Environmental Director has the responsibility to interface directly with State and Federal environmental regulators, however, there were many people in leadership positions making contacts with the regulators during the drinking water crisis, which may have confused the regulators, resulted in miscommunication, encouraged diffusion of responsibility, and impacted trust. [FF (140)-(338)]

27. The Environmental team also missed critical opportunities for early validation of the water crisis. The Red Hill well samples collected on 24 November were collected from the standard sampling location, which is a low-flow pump that takes water two feet below the surface of the water. They did not take an additional bailer sample from the surface, which is where fuel would be expected to gather. When the 24 November sample results returned on 1 December, they were reported to leadership as non-detect for Total Petroleum Hydrocarbons (TPH). However, the same sample results indicated estimated detections of naphthalene. These detections were not mentioned in any of the reporting reviewed for this investigation and if further investigated may have provided earlier confirmation of fuel in the well. [FF (140)-(338)]

Manning

28. When the Navy's centralized Shore Manpower Requirements Determination (SMRD) process was abolished by SECNAV in 1986, he directed the Navy to continue aggressive manning efficiency reviews that were to be performed by the various "claimants," which are formally known as Budget Submitting Offices (BSO). NAVSUP, as BSO 23, did not conduct any formal manning efficiency reviews or requirements determinations for FLC PH within the last 10 years. The most recent reviews were conducted in 1997 and 2008 by OMB and a NAVSUP funded private consultant, respectively. Significantly, these are both prior to the 2014 merger of fuels operations between Pearl Harbor and Hickam AFB. Additionally, DLA has not provided guidance to the services regarding DFSP manning requirements. There is, therefore, no current baseline requirement on which to base an assessment of whether or not FLC PH Fuels Department is manned correctly today. [FF (339)-(361), (415), (423), (425)-(429)]

29. After an exhaustive review of Fuels Department manning, it was not possible to reconcile the civilian FTE that FLC PH states that they are authorized for the Fuels Department with the civilian FTE that NAVSUP says they are authorized for the Fuels Department. NAVSUP states FLC PH Fuels Department is authorized 84 FTE vice the 89 FTE that FLC PH actually manages. The lack of a formal NAVSUP process to determine, request and adjudicate civilian manning requirements with specificity is the basis of this disconnect. As practiced, the manning process for Fuels Department is budget based rather than work requirements or position based and typically involves email and meetings between the FLC PH business office and either SUP01, SUP03 at NAVSUP or communications via the NAVSUP Financial Management Tool. [FF (339)-(361)]

30. Until 2022, FLC PH made only one formal request for one civilian FTE in the last 25 years. They did create several "overhire" positions during that time in order to more fully use the civilian personnel budget that they are allocated, but there is no evidence of a formal request for additional manning, or any substantive analysis to support such a request, had it been made. As such, there is no evidence of elevating manning concerns with the specificity necessary for NAVSUP, as ISIC, to make an informed risk decision. Additionally, in looking back the last decade, NAVSUP did not exercise their ISIC responsibility to ensure that FLC PH demonstrated appropriate analytic rigor in assessing their manning and that any concerns were formally adjudicated with a clear owner of the risk being assumed if a request was denied. [FF (339)-(361)]

31. Between the May and November spills, there is no evidence of work to add Fuels Department manning based on increased watch standing requirements added as a corrective action from the May spill. There was an attempt by the FLC PH Business Office Director to request manning within the POM process, but there is no evidence of any formal analysis used to support that request, which was subsequently denied by the ISIC. That denial appears to be

based on budget considerations and there is no evidence of an operational risk decision being made by the ISIC. [FF (339)-(361)]

32. Although some portion of Fuels Department FTE are funded by NAVSUP, there was a consistent theme found throughout the interview process at FLC PH and NAVSUP/NPO that DLA is expected to fund Fuels Department manning, with little evidence of consideration that NAVSUP could fund needed manning. For example, when DLA denied the 1 FTE for a new environmental person in FY18, there is no evidence that NAVSUP or FLC PH considered the option that NAVSUP provide an additional FTE for the billet. This is especially important considering that the reason DLA denied the request was the fact that DLA expects that function to be provided by the Navy. In spite of this, FLC PH hired the environmental person using their internal “overhire” process without NAVSUP or DLA involvement in the decision. [FF (339)-(361), (415), (423), (425)-(429)]

33. While the Cavanaugh Report opinion that FLC PH Fuels Department is undermanned at every level is based on interviews with FLC PH employees combined with deficiencies in Fuels Department processes identified in that investigation, there is not an analytic basis for the reports made by those FLC PH employees, nor is there evidence that relief was effectively sought from the ISIC. It is important to note, however, that FLC PH appears to have improved their manning processes and thinking since the November spill. Although there has already been a request for manning, an SMRD was formally requested from NAVMAC, which assumed centralized SMRD responsibility for the Navy in July 2021. Additionally, FLC PH has begun analysis in order to determine how many additional FTE are needed based on work requirements, and transparent communications with the ISIC are evident. [FF (339)-(361)]

May Spill Volume Miscalculation

34. As identified in the Cavanaugh Report, the failure to fully account for fuel spilled on 6 May (human error) is the primary cause of the November spill. However, there were many missed opportunities to identify or correct this error before the November spill that are important to understand. First and foremost, the Deputy OIC of NPO, the Navy’s subject matter experts on bulk fuel accountability, in conducting the investigation of the May spill, understood in the course of that investigation that the installed fuel accountability system reported a loss of approximately 20,000 gallons and yet did not note that fact in his initial or final report. Second, the FLCPH CO (both the CO on 6 May and the next CO) understood this 20,000 gallon discrepancy and did not take appropriate action to address or report it, deciding instead to accept the flawed theory it was “packed in the pipe.” These individuals are the most responsible for this missed opportunity. [FF (58), (66), (68)-(69), (71)-(72), (78)-(81), (84)-(86), (88)-(92), (94)-(101), (103)-(104), (110), (113)-(115), (117)-(119), (122)-(127), (129)-(132), (134)]

35. A second and lower tier of missed opportunity begins with the NAVFAC HI CO, who expressed reservations to the FLCPH CO about the engineering analysis used to resolve the

discrepancy as late as October 2021, but did not report his concerns to anyone above him in the chain of command. The NAVFAC HI CO was right to have concerns regarding the fact that pressure in the fuel system was not accounted for in the accepted calculations, however he did not follow through to bring the problem to senior leader attention or demand action himself. The contractor hired by NAVFAC EXWC to conduct a root cause analysis of the May spill independently identified a drop of approximately 20,000 gallons from tank 12 that occurred in about one minute at the exact time of the May spill and included that fact within a table in their report, but this written finding went unnoticed by the NAVFAC EXWC team that reviewed the root cause analysis report upon receipt from the contractor. Further, when NAVFAC PAC initiated the Red Hill repair mitigations report to go along with the root cause analysis contracted by NAVFAC EXWC, there was another opportunity to notice the 20,000 gallon drop noted within the root cause analysis report. Moreover, NAVFAC PAC positively endorsed all three reports to PACFLT in October 2021, recommending they be approved. While not his intent, this endorsement communicated that the senior civil engineer in Hawaii was satisfied with the (b)(6) investigation and its findings, opinions and recommendations. However, after careful review of the matter, the intent of this endorsement was for the limited purpose of documenting, for the record, the material repair and mitigation efforts that were being executed in response to the material deficiencies identified within the (b)(6) investigation report and associated NAVFAC EXWC root cause analysis report. [FF (58), (66), (68)-(69), (71)-(72), (78)-(81), (84)-(86), (88)-(92), (94)-(101), (103)-(104), (110), (113)-(115), (117)-(119), (122)-(127), (129)-(132), (134)]

36. A third and the lowest tier of missed opportunity occurred when the command investigation was provided to several parties for review outside of NAVSUP, to include personnel within PACFLT N4, PACFLT GA, and the PACFLT DMHQ, who also did not identify the discrepancy. While these reviewers were looking at the reports from the perspective of impacts to PACFLT's Red Hill communication and coordination role and not with a critical eye towards technical issues within the report, it is fair to say that these were missed opportunities. [FF (58), (66), (68)-(69), (71)-(72), (78)-(81), (84)-(86), (88)-(92), (94)-(101), (103)-(104), (110), (113)-(115), (117)-(119), (122)-(127), (129)-(132), (134)]

37. In addition to the above missed opportunities from the investigation, it is also important to note that AFHE data was available to FLC and NAVFAC HI engineers that shows that the tank 12 isolation valves were open for approximately 2 minutes after the pressure transient is recorded in the system, indicating that the two damaged areas (including one (b)(3)(A)) were exposed to pressure from the full weight of fuel in tank 12 throughout that time. Additionally, the theory that fuel was "packed in the pipe" demonstrates a fundamental lack of engineering rigor and a gross misunderstanding of the installed fuel accountability system which uses tank levels, reported transactions, and an assumption that all fuel pipelines are full to report changes in the bulk fuel account. Thus, if there was room in a pipe for 20,000 gallons, that amount of fuel would have to increase level in a tank first because the pipe was full at the start, and thus would be accounted for. It is therefore, not possible for fuel to be lost from inventory unless there is a

reported transaction out of the system, an error in the tank level system, or an uncontrolled release. A third party analysis by an engineering consulting firm would likely have identified this error, as demonstrated by Austin Brockenbrough and Associates, LLC which identifying it during their root cause analysis for NAVFAC EXWC, although not specifically tasked to look for it. But for this working theory of “packed in the pipe” gaining acceptance, more scrutiny would certainly have resulted. [FF (58), (66), (68)-(69), (71)-(72), (78)-(81), (84)-(86), (88)-(92), (94)-(101), (103)-(104), (110), (113)-(115), (117)-(119), (122)-(127), (129)-(132), (134)]

38. The Cavanaugh Report correctly identifies the (b)(6) Investigation as a fundamentally flawed investigative process that was inadequate. Most importantly, the NPO Deputy OIC, in spite of having adequate information provided, failed to accurately resolve the most critical and fundamental fact associated with the May spill – the volume of fuel spilled. If the volume discrepancy, which was known to the NPO Deputy OIC at the time of the investigation, had been plainly identified within his report, even if documented as resolved, senior leaders would likely have demanded a more formal resolution of the matter. Further, there were many individuals from various organizations that reviewed and identified other issues in the (b)(6) investigation as it progressed and before it was endorsed by COMNAVSUP, with a general consensus that it was not thorough or well done. While these issues pale in comparison to the failure to identify or report the discrepancy in the volume spilled, they should have been fed back to NAVSUP at the time they were noted, but were not. Finally, it is important to recall that this investigative process was first initiated by CNRH, who quickly recognized the significance of the May spill and the need for an outside inquiry. CNRH directly engaged COMNAVSUP to request they lead the investigation due to his level of concern over the severity of damage caused during the incident and his wariness towards FLC PH to conduct a thorough inquiry. However, by the end of the investigative process in September and October 2021, CNRH provided little input or critical assessment with regard to the investigation despite their interest and responsibilities in Red Hill, ultimately relegating themselves to facilitating the public release of the report prior to the FTAC hearing. [FF (58), (66), (68)-(69), (71)-(72), (78)-(82), (84)-(86), (88)-(92), (94)-(101), (103)-(104), (110), (113)-(115), (117)-(119), (122)-(127), (129)-(132), (134)-(135)]

Cavanaugh Report

39. Prior to the Secretary of Defense decision on 7 Mar 2022 to defuel and shut down Red Hill, ADM Paparo stated in his endorsement of the Cavanaugh Report that his recommended actions are “designed to ensure safe and effective operations at Red Hill, thereby setting the conditions for the Department of the Navy and Department of Defense to determine the nature and scope of future operations at Red Hill.” Because ensuring safe and effective operations at Red Hill are required to either defuel or continue operations, his recommended actions, in conjunction with those of RDML Cavanaugh, should be viewed in that context, even though the decision to defuel has since been finalized. [FF (337)]

V. Recommendations

1. Establish necessary material and operational conditions at Red Hill to support safe and effective defueling operations.
2. Realign the 'as practiced' leadership of Red Hill incident response to CO JBPHH. Provide training and support, as required, to ensure that the installation Commander is prepared to execute this responsibility.
3. Develop and implement an integrated spill response training and drill program that incorporates all organizations and individuals required to effectively respond to a fuel spill at Red Hill. This program should be led by the installation commander and overseen by the ISIC, CNRH.
4. Resolve the mutually exclusive positions across CNIC, NAVFAC and NAVSUP regarding AFFF system maintenance program management. In so doing, designate a single organization to be responsible for support system maintenance program management at Red Hill.
5. Audit the Red Hill AFFF system maintenance contract and modify it as necessary to ensure that it achieves all preventative maintenance required by the manufacturer, as described in system operations and maintenance manuals.
6. Inspect the entire Red Hill AFFF system to ensure compliance with required material specifications.
7. Audit NAVFAC PAC contracting processes and procedures to ensure compliance with Department of Defense and Navy contracting requirements, as well as commercial construction industry best practices.
8. Conduct a dedicated and broad review of CNRH, JBPHH, and NAVFAC HI environmental team knowledge and performance, including communications with regulators, in light of environmental law, policy, regulation and regulator best practices. Develop and execute an environmental team training, assessment, and feedback program. Include all personnel who have a role requiring expertise in protecting drinking water and the environment.
9. Develop guidance for commanders regarding environmental and public health risk management assumptions and actions to inform future crisis response efforts having a significant public nexus. Using the week of 28 November and the four key friction points noted above as a case study, provide strategies for bounding and communicating risk to the public within the context of limited or no analytic data during the early stages of such a crisis.
10. Revise the CNRH and Red Hill-specific response plans to incorporate specific actions associated with the Red Hill well and lessons learned from the Cavanaugh Report and this

supplement. Plans recommended for review and update include the CNRH Integrated Contingency Plan, the CNRH Red Hill Fuel Storage Facility Response Plan, the Groundwater Protection Plan, the JBPHH Emergency Management Plan, the Community Water System Emergency Response Plan for JBPHH, the Community Water System Risk and Resilience Assessment for JBPHH, and any other plans designed to contribute to protecting drinking water and the environment.

APPENDIX A
Enclosures

- 1) VCNO ltr 5800 Ser N09/22U100519 of 4 March 2022
- 2) Email from VCNO to RADM James Waters, USN, Regarding Red Hill Supplemental Extension Request (30 March 2022)
- 3) Red Hill Administrative Order on Consent
- 4) NAVFAC PAC Interim Update on the Final Groundwater Protection Plan (August 2014)
- 5) Community Water System (PWS-360) Emergency Response Plan for Joint Base Pearl Harbor-Hickam (JBPHH), Pearl Harbor, Hawaii (June 2021)
- 6) Community Water System (PWS-360) Risk and Resilience Assessment for Joint Base Pearl Harbor-Hickam (JBPHH), Pearl Harbor, Hawaii (December 2020)
- 7) Image of Red Hill Site with Incident Locations and Distances (Received 11 April 2022)
- 8) Tumon-Maui Well Rehabilitation Project – An Application of Appropriate Technology: Then and Now (2013)
- 9) Site Plan Red Hill Bulk Fuel Storage Facility (Created 19 January 2022)
- 10) Interview Summary – (b)(6) 24 March 2022
- 11) Interview Summary – RADM Blake Converse, USN 19 March 2022
- 12) CNRH Red Hill Fuel Storage Facility Response Plan (August 2020)
- 13) DFSP Pearl Harbor Combined AFHE Event and Alarm Logs for 6 May 2021
- 14) Red Hill Root Cause Analysis Memo and Report Regarding 6 May 2021 JP-5 Spill (7 September 2021)
- 15) Interview Summary – (b)(6)
- 16) FLC Pearl Harbor Fuels Department Operations Orders (1 May - 20 November 2021)
- 17) NAVSUP Command Investigation Report Regarding 6 May 2021 JP-5 Spill
- 18) Interview Summary – CAPT Trent Kalp, SC, USN
- 19) Interview Summary – (b)(6)
- 20) Interview Summary – (b)(6)
- 21) Interview Summary – (b)(6)
- 22) Interview Summary – (b)(6)
- 23) Powerpoint of Red Hill AFFF Retention Sketch Revision 1 (Created: 22 November 2021)
- 24) Interview Summary – (b)(6)
- 25) Interview Summary – (b)(6)
- 26) Interview Summary – (b)(6)
- 27) Interview Summary – (b)(6)
- 28) FLC Pearl Harbor Timeline of Incident and Action 6 May 2021
- 29) FEDFIRE Red Hill NFIRS for 6 May 2021 Spill
- 30) Interview Summary – FEDFIRE
- 31) Interview Summary – (b)(6)
- 32) CNRH 5750 – Designation as FOSC Representative, NOSC Representative, and QI ICO (b)(6) (12 February 2021)
- 33) CNRH Integrated Contingency Plan - Core Plan (May 2014)
- 34) Interview Summary – Ms. (b)(6) (16 March 2022)
- 35) Interview Summary – Ms. (b)(6) (21 March 2022)

- 36) Email from Hawaii News Now Reporter to CNRH PAO – Query on Spill 6 May 2021
- 37) Email from CNRH PAO to Hawaii News Now – Response to Query 6 May 2021
- 38) Federal Fire Dispatch Report 6 May 2-21
- 39) CNRH Combined Integrated Contingency Plan (August 2018)
- 40) Interview Summary – (b)(6)
- 41) Interview Summary – (b)(6) (21 March 2022)
- 42) Interview Summary – CAPT (b)(6), USN (22 March 2022)
- 43) Interview Summary – CAPT (b)(6), CEC, USN (21 March 2022)
- 44) Interview Summary – (b)(6) (23 March 2022)
- 45) Interview Summary – CAPT James “Gordie” Meyer, CEC, USN
- 46) Interview Summary – (b)(6) (17 March 2022)
- 47) Interview Summary – (b)(6) (24 March 2022)
- 48) Interview Summary – LCDR (b)(6), SC, USN
- 49) Fire Suppression Reclamation System Record Drawings
- 50) P-1551 Design Drawings, Change R, (Signed 22 June 2018) (flattened and half size)
- 51) Kinetix Engagement MFR with Invoices
- 52) Three-Way Phone call with FLC PH CO, Deputy Fuels Director, and Fuels Director (6 May 2021)
- 53) FLC Pearl Harbor Fuels Department Estimates of Fuel Recovered
- 54) Interview Summary – (b)(6), USN
- 55) Interview Summary – RDML Timothy Kott, USN
- 56) Interview Summary – (b)(6)
- 57) CPF, COMNAVSUP, FLC Pearl Harbor CO Emails ICO 6 May 2021 JP-5 Spill
- 58) Interview Summary – CDR (b)(6), SC, USN
- 59) Interview Summary – LT (b)(6), SC, USN
- 60) Email from FLC Pearl Harbor XO with Reports (CCIRs and OPREPs) from 6 May 2021 Spill
- 61) Email from NAVFAC HI Red Hill PMO to DOH Regarding Phonecall this Morning (7 May 2021)
- 62) Email from NAVFAC HI Red Hill PMO to DOH Regarding Red Hill Status Update (7 May 2021)
- 63) Email from NAVFAC HI Red Hill PMO to DOH Regarding Tour of Red Hill Lower Access Tunnel (8 May 2021)
- 64) Email from NAVFAC HI Red Hill PMO to DOH Regarding Facts for Red Hill (7 May 2021)
- 65) Email from FLC PH CO to COMNAVSUP - Red Hill Fuel Release (7 May 2021)
- 66) Interview Summary – (b)(6)
- 67) SECNAV ORDER IMMEDIATE ACTIONS RED HILL UNDERGROUND STORAGE TANKS 7 DEC
- 68) P-40 DFSP Pearl Harbor Red Hill Tank 20-001
- 69) FLC Pearl Harbor Training Timeline After 6 May 2021 Spill
- 70) Documentation Regarding Other Explanations For Missing 20,000 Gals (26 May 2021)
- 71) Inventory JP-5 MFR for 6 May 2021
- 72) FLC Pearl Harbor Fuels Department Estimated JP-5 Volume Release at Tanks 19 and 20 – 7 May 2021
- 73) CNRH Media Release 21-03, Navy Contains Fuel Release at Red Hill Bulk Fuel

Storage Facility (7 May 2021)

- 74) Interview Summary – (b)(6) (21 March 2022)
- 75) Email from NAVFAC HI CO to NAVFAC HI Vice CO Regarding Investigation at Red Hill (8 May 2021)
- 76) Email from CNRH to NAVSUP ICO Red Hill Pipe Failure on 6 May 2021 (9 May 2021)
- 77) Email from NAVSUP to COMPACFLT Regarding Red Hill: NAVSUP Led Investigation (12 May 2021)
- 78) Enclosures to NAVSUP Command Investigation Report Regarding 6 May 2021 JP-5 Spill
- 79) Interview Summary – RADM John Korka, CEC, USN
- 80) NAVSUP Command Investigation of 13 August 2021
- 81) Interview Summary – Mr. (b)(6)
- 82) Interview Summary – RADM Pete Stamatopoulos, SC, USN
- 83) Email from Site Director, DLA Installation Management, Indo-Pacific to NAVFAC HI Red Hill PMO Regarding Draft Email to PACFLT on Red Hill (13 May 2021)
- 84) Email from CAPT Kalp to Investigation Team Responding to RFI (557 gallons) (11 January 2022)
- 85) Email from CAPT Kalp to Investigation Team Responding to RFI (11 January 2022)
- 86) FLC Pearl Harbor and NAVFAC EV Red Hill Remedial Actions after 6 May 2021 Spill
- 87) 6 May 2021 and 20 November 2021 GW Sampling Plan as of 9 December 2022
- 88) Interview Summary – (b)(6)
- 89) PowerPoint Presentation on Red Hill JP-5 Line Column Separation (Created: 28 June 2021)
- 90) Excel Spreadsheet with Estimated JP5 Line Volume Release (17 May 2021)
- 91) Interview Summary – CDR (b)(6), SC, USN (19 March 2022)
- 92) Interview Summary – CDR (b)(6), SC, USN (20 March 2022)
- 93) Fuel Tank Advisory Committee Agenda (20 May 2021)
- 94) Email from NAVFAC HI CO to CNRH Environmental Director Regarding Notice of Interest Sampling Results – 18 Nov (21 November 2021)
- 95) Email from FLC Pearl Harbor CO to NAVFAC Hawaii CO Regarding 6 May 2021 Spill Release and Recovery Calculations (5 October 2021)
- 96) Email from NPO Deputy OIC Regarding Draft Red Hill Investigation Deliverables (8 June 2021)
- 97) Interview Summary – (b)(6)
- 98) Red Hill Notice of Interest - Sampling Results (10 May 2021 - 2 December 2021)
- 99) Email from FLC Pearl Harbor CO to COMNAVSUP Regarding Elevated GW Samples (30 June 2021)
- 100) Email from Deputy OIC, NAVSUP Naval Petroleum Office to PACFLT N4 Regarding Draft Red Hill Investigation Status Report (4 June 2021)
- 101) Email from CNRH COS to Deputy OIC, NAVSUP Naval Petroleum Office Regarding Draft Red Hill Investigation Status Report (4 June 2021)
- 102) Email from PACFLT to PACOM Regarding Info: Red Hill Update (4 June 2021)
- 103) Email from Deputy OIC, NAVSUP Naval Petroleum Office to PACFLT N4 Regarding Draft Red Hill Investigation Deliverables due 8 Jun 2021 (8 June 2021)
- 104) Email from Deputy OIC, NAVSUP Naval Petroleum Office to PACFLT N40 (9 June

- 2021)
- 105) DOH ltr U0636RK Release Confirmation and Request for Information of 9 June 2021
 - 106) Email from FLC General Engineer to NAVFAC HI Red Hill PMO Regarding Review of Estimated Discharge Calculations for Red Hill (10 June 2021)
 - 107) Email from Deputy OIC, NAVSUP Naval Petroleum Office to (b)(6) PACFLT N40 Regarding Draft Red Hill Investigation due 8 Jun 2021 (11 June 2021)
 - 108) Interview Summary – (b)(6) (17 March 2022)
 - 109) Interview Summary – (b)(6) (24 March 2022)
 - 110) Email from PACFLT GA to PACFLT Staff Regarding Draft Red Hill Investigation (7 July 2021)
 - 111) Amendment to NAVSUP Command Investigation Regarding 6 May 2021 JP-5 Spill
 - 112) CNRHINST 3440.18 – CNRH Red Hill Bulk Fuel Storage Facility Emergency Response Notification Coordination Plan
 - 113) DFSP Pearl Harbor AFHE Tank Data for 6 May 2021
 - 114) Email from NAVFAC HI Regarding 6 May 2021 Spill Reporting Made to the DOH (11 January 2022)
 - 115) Board of Water Supply Docket No. 19-UST-EA-01 Post-Hearing Memo of 13 July 2021
 - 116) Email from (b)(6) to (b)(6) Regarding Red Hill Stakeholder Meeting of 08 July 2021 (9 July 2021)
 - 117) Silica Gel Cleanup of Extractable Petroleum Hydrocarbons (drafted 3 July 2019)
 - 118) San Francisco Bay Regional Water Quality Control Board, Petroleum Metabolites: Literature Review and Assessment Framework (27 June 2016)
 - 119) Email from (b)(6) to (b)(6) Regarding Red Hill Stakeholder Meeting of 08 July 2021 (1 April 2022)
 - 120) Email from CNRH to COMPACFLT Regarding (CUI) JBPHH Water Quality Update (29 November 21)
 - 121) Interview Summary – CAPT Albert Hornyak, SC, USN
 - 122) Interview Summary – LCDR (b)(6), SC, USN
 - 123) FLC Pearl Harbor Fuels Department Qualifications and Training Programs
 - 124) Interview Summary – CAPT James “Gordie” Meyer (18 March 2022)
 - 125) Interview Summary – RADM Dean VanderLey, USN (17 March 2022)
 - 126) Interview Summary – (b)(6) (29 March 2022)
 - 127) Interview Summary – CAPT (b)(6) (23 March 2022)
 - 128) Interview Summary – (b)(6) (25 March 2022)
 - 129) Interview Summary – (b)(6) (28 March 2022)
 - 130) Honolulu Star Advertiser, Approval of Red Hill Permit Recommended Despite Risks, 12 September 2021
 - 131) Email from NAVSUP to CPF Regarding 6 May 2021 Spill (17 September 2021)
 - 132) (CUI-AWP) Email from FLC Pearl Harbor CO to COMNAVSUP ICO Update to COM Regarding Red Hill Permit and 6 May 2021 Spill (28 September 2021)
 - 133) (CUI-AWP) Email from FLC Pearl Harbor CO to COMNAVSUP ICO Update to COM Regarding Red Hill Permit and 6 May 2021 Spill – CPF to INDOPACOM (1 October 2021)
 - 134) CNRH ltr 5000-45A Initial Release Response Report of 17 September 2021
 - 135) NAVFAC HI, Initial Release Response Report, Pipeline Breach in Tunnel, Red Hill Bulk Fuel Storage Facility (September 2021)

- 136) DOH ltr U0915RK Follow Up on Request for Information Letter, dated June 9 2021 (17 September 2021)
- 137) Email from PACFLT GA to CODEL Regarding 6 May Red Hill Spill Investigation Results (4 October 2021)
- 138) COMNAVSUP ltr 5830 Ser SUP00/078 of 14 October 2021
- 139) NAVFAC PAC ltr 5830 Ser 00/ of 18 October 2021
- 140) Red Hill Pipeline Way Forward COMPACFLT Endorsement Brief (given 20 October 2021)
- 141) Email from FLC PH CO to NAVSUP Regarding (CUI-AWP) Red Hill Investigation Report Update and Action (20 October 2021)
- 142) (CUI) Email from CPF to CNO and Follow-on Discuss with FLC Pearl Harbor CO, PACFLT N4, and COMNAVSUP (13 November 2021)
- 143) Email from CNRH Environmental Director to (b)(6) Regarding Preview of Questions (24 March 2022)
- 144) CNRH Media Release 21-08, U.S Navy Identifies Operator Error as Cause of May 6 Fuel Release at Red Hill (26 October 2021)
- 145) Fuel Tank Advisory Committee Agenda (28 October 2021)
- 146) CODEL ltr Regarding Safety of Navy's Fuel Operations to SECNAV of 1 November 2021
- 147) Honolulu Star Advertiser, Hawaii Health Officials Say Whistleblower Alleges Navy Withheld Information about Red Hill from Regulators, 9 November 2021
- 148) Email from CNRH Environmental Compliance Manager to DOH Regarding Recommendations to Improve the Timeliness of the Current Red Hill Analytical Program (22 November 2021)
- 149) Interview Summary – (b)(6)
- 150) Interview Summary – (b)(6)
- 151) Interview Summary – (b)(6)
- 152) FEDFIRE Red Hill NFIRS for 20 November 2021 Spill
- 153) Text Messages from 20 November 2021 between FLC Pearl Harbor CO, NAVFAC Hawaii CO, and CNRH COS
- 154) Recorded Interview ICO LCDR (b)(6), SC, USN (Part 2) (9 December 2021)
- 155) Email from (b)(6) on 13 January 2022
- 156) Interview Summary – (b)(6) (Second Interview)
- 157) Interview Summary – CAPT Hornyak (2nd)
- 158) Interview Summary – CAPT Albert Hornyak, SC, USN (16 March 2022)
- 159) Interview Summary – CDR (b)(6) USN (19 March 2022)
- 160) OPNAVINST 5090.1E – Environmental Readiness Program Manual (25 June 2021)
- 161) Interview Summary – CDR (b)(6) CEC, USN
- 162) FLC Pearl Harbor Timeline of Events - 20 November 2021
- 163) Text Messages from 20 November 2021 with JBPHH PWO, NAVFAC HI OPS, NAVFAC HI CDO, and NAVFAC HI Red Hill PMO Director
- 164) Text Message Between the NOSC and NAVFAC Hawaii Red Hill PMO Director (20 November 2021)
- 165) Interview Summary – CAPT Gordie Meyer, CEC, USN (Second Interview)
- 166) OPNAVINST 11320.23G – Navy Fire and Emergency Services Program (4 February 2013)

- 167) COMNAVREGHICOMNAVSURGRUMIDPACINST 5214.1 - CNRH and CNSG MIDPAC CCIRs (21 January 2020)
- 168) Interview Summary – (b)(6) (21 March 2022)
- 169) Interview Summary – (b)(6) (21 March 2022)
- 170) Interview Summary – (b)(6)
- 171) Interview Summary – (b)(6)
- 172) Image of Waiawa Pump Station Logbook Entry dtd 20 November 2021
- 173) Email from NAVFAC HI Red Hill PMO to CNRH Red Hill PMO Regarding CPF Bi-monthly input due by Friday (23 November 2021)
- 174) Interview Summary – CDR (b)(6) CEC, USN (Second Interview)
- 175) Interview Summary – RDML Timothy Kott, USN (16 March 2022)
- 176) Interview Summary – (b)(6)
- 177) Interview Summary v RDML Dion English, SC, USN (19 March 2022)
- 178) Interview Summary – (b)(6), USN (24 March 2022)
- 179) Email from FLC Pearl Harbor CO to COMNAVSUP Regarding 20 November 2021 Spill (22 November 2021)
- 180) Email from CNRH to PACFLT DCOM Regarding 20 November 2021 Spill (21 November 2021)
- 181) Interview Summary – (b)(6)
- 182) CNRH Media Release 21-11, Navy Responds to a Release from a Fire Suppression Drain Line at Red Hill (21 November 2021)
- 183) FLC PH OPREP-3 Navy Blue Message 210320Z 22 November 2021
- 184) Email from NAVFAC HI Red Hill PMO to PCS HI Regarding Authorization to Proceed Red Hill Cleanup 21 November 21
- 185) Email from NAVFAC HI Red Hill PMO to CNRH Red Hill PMO Regarding Talking Points on Fire Suppression Line (21 November 2021)
- 186) Email from COMPACFLT to CNO Regarding Red Hill Fire Suppression Drain/Return Line Leak (23 November 2021)
- 187) Email from CNRH to COMPACFLT Regarding CUI: Summary of Discussion with Reps Case and Kahele re: Nov 20 Red Hill Fire Suppression Return Line Leak (22 November 2021)
- 188) Email from NAVFAC HI CO to NAVFAC PAC Regarding CUI: Water Distribution Summary (29 November 2021)
- 189) Email from NAVFAC HI Red Hill PMO to CNRH COS Regarding Site Visit with DOH (22 November 2021)
- 190) CNRH Media Release 21-12, Navy Stops Release of Water and Fuel Mixture (22 November 2021)
- 191) Interview Summary – (b)(6) (22 March 2022)
- 192) Email from (b)(6) to (b)(6) Regarding: Navy Source Water – Latest Red Hill Fuel Incident (29 November 2021)
- 193) Email from CNRH PAO to JBPHH CO Regarding Joint Base Message for Distro to Ohana Military Communities and Hickam Communities (29 November 2021)
- 194) Interview Summary – (b)(6) 23 March 2022
- 195) Email from NAVFAC HI CO to NAVFAC PAC Regarding ADM Paparo Red Hill Visit this Morning (23 November 2021)
- 196) Email from COMPACFLT to CNO Regarding INFO Sen Hirono Phone Call (23

November 2021)

- 197) Email from CNRH Environmental Director to DOH Regarding 24 November Sample Results (3 December 2021)
- 198) Email from NAVFAC HI CO to NAVFAC PAC and CNRH Regarding Specific CCIR: Let Me Know as soon as Water Sampling from 24 November is Received (3 December 2021)
- 199) Email from CNRH Environmental Compliance Manager to DOH Regarding Notice of Interest Sampling Plan- Release Case 20211120-2330 (29 November 2021)
- 200) DOH ltr Notice of Interest in a Release or Threatened Release of Hazardous Substances (24 November 2021)
- 201) Email from FLC PH CO, to (b)(6) RE Red Hill Operations (7 December 2021)
- 202) CDO Summary Report (28-29 November 2021)
- 203) Navy PPV data showing earliest calls re: smell (26-27 November 2021)
- 204) MFR WRT Social Media Review (20 March 2022)
- 205) Email from (b)(6) to (b)(6) Re: PPV Data Request (23 March 2022)
- 206) Email from (b)(6) to (b)(6) Re: PPV Data Request (22 March 2022)
- 207) Email from (b)(6) to (b)(6) Re: PPV Data Request (22 March 2022)
- 208) Email from NAVFAC HI CO to (b)(6) Summary of key text messages from multiple strings (28 November 2021)
- 209) Interview Summary – (b)(6) (22 March 2022)
- 210) CAT Official Timeline
- 211) Email from NAVFAC HI CO to RADM Dean VanderLey Re: JBPHH Potable Waters – End of Day 29 Nov 2021 (30 November 2021)
- 212) CNRH Media Release 21-13 Navy Investigation, Testing Water at JBPHH Family Housing (28 November 2021)
- 213) Email from NAVFAC HI Red Hill PMO Director to (b)(6) Re: water sample locations (29 November 2021)
- 214) Interview Summary – CAPT (b)(6) MC, USN (23 March 2022)
- 215) COMPACFLT EXORD DTG 040228Z DEC 21
- 216) COMPACFLT EXORD DTG 110411Z DEC 21
- 217) Interview Summary – (b)(6) (18 March 2022)
- 218) CNRH JBPHH Water Communication Plan (November-December 2021)
- 219) Email from NAVFAC HI Red Hill PMO Director to Representative Aaron Ling Johanson Re: Jet Fuel in the water (29 November 2021)
- 220) Email from JBPHH CO Joint Base Message for Distro to Ohana Military Communities and Hickam Communities (29 November 2021)
- 221) DOH press release (29 November 2021)
- 222) CNRH Media Release 21-14 Navy Working with DOH to Resolve Reports of Chemical Odor in Water (29 November 2021)
- 223) CNRH and JBPHH Facebook Posts (20 November – 7 December 2021)
- 224) Email from CNRH to COMPACFLT JBPHH Water Quality Update 11/30 (1 December 2021)

- 225) Email from COMPACFLT DCOM to USARPAC COS 25th ID Potable Water Production Capacity (30 November 2021)
- 226) CNRH Media Release 21-15 Navy Asks Housing Residents to Flush Water Taps Today (30 November 2021)
- 227) CNRH Community Information - JBPHH Update on Water Distribution Mains (30 November 2021)
- 228) CNRH Media Release 21-17, Navy Sets Water Distribution Plan for 1 Dec at Affected Housing, (30 November 2021)
- 229) Email from NAVFAC HI Red Hill PMO Director to (b)(6) Re: JBPHH Water System Map & EAP (1 December 2021)
- 230) CNRH Media Release 21-16, Navy Schedules Town Hall Meetings with Housing Communities (30 November 2021)
- 231) CNRH Community Information, Shower Availability on JBPHH, (30 November 2021)
- 232) Approved Lab List (31 May 2021)
- 233) NOI GW by Well Final Cumulative Data Table
- 234) Email from CNRH to JBPHH CO Re: FW: Bottled Water Planning Effort in Pearl Harbor (1 December 2021)
- 235) Email from (b)(6) to CNRH Web Page Up (1 December 2021)
- 236) CNRH Media Release 21-18 Navy Provides Updates for Military Housing Residents Impacted by Water (1 December 2021)
- 237) CNRH Community Information Updated Shower Availability on JBPHH (1 December 2021)
- 238) NAVFAC HI Red Hill PMO Director email CNIC HQ directs NMCPHC input
- 239) Email from JBPHH Water Quality CAT Team Update 12-01
- 240) Email from USARPAC CG to U.S. Army COS AMR/Red Hill Army Housing Water Issue (1 December 2021)
- 241) JBPHH Water Quality CAT Team Update 12-02
- 242) Interview Summary – CAPT (b)(6) (18 March 2022)
- 243) Interview Summary – CAPT (b)(6) (24 March 2022)
- 244) Email from NAVFAC HI CO to CNRH Fwd: BLUF: Potential source of fuel at Red Hill Shaft (2 December 2021)
- 245) Local News: Rep. Kahele to Armed Services Committee on Red Hill Water Contamination (2 December 2021) Subcommittee on Readiness Hearing, 2 December 2021
- 246) CNRH Media Release 21-19 Virtual Town Hall Meeting on JBPHH Facebook Page (2 December 2021)
- 247) CNRH Media Release 21-20 Navy Detects Petroleum Products in Red Hill Well (2 December 2021)
- 248) CNRH ltr 5090 Ser N45of 3 December 2021
- 249) Email from (b)(6) to PACFLT PAO JBPHH Water Update Page on cpf.navy.mil (3 December 2021)
- 250) CNRH Media Advisory 21-21, Town Hall Meeting (3 December 2021)
- 251) Halawa and Red Hill Shaft Closure 28 Nov 21/3 Dec 21 (19 February 2022)
- 252) CNRH ltr 7220 Ser N00J127 of 3 Dec 2021
- 253) COMNAVREGHINOTE11101 of 23 Dec 21 (Canc: Mar 2022)
- 254) Email from 647th Air Base Group CDR to (b)(6), Facebook Post

(December 2021)

- 255) Email from JBPHH CO to CNRH TLA Execution Plan for Designated Housing Areas Aboard JBPHH (3 December 2021)
- 256) JBPHH TLA Execution Plan
- 257) JCS Daily Report (20 December 2021)
- 258) COMNAVFAC HI email re: hume drain
- 259) CNRH Media Advisory 21-22 Virtual Town Hall Meeting on JBPHH Facebook Page (4 December 2021)
- 260) JBPHH Water Quality CAT Team Update 12-04
- 261) DOH Formal Request for Records (4 December 2021)
- 262) Email from (b)(6) to NAVFAC HI CO FW: Formal Request for Records (4 December 2021)
- 263) Maui Now.com article of 5 Dec 21; Gov. Ige and Hawaii's Congressional Delegation Call for Immediate Suspension of Operations at Red Hill
- 264) Office of Congressman Ed Case Press Release (5 December 2021)
- 265) Email from (b)(6) to (b)(6) Bdition Assistance (6 December 2021)
- 266) CNRH Media Advisory 21-24, NEW LOCATION - Town Hall Meeting at Hokulani Community Center (4 December 2021)
- 267) DOH Dive Skim Plan Approval
- 268) Email from CNRH to Representative Bob McDermott Re: Civilians in Navy Housing (teachers and others qualified) (6 December 2021)
- 269) Email from CNRH to CNSGMP COS FW: Civilians in Navy Housing (teachers and others qualified) (6 December 2021)
- 270) JBPHH Facebook and town hall resident comments 29 November 2021 – 5 December 2021
- 271) BWS News Release Announces Halawa closure (3 December 2021)
- 272) Email from (b)(6) confirming Halawa well sampled 12.5 results 12.8
- 273) DOH Press Release, Petroleum Contamination in Aiea Halawa Shaft, 9 Dec 2021
- 274) Email from (b)(6) to (b)(6) Re: HDOH Split Sampling 12-7-21 (6 December 2021)
- 275) Initial Navy Sampling
- 276) QA Glossary | Environmental Monitoring & Assessment | US EPA
- 277) Email from (b)(6) to (b)(6) Re: Groundwater Sampling Plan for the November 20, 2021 and May 6, 2021 Releases (7 December 2021)
- 278) Fed Fire NFIRS response to flood spill ADIT 3 (6 December 2021)
- 279) Email from (b)(6) to (b)(6) Re: Interview Request RHSI (23 March 2021)
- 280) Joint Health Services JBPHH Water Guidance (5 December 2021)
- 281) Email from (b)(6) to (b)(6) NOI Acknowledgment - Case No 20211120-2330 (5 December 2021)
- 282) CNRH Media Advisory 21-25, SECNAV and CNO Press Engagement (5 December 2021)
- 283) JBPHH Water Quality Update 12-6
- 284) DOH Defueling Emergency Order (6 December 2021)
- 285) Email from NAVFAC HI CO to CNRH ROC Fingerprint pint of fuel (7 December 2021)

- 286) GSI Environmental Finger Analysis of Samples from Sump (11-24-2021), Adit 3 (11-24-2021) and Red Hill Shaft Water Gallery (12-2-2021) (29 December 2021)
- 287) Email from (b)(6) to (b)(6) Subj: RESPONSE TO DOH FORMAL REQUEST FOR RECORDS, RED HILL BULK FUEL STORAGE FACILITY, JBPHH, OAHU, DOD FACILITY ID NO. 9-102271 (7 December 2021)
- 288) JBPHH Claims Website Screen Shot
- 289) Code 15 claims packages (23 February 2022)
- 290) C700 Org Chart (complete) (4 April 2022)
- 291) Email from CDR (b)(6) to CAPT (b)(6) Re: FLC-PH Mil Billets (7 April 14, 2022)
- 292) Email from CAPT (b)(6) to (b)(6) Re: Approved FTE 2008-present for FLC-PH Fuels Department (6 April 2022)
- 293) Interview Summary - (b)(6) (5 April 2022)
- 294) Interview Summary - (b)(6) (5 April 2022)
- 295) Interview Summary - (b)(6) (1 April 2022)
- 296) Interview Summary - (b)(6) (29 March 2022)
- 297) Interview Summary - (b)(6) (23 March 2022)
- 298) Email from (b)(6) to CAPT (b)(6) FW: Ech 3 process of requesting additional billets (29 March 2022)
- 299) Email from (b)(6) to CAPT (b)(6) Re: Follow-up call (1 April 2022)
- 300) Email from (b)(6) to CAPT (b)(6) Re: Follow up call (31 March 2022)
- 301) Email from (b)(6) RE SMRD RFI (6 April 2022)
- 302) CNO memo of 14 October 1986
- 303) OPNAVINST 1000.16L CH-3 - Navy Total Force Manpower Policies and Procedures (2 July 2021)
- 304) NAVMAC ltr 5310 Ser 00051 of 1 January 2021
- 305) Email from DLA Energy East Pacific COM to CAPT (b)(6) Re: DLA-E guidance on manning (13 April 2022)
- 306) DELETED
- 307) (b)(6) ltr of 6 Jan 2022 Subj: Pearl Harbor Fuels A-76 Study Summary
- 308) Email from (b)(6) to (b)(6) Re: Manning Requests (4 April 2022)
- 309) Interview Summary - (b)(6) (23 March 2022)
- 310) High Performing Organization Business Process Reengineering outbrief PPT (NAVSUP February 2009)
- 311) JB Hickam - FLCPH merger (3 February 2011)
- 312) Email from (b)(6) to (b)(6) Re: Quick Question (1 December 2021)
- 313) Interview Summary - (b)(6) (18 Mar 2022)
- 314) Rightsizing FLC-PH Background paper (12 March 2022)
- 315) C700 Org Chart (4 January 2021)
- 316) Email from (b)(6) to (b)(6) - Labor Overage Issue (13 January 2021)
- 317) Email from (b)(6) to CAPT (b)(6) - NAVSUP approval process


- for FTE increases (6 April 2022)
- 318) C700 Org Chart (22 November 2021)
 - 319) Email from FLC PH CO to (b)(6) FW: FLC Pearl Harbor SMRD Study (10 March 2022)
 - 320) Email from NAVSUP HI XO to FLC PH CO Subj: UPDATE NAVSUP Enterprise Code 700 vacancy and manning information in support of NAVSUP Commander Congressional Testimony (35FTE) (31 December 2021)
 - 321) Email from FLC Pearl Harbor Regarding SMRD Response (7 January 2022)
 - 322) FLC Pearl Harbor Fuels Department Manning Request (31 December 2021)
 - 323) Email from FLC Pearl Harbor Regarding FLC Pearl Harbor Manpower Responses (9 January 2022)
 - 324) NAVSUP FLC Fuels manning levels vacancies and proposed increases revised (27 January 2022)
 - 325) CAPT Albert Hornyak emails re 17_36FTE increase
 - 326) CAPT Albert Hornyak Get Real Get Better brief
 - 327) Email from NAVMAC CO to N13 re SMRD query
 - 328) AFFF System Requirement (DD 1391)
 - 329) Previous Fire Suppression System
 - 330) Insynergy Inc. Basis of Design (October 2014)
 - 331) Email (b)(6), P-1551 Red Hill - Additional Technical Information on PVC piping and 1391 (23 June 2017)
 - 332) Interview Summary – (b)(6) (29 March 2022)
 - 333) RFI 69.1 - Elevation Conflict at AFFF Waste Line Between Sump and Tank
 - 334) AFFF Change Discussion #4 - DLA counter to NAVFAC PAC Concur
 - 335) AFFF System Design Drawing #1
 - 336) UFC 3-600-01 section 9-9
 - 337) UFC 3-460-01 section 2-14
 - 338) Questions & Answers (31 December 2014)
 - 339) Section 21 13 13.00 20 WET PIPE SPRINKLER SYSTEM, FIRE PROTECTION
 - 340) SECTION 21 13 24.00 10 AQUEOUS FILM FORMING FOAM (AFFF) FIRE PROTECTION SYSTEM (Amended)
 - 341) AFFF Change Discussion #1 - Initial to NPO concur
 - 342) Contract N62742-11-D-005 T.O. 0010, P-1151 Upgrade Fire Suppression and Ventilation Systems (A-E contract with Insynergy Inc.)
 - 343) Contract Award N62742-15-C-1308, FY15 MCON P-1551 UPGRADE FIRE SUPPRESSION & VENTILATION SYSTEM, RED HILL, JBPHH, awarded to Hensel Phelps Construction Company (HPCC)(25 August 2015)
 - 344) HPCC construction schedule (31 May 2017)
 - 345) RFI 0006 Stainless Steel Jacket Containment Piping Clarification (28 October 2015)
 - 346) Email: (b)(6) fw: [PM_MAIL] [CONTRACT N62742-15- C-1308, FY15 P-1551 UPGRADES TO RED HILL FUEL STORAGE FACIL] Request For Information: 0006 Stainless Steel Jacket Containment Piping Clarification (15 December 2015)
 - 347) Johnson Controls Field Service Report on Red Hill (21 December 2017)
 - 348) Interview Summary – (b)(6) (13 June 2017)
 - 349) Material Submittal 0001-22 00 00-0001-0 Plumbing, General Purpose
 - 350) RFI O 119 AFFF Retention Line Clarifications (10 August 2016)

- 351) Email (b)(6) fw N62742-15-C-1308 MILCON P-1551-RFI-0006 – Stainless Steel Jacket Containment
- 352) Email (b)(6) re P-1551 SAES (22 June 2017)
- 353) HPCC letter to Government (13 March 2017)
- 354) RFI 69.1 – Low Point Design and Initial Drain Proposal
- 355) AFFF PVC – NAVFAC PAC & CNRH Notification
- 356) AFFF Waste System Commissioning Test
- 357) AFFF Change Discussion #2 - DLA proposal (no steel)
- 358) AFFF System Acceptance and Maintenance Start
- 359) AFFF Change Discussion #3 - NAVFAC Discussion of DLA counter-proposal
- 360) AFFF Change Discussion #4 - DLA counter to NAVFAC PAC Concur
- 361) O&M handoff email
- 362) Change R Detailed Times
- 363) Request for AFFF waste system maintenance
- 364) No 2nd Commissioning and some pumps seized
- 365) FLC PH accepts O&M manuals
- 366) AFFF System Real Property Acceptance (DD 1354)
- 367) First AFFF Sump Pump Test – (December 2021)
- 368) B-1.6.11 NAVFAC Red Zone
- 369) No Red Zone Checklists Email
- 370) Only Red Zone Meeting Minutes
- 371) EPA PFAS Risk Management
- 372) MIL-PRF-24385F(2)
- 373) DODD 5101.08E DOD EXECUTIVE AGENT (DOD EA) FOR BULK PETROLEUM
- 374) Interview Summary – BGen Jimmy Canlas (21 March 2022)
- 375) Interview Summary – CAPT (b)(6) and (b)(6) (23 March 2022)
- 376) DLA and NAVSUP MORA on Funding of Fuel Terminal Operations 22 December 2015
- 377) CNIC and NAVSUP MOA on Management of Navy Bulk Fuel Facilities 30 April 2015
- 378) DLA, NAVFAC and NAVSUP MOA on Roles and Responsibilities for POL Facilities Sustainment, Restoration and Modernization 30 June 2016
- 379) NAVFAC and NAVSUP MOA on RPE 23 August 2017
- 380) Interview Summary – (b)(6) 23 March 2022
- 381) Interview Summary – LT (b)(6)
- 382) DELETED
- 383) Emails from VADM Lindsey, RADM Stamatopoulos, and RADM Korka of March 2022
- 384) Interview Summary – (b)(6)
- 385) Interview Summary – (b)(6)
- 386) CNRH ICS training records
- 387) FLC does not have ICS training pdf
- 388) JBPHH Appendix For Spill Response EOC – Environmental Pollution or Contamination of 23 August 2010
- 389) Email from (b)(6) 1 April 2022
- 390) Email from (b)(6) ICO Red Hill Fire Suppression System Maintenance
- 391) Failed pump tests
- 392) JBPHH Contamination Appendix

- 393) PREP TRNG SCHED 1-14
- 394) Red Hill Original Technical Drawing
- 395) Email from (b)(6) GWPP update
- 396) Email from FLC Pearl Harbor Regarding CCTV Footage – No video footage from 6 May 2021 or 20 November 2021
- 397) Email from FLC Pearl Harbor Regarding NIWC Pacific Statement of Work for C700 CCTV Cameras (23 November 2021)
- 398) CNICINST 5090.4A
- 399) OPNAVINST 3440.17
- 400) OPNAVINST 11320.23G
- 401) OPNAVINST 11014.3
- 402) OPNAVINST 4020.27
- 403) U.S. Navy regulations
- 404) Interview Summary – RDML Christopher Cavanaugh (23 March 2022)
- 405) OPNAV M-5090.1
- 406) COMNAVREGHINST 3120.2D 9 Mar 2018398) CNICINST 5090.4A
- 407) Property Record Card Updates
- 408) Email RE FOR APPROVAL RED HILL COMMAND INVESTIGATION
- 409) Interview Summary – (b)(6) 21 Mar 22 (Second interview that day)
- 410) Email RE: Discussion on Possible Release 15 April 22

PAGE INTENTIONALLY LEFT BLANK

State & Congressional Stakeholders Federal & State Regulators

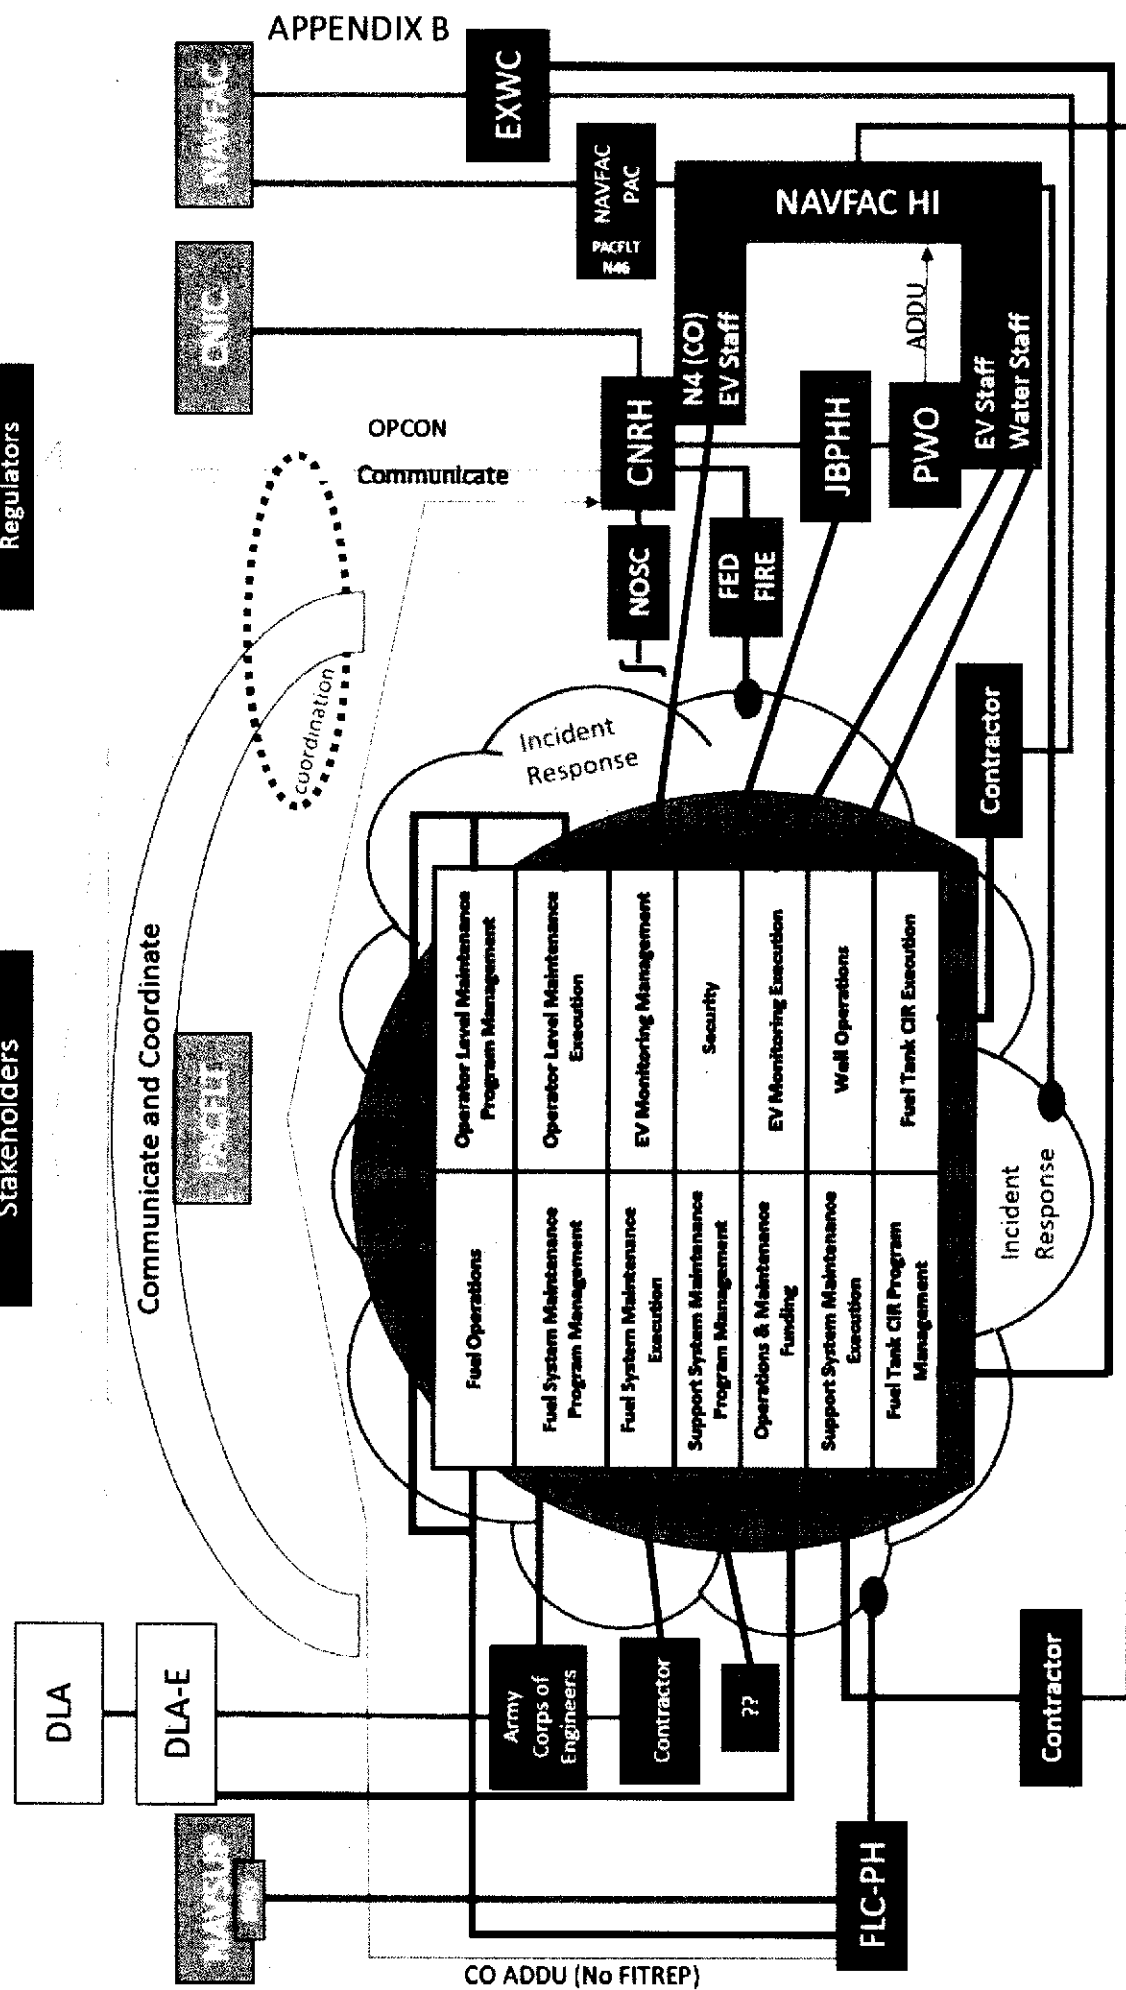

PAGE INTENTIONALLY LEFT BLANK

APPENDIX C (Updated 6 Apr 22)

Quantities of Fuel Spilled, Recovered, and Potentially Released to the Environment

Total Fuel Spilled, Recovered, and Missing on 6 May

On 6 May 2021, Red Hill operators improperly executed a fuel transfer procedure, resulting in two piping joint ruptures and a subsequent JP-5 fuel spill. Although unknown at the time, a fire suppression system sump pump transferred most of the fuel into a retention line, where it remained until 20 November 2021.

• Fuel lost from tank 12 between rupture and tank isolation	19,866 gal
• Fuel spilled from lateral pipes connecting tanks 17/18 and 19/20, based on pipe volumes ¹	2,729 gal
• Fuel “repacked” into the pipeline to fill the void drawn prior to the rupture, equal to surge tank 2 level increase prior to the incident	(1,638) gal
Total quantity of fuel spilled on 6 May 2021²	20,957 gal

• Fuel recovered from sumps and recovery tank 311	1,230 gal
• Fuel absorbed in cleanup materials	350 gal
Total quantity of fuel recovered immediately after 6 May 2021	1,580 gal

The quantity of fuel released to the environment on 6 May 2021 cannot be calculated, but is assessed to be small. In addition to some evaporation, potential pathways to the environment in the area of the spill are three soil vapor monitoring ports in the upper tank gallery and approximately six imperfections in the concrete. The following calculations assume all unrecovered fuel from 6 May 2021 was transferred to the fire suppression system.

• Fuel spilled on 6 May 2021 ³	20,957 gal
• Fuel recovered immediately after 6 May 2021	(1,580) gal
Maximum quantity of fuel transferred to the fire suppression system⁴	19,377 gal

Total Fuel Spilled and Recovered Since 20 November

On 20 November 2021, the Red Hill rover inadvertently struck the fire suppression system retention line drain valve with the passenger cart of a train, cracking the PVC pipe near Adit 3. Although not known at the time, this retention line contained JP-5 fuel from the 6 May 2021 spill. The following quantities of fuel were recovered immediately after 20 November 2021.

• Fuel recovered by vacuum trucks	10,757 gal
• Fuel recovered from Adit 3 groundwater sump pump discharge line	1,134 gal
• Fuel recovered from flushing of fuel oil recovery facility sump line	420 gal
Total quantity of fuel recovered immediately after 20 November 2021	12,311 gal

¹ Updated to reflect the actual installed field measurements of the JP5 pipeline. Previous volume was 351 gallons. Update reflects a net increase of 2,378 gallons. *Austin Brockenbrough and Associates, LLC*, independently verified this amount on 28 Mar 22.

² Updated to reflect the additional 2,378 gallons described in Footnote 1.

³ Updated to reflect the additional 2,378 gallons described in Footnote 1.

⁴ Updated to reflect the additional 2,378 gallons described in Footnote 1.

Following the 20 November 2021 spill, FLC Pearl Harbor drained fuel remaining in the fire suppression system retention line. At the time of this report, the line has not been flushed, which may recover some additional fuel.

• Fuel recovered from main sump following pumping from retention line	428 gal
• Fuel recovered from retention line low point drains	415 gal
• Fuel recovered from retention line manifolds ⁵	146 gal
<i>Total quantity of fuel recovered from fire suppression system retention line</i>	<i>989 gal</i>

Beginning in December, FLC Pearl Harbor and other organizations continued to recover fuel as it was discovered.

• Fuel recovered from Adit 3 groundwater sump discharge holding tank	235 gal
• Fuel recovered from Red Hill well water surface ⁶	152 gal
• Fuel recovered from CHT Sump ⁷	148 gal
<i>Total quantity of fuel recovered from additional locations</i>	<i>535 gal</i>

Total Fuel Spilled, Recovered, and Unaccounted for Since 6 May

Below is a summary of the total quantities of fuel recovered since 6 May 2021 compared to the quantity spilled. A total of 5,542 gallons of fuel remain unaccounted for, and some or all of that fuel contaminated the Red Hill well and Navy water distribution system.

• Total quantity of fuel recovered immediately after 6 May 2021	1,580 gal
• Total quantity of fuel recovered immediately after 20 November 2021	12,311 gal
• Total quantity of fuel recovered from fire suppression system retention line ⁸	989 gal
• Total quantity of fuel recovered from additional locations ⁹	535 gal
<i>Total quantity of fuel recovered since 6 May 2021¹⁰</i>	<i>15,415 gal</i>
• Total fuel spilled on 6 May 2021	20,957 gal
• Total fuel recovered since 6 May 2021	(15,415) gal
Total quantity of fuel that remains unrecovered¹¹	5,542 gal

⁵ Amount added since the Original Appendix C of 14 Jan 22.

⁶ Updated to reflect amount recovered from Red Hill well water surface (Original Appendix C of 14 Jan 22 reflected 140 gallons of fuel recovered from the Red Hill well shaft via skimmer pumps).

⁷ On 6-7 December, heavy rains flooded the Red Hill tunnel near Adit 3. This resulted in a fuel and water mixture that was collected in the CHT sump. The CHT sump pump automatically pumped the fluid to a holding tank outside Adit 3, where it was subsequently recovered.

⁸ Updated to reflect the additional 146 gallons in Footnote 5.

⁹ Updated to reflect the additional 12 gallons in Footnote 6.

¹⁰ Updated to reflect additional 158 gallons in Footnotes 5 and 6.

¹¹ Updated to reflect the difference between Footnote 3 and Footnote 10. This update reflects a net increase of 2,220 gallons from the 3,322 gallons in the Original Appendix C of 14 Jan 22.

20-Nov	~1650L	November Spill	
	2345L	Regulators	The acting CNRH Environmental Director called DOH to report fuel/water spill [Encls (159), (173), (174)]
21-Nov		Government Leaders	CNRH COS made notification to CODEL staffs, Governor, LT Governor, and other state representatives regarding spill and actions taken Done at the request of PACFLT GA who was on leave on the mainland [Encls (108), (175), (178)]
	1618L	General Public	CNRH Media Release: Water and fuel mixture release from fire suppression drain line at Red Hill No signs or indication of any release to the environment and the drinking water remains safe to drink [Encls (34), (74), (182)]
	1645L	HHQ	FLC PH OPREP-3 Navy Blue: Reports spill All released fluid was contained in the lower tunnel No known fluid was released to the environment No impact to mission [Encl (183)]
22-Nov	Morning	Government Leaders	CNRH provided an in-person brief to Rep Kabele and Rep Case, along with their staffs, regarding the spill and also provided a tour of Red Hill [Encl (187)]
	1330L - 1530L	Regulators	FLC PH staff confirmed to DOH that there was no sheen on the Halawa stream and NAVFAC HI confirmed no fuel in the well pump room during DOH site visit to Red Hill [Encl (189)]
	1601L	General Public	CNRH Media Release: Red Hill Fuel tanks and main fuel pipelines are secure There are no signs or indication of any releases to the environment and the drinking water remains safe [Encl (190)]
23-Nov		Government Leaders	PACFLT COM called Sen Hirono to brief her on the spill at Red Hill and advised that he directed an investigation [Encl (196)]
24-Nov		Regulators	CNRH received from DOH a Notice of Interest (NOI) in a Release or Threatened Release of Hazardous Substances for the 20 November spill The NOI included requirements for additional sampling and development of work plans to remediate the area, among other items [Encls (199), (200)]
27-Nov	1830L	Military Housing Residents	JBPHH PWD help desk received the first phone call from a resident of Moanalua Terrace complaining of a chemical smell in their water There is no indication that action was taken beyond logging it This is the earliest report of the issue [Encls (194), (202), (203)]
28-Nov	0749L	Military Housing Residents	JBPHH PWD help desk started receiving phone calls from JBPHH housing residents complaining of a chemical/fuel smell in their water These continued throughout the day for a total of 37 calls [Encls (10), (194), (202), (206), (207)]
	1930L	Red Hill Well Secured	
	2133L	General Public	CNRH Media Release: Navy investigating reports of a chemical smell in drinking water from some residences There was no immediate indication that the water was not safe Navy continuing to test water, visit homes, and investigate the drinking wells [Encl (212)]
	2138L	Military Housing Residents	JBPHH FB Post: Navy is investigating reports of a chemical smell in drinking water at several homes in some of the military housing areas for JBPHH Sunday evening There is no immediate indication that the water is not safe Navy continues to investigate reports and is testing the water [Encl (223)]
29-Nov		Regulators	CNRH discussed reports of fuel/chemical smell in Army housing with DOH Deputy Director DOH notifies CNRH of intent to advise all Navy water system users to avoid using the water for drinking, cooking, or oral hygiene [Encl (175)]
		Regulators	CNRH e-mailed a sampling plan to DOH in response to the 24 Nov DOH Notice of intent [Encls (199), (200)]
		Regulators	NAVFAC shared negative water test results with DOH for samples taken on 28 Nov NAVFAC also provided water from those same samples [Encls (44), (124), (213)]
		Military Housing Residents	Throughout the day, resident social media posts regarding smells of fuel in the water increased [Encl (175)]
		CNRH PA took the lead for Navy communications with media [Encls (34), (191), (217)]	
	1200L	Regulators	PACFLT DCOM called DOH Deputy Director to provide information on the situation and offered to provide Navy data and requested data regarding Army housing complaints from DOH DCOM attempted, unsuccessfully, to coordinate a joint press release through the afternoon [Encl (11)]
	1204L	Government Leaders	Acting CNRH Environmental Director responded to e-mail from State Rep Johansen that the Navy is aware of the base housing water quality issue and is taking samples for analysis [Encl (219)]
	1250L	Military Housing Residents	JBPHH CO released a statement via PPV housing portal that there are no immediate indications that the water is not safe, and that he and his staff are drinking the base water [Encl (35), (220)]
	1408L	General Public	PACFLT Media Release: Reports that on 22 Nov 21, PACFLT COM ordered an investigation into the spills at Red Hill [Encl (408)]
	1900L	DOH press release recommending all Navy water system users avoid using the water for drinking, cooking, or oral hygiene [Encl	

	2026L	General Public	CNRH Media Release: The Navy is working with HI DOH to resolve reports of chemical odors in the water at affected military housing at JBPHH. Recommends avoiding ingestion if odors are present [Encl (222)]
	2031L	Military Housing Residents	JBPHH FB Post: DOH and Navy tested water -- no measurable quantities of fuel found. Navy pursuing additional, stringent testing. [Encl (223)]
30-Nov	0901L/0902L	Military Housing Residents	JBPHH/CNRH FB Post: Joint Base Pearl Harbor-Hickam Emergency Operations Center has stood up an information cell to receive calls from residents in military housing who have concerns about their water. [Encl (223)]
	Morning	Government Leaders	CNRH conducted a phone call with Hawaii Lieutenant Governor Josh Green, updating him on actions being taken. Dr. Green expressed his support and offered assistance if needed. [Encls (175), (224)]
		Government Leaders	CNRH provided updates to Representative Kaele and Honolulu Mayor Blangiardi. [Encls (175), (224)]
	1414L	General Public	CNRH Media Release: JBPHH housing residents are asked to flush their water systems as the Navy continues to test water samples. No detection of petroleum constituents in initial test sampling, residual contamination may exist. [Encls (226), (227)]
	1448L	Military Housing Residents	CNRH update emailed to housing portal reps and ombudsmen on the flushing of the water distribution mains and request for residents to flush their individual household lines. No detection of petroleum constituents in initial sampling. [Encls (226), (227)]
	1448L/1449L	Military Housing Residents	CNRH/JBPHH FB Post: Primary water distribution mains associated with the housing areas affected by possible potable water contamination have been flushed twice and the third flush is ongoing. No petroleum detected, residual contamination remains concern. [Encls (226), (227)]
		Regulators	Acting CNRH Environmental Director sent DOH the water system map, emergency action plan, and groundwater protection plan. [Encl (229)]
	1615L	General Public	CNRH Media Release: Town halls are scheduled at Hickam Theater, Moanalua Terrace Community Center and Halesey Terrace Community Center for affected housing communities on JBPHH. [Encls (175), (224), (230)]
	1621L/1624L	Military Housing Residents	CNRH/JBPHH FB Post: Navy is holding four town hall meetings at 1900 30 Nov, with affected housing communities to provide up-to-date information and answer questions regarding the ongoing water issue identified at several military housing areas. [Encl (223)]
	1800L	Military Housing Residents	Town hall for Ombudsmen/Key Spouses at Hickam Theater. JBPHH Deputy (USAF Col) participates. Communicate what the Navy knew about the water problems and what actions were being taken. Listen to concerns and answer questions. [Encls (175), (224), (230)]
	1900L	Military Housing Residents	Town hall for Hickam Housing Community at Hickam Theater. JBPHH Deputy (USAF Col) participates. Communicate what the Navy knew about the water problems and what actions were being taken. Listen to concerns and answer questions. [Encls (175), (224), (230)]
	1900L	Military Housing Residents	Town hall for Halesey Terrace, Radford, Calfin Housing Community residents at Halesey Terrace Community Center. PACFLT DCOM and JBPHH CO participate. Communicate what the Navy knew about the water problems and what actions were being taken. Listen to concerns and answer questions. [Encls (175), (224), (230)]
	1900L	Military Housing Residents	Town hall for Moanalua Terrace Housing Community residents at Moanalua Terrace Community Center. CNRH and NAVFAC HI CO participate. Communicate what the Navy knew about the water problems and what actions were being taken. Listen to concerns and answer questions. [Encls (175), (224), (230)]
	1915L	Military Housing Residents	JBPHH FB Post: Moanalua Terrace Community town hall FB livestream and recording of town hall. [Encl (223)]
	2200L	General Public	CNRH Media Release: Water distribution plan set for December 1st at affected base housing. [Encls (175), (224), (228)]
	2246L	Military Housing Residents	CNRH FB Post: Navy is providing sources of clean water for the communities in need. The Navy will continue to set up several water distribution sites for residents of base housing. [Encls (175), (223), (228)]
	2345L	Military Housing Residents	CNRH listing of available shower locations and times on JBPHH. [Encl (237)]
	2345L	Military Housing Residents	JBPHH FB Post: Showers are available at JBPHH for those at affected military housing who have concerns with the water quality at their residences. Locations and times included. [Encl (223)]
		Regulators	DOH and EPA representatives join the PACFLT CAT. [Encls (210), (214), (239)]
	0748L	Military Housing Residents	JBPHH FB Post: JBPHH Emergency Operations Center has established an information cell to receive calls from residents in military housing who have concerns about their water. Numbers provided. [Encl (223)]
	1334L	Military Housing Residents	CNRH PA launched the JBPHH Water Resources and Updates webpage, which was available through both CNRH and JBPHH web sites. [Encl (235)]
	1556L	General Public	CNRH Media Release: Provided information regarding an upcoming Army town hall, the JBPHH EOC phone numbers, a new information web page, and availability of potable water trucks. [Encl (236)]
	1603L	Military Housing Residents	CNRH FB Post: Showers are available at JBPHH for those in affected military housing who have concerns with the water quality at their residences have been expanded. Updated available locations and times included in post. [Encl (223)]

1-Dec	1603L	Military Housing Residents	CNRH updated listing of available shower locations and times on JBPHH [Encl (236)]
	1610L	Military Housing Residents	JBPHH FB Post: Army is hosting a town hall meeting for residents of the Aliamanu Military Reservation (AMR) housing at the AMR Chapel and has already notified residents [Encl (223)]
	1613L	Military Housing Residents	CNRH FB Post: Potable water trucks will be available for water at various locations for individuals in impacted communities. Locations provided in post [Encl (223)]
	1800L	Military Housing Residents	CNRH/JBPHH FB Posts: Navy has built a new web page with information, resources and updates. It will be updated continuously with new information. It can be accessed from either the Navy Region Hawaii or Joint Base Pearl Harbor-Hickam pages [Encls (223), (235)]
	1808L	Military Housing Residents	JBPHH FB Post: Shower availability on Fort Shafter, Helemano Military Reservation, Schofield Barracks and Tripler Army Medical Center for anyone concerned with water quality [Encl (223)]
	1900L	Military Housing Residents	Town hall for AMR housing residents at AMR chapel. A/ASN (E, I & E), PACFLT COM, PACFLT DCOM, CNRH and JBPHH CO and the Army Garrison Commander participate. Communicate what the Navy knew about the water problems and what actions were being taken. Listen to concerns and answer questions [Encl (239)]
2-Dec			Army issues evacuation order for Army personnel in affected housing [Encls (175), (241)]
		Government Leaders	During a HASC hearing, VADM Williamson (OPNAV N4) briefed Rep. Kaele and answered questions regarding the Navy's response at Red Hill [Encl (245)]
		Government Leaders	PACFLT COM contacted Mayor Blangiardi and updated him on the situation [Encl (241)]
	1505L/1527L	Military Housing Residents	JBPHH/CNRH FB Posts: Military & Family Support Center has established Emergency Family Assistance Center to assist any affected personnel who need help to include medical assistance. Phone number and location provided [Encl (223)]
	1656L	Military Housing Residents	JBPHH FB Post: Virtual town hall will begin shortly [Encl (223)]
	1735	Military Housing Residents	JBPHH FB Post: CNRH virtual town hall scheduled on JBPHH Facebook page at 1900 [Encl (223)]
	1814L	General Public	CNRH Media Advisory: Virtual town hall scheduled on JBPHH Facebook page at 1900 [Encl (246)]
	1900L	Military Housing Residents	Virtual town hall via Facebook Live. PACFLT DCOM, NAVFAC PAC, CHRH, PACFLT Surgeon and NAVFAC HI CO participate. Communicate what the Navy knew about the water problems and what actions were being taken. Listen to concerns and answer questions (https://www.PACFLT.navy.mil/JBPHH-Water-Updates/Town-Halls-Daily-Updates/)
	1902L	Military Housing Residents	JBPHH FB Post: Virtual Town Hall recording [Encl (223)]
	2204L	General Public	CNRH Media Release: Petroleum products detected in Red Hill well, below DOH action levels. The well was isolated since 28 Nov 21. Waiawa well's water quality remains safe [Encl (247)]
3-Dec	2215L/2226L	Military Housing Residents	JBPHH/CNRH FB Posts: Petroleum products detected in Red Hill well, below DOH action levels. The well was isolated since 11/28/2021. Waiawa well's water quality remains safe [Encl (223)]
	1002L/1008L	Military Housing Residents	JBPHH/CNRH FB Posts: Tricare beneficiaries can call the Tricare Nurse Advice line, send a message to their provider via the MHS Genesys Patient Portal or go to any ER in the event of an emergency. Family members can be seen at any urgent care without a referral if the clinic accepts Tricare. Advice line number provided [Encl (223)]
		Regulators	CNRH provided a letter to DOH confirming the release of approximately 14,000 gallons of a mix of water and fuel at Red Hill BFSF on 20 Nov 2021 [Encl (248)]
		Regulators	DOH ordered that diving and flushing at the Red Hill well stop [Encls (47), (257)]
		Government Leaders	PACFLT COM provided in-person brief to Rep. Case and phone updates to HI Governor, Sen. Hirono, Sen. Schatz, Rep. Kaele, and Sen. Couchee [Encl (210)]
		Government Leaders	PACFLT COM provided an e-mail update to the Governor, to include water test sampling results [Encl (241)]
	1359L/1400L	Military Housing Residents	JBPHH/CNRH FB Posts: Navy will be hosting town hall tonight at 7-8 p.m. at the Hickam Theater to provide up-to-date info about ongoing water issue. The town hall will be shared on JBPHH FB page [Encl (223)]
	1636L	General Public	CNRH Media Advisory: Town hall scheduled for 1900 at Hickam Theater [Encl (250)]
	1700L	Military Housing Residents	JBPHH/CNRH FB Posts: CNRH has determined TLA is necessary for service members and their dependents, and civilians living in housing affected by the current water-related health or safety concerns. The date range is 3-12 Dec and communities are listed in post [Encl (223)]
	1701L	Military Housing Residents	JBPHH webpage updated to reflect CNRH order to use TLA funding for affected service member and dependent residents. Affected DoD civilian employees and their dependents will be provided separate travel orders [Encls (175), (252), (254), (255), (256)]
	~1900	Military Housing Residents	PACFLT launched the JBPHH Water updates web page that replaced the Region webpage for sharing information

4-Dec	1900L	Military Housing Residents	Town hall at Hickam Theater PACFLT DCOM, CNRH, JBPBH CO, PACFLT Surgeon and NAVFAC HI CO participate Intended to provide latest updates and answer questions [Encl (250)]
	1901L	Military Housing Residents	JBPBH FB Post Hickam Theater town hall FB live stream and recording to provide latest updates and answer questions [Encl (223)]
	2130L & 2131L	Military Housing Residents	JBPBH/CNRH FB Posts: Navy will be hosting a virtual town hall meeting on the JBPBH Facebook page tomorrow, Dec 4, from 11 a m to noon to provide up-to-date information about the ongoing water issue Please email questions to cnrhpa@gmail.com [Encl (223)]
	0753L	Military Housing Residents	JBPBH FB Post: Navy will be hosting a virtual town hall meeting on the JBPBH FB page from 11 a m to noon today to provide up-to-date information about the ongoing water issue Please email questions to cnrhpa@gmail.com [Encl (223)]
	0800L	General Public	CNRH Media Advisory: Virtual town hall scheduled on JBPBH Facebook page at 1100 [Encl (259)]
		Regulators	CNRH received a formal Request for Records from DOH requesting sampling plans, data, methodology, and analytical reports The request applied to future records generated as well [Encls (261), (262)]
	1025L	Military Housing Residents	JBPBH FB Post: Additional shower and laundry facilities are available at Halsey Terrace for those who have concerns with the water quality in their residence [Encl (223)]
	1049L	Military Housing Residents	JBPBH FB Post: Virtual town hall FB Live feed begins in order to provide latest updates and answer questions [Encl (223)]
	1100L	Military Housing Residents	Virtual town hall on JBPBH Facebook Live PACFLT DCOM, CNRH, PACFLT Surgeon and NAVFAC HI CO participate Provides the latest updates on the water crisis [Encl (223)]
	1850L	Military Housing Residents	JBPBH FB Post: CNRH has determined lodging procurement is necessary for active duty service members, their dependents, Federal civilian employees and their authorized dependents and all other privatized housing residents affected by the current water-related health and safety concerns Web page with info on lodging assistance and TLA info included in post (https://www.PACFLT.navy.mil/JBPBH-Water-Updates/) [Encl (223)]
	1859L	General Public	CNRH Media Advisory: Town hall scheduled for 5 Dec at 1500 at Moanalua Terrace Community Center [Encl (223)]
	2001L	Military Housing Residents	CNRH FB Post: CNRH released updated lodging procurement guidance for all privatized housing residents affected by current water-related health and safety concerns [Encl (223)]
	2008L	Military Housing Residents	CNRH FB Post: Additional shower and laundry facilities are available at Halsey Terrace for those who have concerns with the water quality in their residence [Encl (223)]
	2016L	Military Housing Residents	JBPBH FB Post: Town hall location updated to Hukulani Community Center for 5 Dec at 1500 Town Hall [Encl (223)]
			Governor Ige and Hawaii's Congressional Delegation call for suspension of Red Hill operations [Encls (263), (264)]
		Government Leaders	SECNAV met with Representatives Courtney, Garamendi, and Kakele regarding the contamination of the water from Red Hill [Encl (210)]
		Government Leaders	CNRH PAO provided information to Representative Johanson via e-mail regarding how to best advise citizens seeking immediate relief/recourse at his request (TLA, temporary duty orders and government contracted lodging information) [Encl (265)]
		Government Leaders	Senator Glenn Wakai requested from the CNRH PAO a graphic of Red Hill BFSF showing how fuel is moved from the facility NAVFAC HI Red Hill PMO was tasked to provide [Encl (265)]
5-Dec		Regulators	CNRH sent a letter to DOH acknowledging receipt of the 24 November Notice of Interest and expressing the intent to continue communication and coordination with DOH [Encl (281)]
	1116L	General Public	CNRH Media Advisory: Town hall scheduled for 05 December at 1500 updated location to Kokulani Community Center [Encl (266)]
	1119L/1129L	Military Housing Residents	JBPBH/CNRH FB Posts: Navy will host an in person Town Hall meeting today from 3-4 p m at the Hukulani Community Center to provide up-to-date information about the ongoing water issue to those who have been impacted Location updated in post [Encl (223)]
	1448L	Military Housing Residents	JBPBH FB Post: JBPBH CO apologized for the comments he made in his 19 November assurance to families that the drinking water was safe [Encl (223)]
	1450L	Military Housing Residents	JBPBH FB Post: Hukulani Community Center Town Hall FB Live feed begins in order to provide latest updates and answer questions [Encl (223)]
	1500L - 2000L	Military Housing Residents	Town hall at Hukulani Community Center SECNAV, CNO, PACFLT DCOM, CNRH, PACFLT Surgeon and NAVFAC HI CO participate Provide updates, answer questions and engage with residents /Lasts ~5 hours [Encls (175), (266)]
		Military Housing Residents	Throughout the week of 29 November housing residents provided comments on the JBPBH Facebook page and made comments at the town halls reflecting concerns and frustrations with the water situation and response [Encl (270)]
		Regulators	CNRH received approval from DOH for divers to enter the Red Hill well DOH subsequently ordered that diving stop on 8 December until a recovery plan was renegotiated Permission was granted to continue on 9 December [Encls (46), (47), (267)]
		Regulators	The Interagency Drinking Water System Team (IDWST) stood up and included representatives from DOH and EPA [Encl (46)]

	1913L/1918L	Military Housing Residents	JBPHH/CNRH FB Posts: JBPHH MWR to provide free Grab-and-Go Lunch, Family Activities for service members and their dependents, DoD civilian employees and retirees living in military housing impacted by the water issue. Locations and weekday and weekend hours included in post [Encl (223)]
	1947L	Government Leaders	CNRH engaged with Rep. McDermott, who raised the concern that qualified civilians who live in some affected off base housing have no point of contact for temporary lodging and assistance. CNRH advised that they were working to resolve the issue [Encl (268)]
	1957L/1958L	Military Housing Residents	JBPHH/CNRH FB Posts: JBPHH Military and Family Support Center have licensed clinical counselors and chaplains available at the Emergency Family Assistance Center to assist anyone in need. Location, hours and phone number in post [Encl (223)]
6-Dec	2004L	General Public	CNRH Media Advisory: SECNAV and CNO Media engagement scheduled for 06 December at 1330. Both leaders are in Pearl Harbor to see Red Hill first hand and meet with affected residents as well as local officials [Encl (282)]
	2209L	Military Housing Residents	JBPHH FB Post: Government procured quarters still available for all those residing in JBPHH PPV communities regardless of affiliation who are seeking lodging due to water quality supply issues. Website and email address for Hotel and Data request form options included in post [Encl (223)]
	1227L/1229L	Military Housing Residents	JBPHH/CNRH FB Posts: No scheduled Town Hall meetings today for JBPHH and CNRH. Dates and times of additional meetings will be posted as they become available. The USAF leadership on JBPHH will have a Town Hall today at 4 p.m. at Hickam Theater to answer USAF specific questions and will be streamed live on the 15th Wing FB page [Encl (223)]
		Government Leaders	SECNAV toured Red Hill with Navy leaders and had lunch and discussions with Governor Ige [Encls (210), (283)]
	1330L	General Public	SECNAV, CNO and PACFLT DCOM conduct press engagement at PACFLT HQ [Encls (282), (283)]
		Government Leaders	SECNAV participated in a teleconference with the HI Congressional delegation [Encls (210), (283)]
		Government Leaders/Regulators	PACFLT COM and DCOM met with Governor Ige, DOH Director and DOH Deputy Director [Encls (210), (283)]
		Regulators	CNRH Deputy Environmental Director emailed revised sampling plan to DOH [Encl (277)]
		Regulators	DOH requested via email to collect samples at Navy facilities. CNRH Environmental Director agreed and requested that the Navy be allowed to conduct split sampling by taking two or more representative portions from one sample. This was done on 7 Dec [Encls (274-276)]
	1705L/1715L	Military Housing Residents	JBPHH/CNRH FB Posts: The Navy and USAF have authorized partial TLA for active members living in the currently designated housing areas, if they decide to stay in their housing. Navy continues to work on authorization for all other categories of individuals who decide to stay in their homes [Encl (223)]
	1746L/1837L	Military Housing Residents	JBPHH/CNRH FB Posts: Additional laundry services with one-week turn around have been made available at four locations. Addresses and hours included in post [Encl (223)]
	1758L/1759L	Military Housing Residents	CNRH/JBPHH FB Posts: SECNAV, CNO, PACFLT DCOM hold press conference at PACFLT HQ to discuss ongoing water issue earlier today. Press conference recorded video posted [Encl (223)]
			DOH order to suspend operations at Red Hill, treat contaminated water, and remove fuel [Encls (210), (284)]
7-Dec	1917L	Military Housing Residents	JBPHH FB Post: Laundry services are available at four locations. Hours and addresses included [Encl (223)]
	1956L	Military Housing Residents	JBPHH FB Post: Due to weather conditions all water distribution locations and Halsey Terrace shower and laundry facilities will cease operations. Update on resumption of ops will be posted [Encl (223)]
	2158L	Military Housing Residents	JBPHH FB Post: NAVFAC HI posted photos of Seabees delivering water to affected schools and also provided locations of water distribution sites in post [Encl (223)]
	1034L	Military Housing Residents	JBPHH FB Post: Emergency Family Assistance Center (EFAC) is located at the Military & Family Assistance Center (MFSC). The EFAC serves as a consolidated staging area to coordinate care, and services from various orgs for personnel who need it. Phone number and hours provided in post, no appointments necessary [Encl (223)]
	1203L	Military Housing Residents	JBPHH FB Post: Phones at Navy Marine Corps Relief Society are currently down due to the weather. Updates will be made as soon as available [Encl (223)]
		Regulators	CNRH responded to the 4 December formal Request for Records from DOH with sampling plans, sampling procedures, laboratory data, and initial sampling results [Encl (287)]
	2027L	Military Housing Residents	JBPHH FB Post: Phone lines at the EOC have been affected by the current inclement weather conditions. Anyone having issues reaching EOC numbers should try another number on the list. Numbers provided in post [Encl (223)]
			SECNAV order to suspend Red Hill Operations [Encl (67)]

APPENDIX E

Acronyms

ACRONYM FULL DESCRIPTION

ACE	Army Corps of Engineers
ADDU	Additional Duties
ADM	Admiral
AFB	Air Force Base
AFFF	Aqueous Film Forming Foam
AFHE	Automated Fuel Handling Equipment
AOC	Administrative Order on Consent
AMR	Aliamanu Military Reservation
ASD(S)	Assistant Secretary of Defense (Sustainment)
BEC	Base Environmental Coordinator
BFSF	Bulk Fuel Storage Facility
BOD	Beneficial Occupancy Date
BOS	Base Operating Support
BWS	Board of Water Supply
BSO	Budget Submitting Office
C2	Command and Control
CAPT	Captain
CAT	Crisis Action Team
CCIR	Commander's Critical Information Requirements
CCR	Consumer Confidence Report
CCTV	Closed-Circuit Television
CDC	Child Development Center
CDO	Command Duty Officer
CDR	Commander
CEC	Civil Engineering Corps
CHINFO	Navy Office of Information
CHINFO CI	Navy Chief of Information
CHT	Collection, Holding, and Transfer
CTR	Clean, Inspect, and Repair
CMP	Centrally Managed Program
CNIC	Commander, Navy Installations Command
CNO	Chief of Naval Operations
CNPC	Commander, Navy Personnel Command
CNRH	Commander, Navy Region Hawaii
CO	Commanding Officer
COCO	Contractor-owned, Contractor-operated
CODEL	Congressional Delegation
COM	Commander
COMPACFLT	Commander, U.S. Pacific Fleet
COS	Chief of Staff

CPF	Commander, U.S. Pacific Fleet
CRO	Control Room Operator
CSG	Component Steering Group
DCOM	Deputy Commander
DFSP	Defense Fuel Support Point
DOD	Department of Defense
DOH	Hawaii Department of Health
DLA	Defense Logistics Agency
DLA-E	Defense Logistics Agency – Energy
DMHQ	Director, Maritime Headquarters
DTG	Date Time Group
DWCF	Defense Working Capital Fund
DWDSO	Drinking Water Distribution System Operator
EA	Executive Agent
ED	Executive Director
EOC	Emergency Operations Center
EPA	Environmental Protection Agency
ERP	Emergency Response Plan
ESAMS	Enterprise Safety Applications Management System
EXORD	Executive Order
EV	Environmental
EXWC	Expeditionary Warfare Center
F-24	Aviation Turbine Fuel
F-76	Diesel Marine Fuel
FFD	Federal Fire Department
FISC	Fleet Industrial Supply Center
FITREP	Fitness Report
FLC PH	Fleet Logistics Center Pearl Harbor
FMD	Fuels Manager Defense
FOF	Finding of Fact
FOR	Fuel Oil Reclaimed
FORFAC	Fuel Oil Reclaimed Facility
FSD	Facilities Sustainment Directorate
FTE	Full Time Equivalent
GA	Government Affairs
GOCO	Government-owned, Contractor-operated
GOGO	Government-owned, Government-operated
GS	General Schedule
GWPP	Ground Water Protection Plan
HFFC	Hawaii Fuel Facilities Corporation
ICP	Integrated Contingency Plan
IDWST	Interagency Drinking Water System Team
IEM	Installation Emergency Management
IEPD	Installation Environmental Program Director
IG I	Inspector General
INFADS	Internet Navy Facilities Assets Data Store

INDOPACOM	U.S. Indo-Pacific Command
INSURV	Board of Inspection and Survey
ISIC	Immediate Superior in Charge
JBPHH	Joint Base Pearl Harbor-Hickam
JP-5	Jet Propellant 5
LCDR	Lieutenant Commander
LNAPL	Light Non-Aqueous-Phase Liquid
MAV	Material Assist Visits
MBA	Master of Business Administration
MCL	Maximum Containment Level
MFR	Memorandum for the Record
MILCON	Military Construction
MOA	Memorandum of Agreement
MSR	Monthly Status Report
MUIC	Maintenance Unit Identification Code
NAS	Naval Air Station
NAVFAC	Naval Facilities Engineering Systems Command
NAVMAC	Navy Manpower Analysis Center
NAVSEA	Naval Sea Systems Command
NAVSUP	Naval Supply Systems Command
NEX	Navy Exchange
NLEC	Navy Leadership and Ethics Center
NMCPH	Navy Marine Corps Public Health
NOI	Notice of Intent
NOSC	Navy On-Scene Coordinator
NOSC-R	Navy On-Scene Coordinator Representative
NPO	Naval Petroleum Office
O&M, N	Operation and Maintenance, Navy
OHS	Oil and Hazardous Substance
OIC	Officer in Charge
OMB	Office of Management and Budget
OPREP	Operational Report
OSD	Office of the Secretary of Defense
OT	Over Time
PA	Public Affairs
PAO	Public Affairs Officer
PHEO	Public Health Emergency Officer
PIT	Pressure Indicating Transmitter
PM	Preventive Maintenance
PMO	Project Management Office
POL	Petroleum, Oil, and Lubricant
POM	Plan of Management
PPE	Personal Protective Equipment
PPM	Parts Per Million
PPV	Public Private Venture
PSP	Product and Service Plan

PVC	Polyvinyl Chloride
PWO	Public Works Officer
RADM	Rear Admiral Upper Half
RDML	Rear Admiral Lower Half
REC	Regional Environmental Coordinator
RFI	Request for Information
RMMR	Recurring Maintenance and Minor Repair
ROC	Regional Operations Center
RPA	Request Personnel Action
RPE	Regional POL Engineer
RRA	Risk and Resilience Assessment
RTOP	Regional Terminal Operations Program
SC	Supply Corps
SECNAV	Secretary of the Navy
SCBA	Self-Contained Breathing Apparatus
SORM	Standard Organizations and Regulations Manual
SMRD	Shore Manpower Requirements Determination
SNDL	Standard Naval Distribution Listing
SRM	Sustainment, Restoration, and Modernization
SUPO	Supply Officer
SWP	Strategic Workforce Plan
TOC	Total Organic Carbon
TF	Task Force
TLA	Temporary Lodging Allowance
TPH-O	Total Petroleum Hydrocarbons - Oil
UEM	Utilities and Energy Manager
UFC	Unified Facilities Code
USD(A&S)	Under Secretary of Defense (Acquisition and Sustainment)
UM	Utilities Management
UST	Underground Storage Tank
VADM	Vice Admiral
WG	Wage Grade
XO	Executive Officer

APPENDIX F

References

- a) VCNO ltr 5800 Ser N09/22U100519 of 04 Mar 22
- b) RDML Christopher J. Cavanaugh, USN, ltr 5830 of 14 Jan 22 w/encl
- c) COMPACFLT ltr 5830 Ser N00/0076 of 20 Jan 22
- d) CNICINST 5090.4A
- e) OPNAVINST 11320.23G
- f) OPNAVINST 11014.3
- g) OPNAVINST 3440.17
- h) OPNAVINST 4020.27
- i) U.S. Navy Regulations (1990)
- j) COMNAVREGHIINST 3120.2D 9 Mar 2018